

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised May 08, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-005-21160

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Dulce 36 State Com

8. Well Number

1

9. OGRID Number

10. Pool name or Wildcat
Wildcat Morrow Gas

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☒ Other

2. Name of Operator

Chevron USA Inc

3. Address of Operator

15 Smith Rd, Midland, TX, 79705

4. Well Location

Unit Letter F : 1980 feet from the North line and 1980 feet from the West line

Section 36

Township 15-S Range 31-E NMPM Chaves County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE
COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS ☐ PLUG AND
ABANDONMENT ☐


CASING TEST AND
CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion
or recompletion.

1. Notify OCD 24 hrs prior to MI & RU
2. Set 5 1/2 CIBP @ 12450, spot 20sx, plug 12450-12300 (Morrow) WOC Tag
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL
4. Spot 20sx, plug 9000-8000 (Wolfcamp) 255X
5. Spot 20sx, plug 6900-6700 (Tubb) 255X
6. Spot 20sx, plug 5600-5400 (Glorieta) 255X
7. Spot 35sx, plug 4550-4200 (9 5/8 shoe) WOC Tag
8. Cut 5 1/2 csg @ 3000, L/D csg
9. Spot 45sx, plug 3150-2900 (Stub) WOC Tag
10. Spot 35sx, plug 2500-2300 (Yates, B-Salt) WOC Tag
11. Spot 70sx, plug 900-700 (11 3/4 shoe, T-Salt) WOC Tag
12. 10sx surf, install dry hole marker

→ SPOT 255X OR 100' WHICHEVER IS GREATER F/400'-300' FRESH WATER PLUG

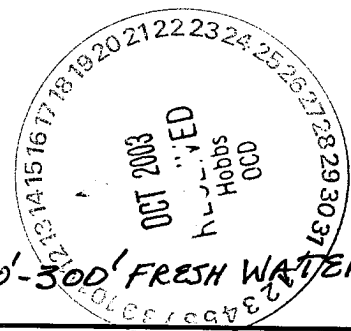

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist

DATE 10/6/2003

Type or print name G.R. Bledsoe

Telephone No. (432) 687-7153

(This space for State use)

APPROVED BY Larry W. Wink TITLE OC DISTRICT SUPERVISOR/GENERAL MANAGER

Conditions of approval, if any

DATE OCT 16 2003

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME DULCE 3/4 STATE COM

WELL # 1

SECT 36 TWN 15-S RNG 31-E

FROM 1330 N/S L 1980 E/W L

TD 12,942 FORMATION @ TD MORROW

PBTD FORMATION @ PBTD

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	11 3/4	802	SURF	Circ
INTMED 1	9 5/8	4498	SURF	Circ
INTMED 2				
PROD	5 1/2	12,942	3000	CALC.

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	12,530 - 12,604
INTMED 2	OPENHOLE	
PROD	3000'	

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP	20	12,450
YATES	2	WOLF CAMP	20	9000
QUEEN	3	TUBB	20	6900
GRAYBURG	4	GLORIETA	20	5600
SAN ANDRES	5	9518 S	35	4550
	6	STUB	45	3150
CAPITAN REEF	7	YATES	35	2500
	8	11 3/4 S	70	900
DELAWARE	9	SURF	10	10
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				

MLF

11 3/4

MLF

@ 802

TOC SURF

MLF

MLF

9 5/8

@ 4498

TOC SURF

MLF

MLF

MLF

MLF

5 1/2

@ 12,942

TOC 3000

TD 12,942