Form 3160-5 (April 2004)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

QCD-HOBB\$

FORM APPROVED OMB NO. 1004-0137


Expires March 31, 2007

5. Lease Serial No.

Do not use this form for proposals to drill or to re-enter an

i	LC	0316	22A
	6.	If Indian,	Allottee or Tribe Name

abandoned well. Use Form	n 3160-3 (APD) for s	ich proposits.						
SUBMIT IN TRIPLICATE - (7 If Unit or CA/Agreement, Name and/or No NM 70948B						
1 Type of Well X Oil Well Gas Well Other 2 Name of Operator XTO Energy, Inc.	HOE	Y 2 2 2008 BS OC		8. Well Name and No. EUNICE MONUMENT #873 SOUTH UNIT B 9. API Well No.				
3a. Address	31	Phone No. (include ar		30-025-04276				
200 LORAINE, STE. 800 MIALAND, T. 4 Location of Well (Footage, Sec., T., R., M., or Survey L 330' FNL & 660' FWL SEC. 14 TWN 20-S R 36-E		432-620-6740	[·	10. Field and Pool, or Exploratory Area EUNICE MONUMENT; GRAYBURG SAN ANDRES 11. County or Parish, State				
40 OUECK ADDDODDATE	0.111 -	ATE NATURE OF		LEA CTY / NM				
12. CHECK APPROPRIATE	· · · · · · · · · · · · · · · · · · ·	RI, OR OTHER DATA						
TYPE OF SUBMISSION X Notice of Intent Subsequent Report Final Abandonment Notice	Acidize Alter Casing Casing Repair Change Plans Convert to Injection	Deepen Fracture Treat New Construction Plug and Abandon Plug Back	PE OF ACTION Production (S Reclamation Recomplete Temporarily Water Dispose	Neactivate				
3 - Describe Proposed or Completed Operation (clearly state all pertinent details, mubding estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.) 1. MIRU PU. MI and rack up 4,200' of 2-7/8" J-55 WS. ND WH. NU BOP. RIH W/4-3/4" bit & DC's on 2-7/8" WS. 2. Drill out CIBP 03,700' and clean well out to TD 04,125'. Circulate hole clean. P00H w/bit, DC's, & WS. 3. PB to +/-3,962' w/20/40 mesh sand. Will need 13.2# sand per foot of open hole to plug back. If PBTD is 4,125', 2,152# of sand will be needed. 4. RIH & tag sand. PBTD should be close to 3,962'. RU WL & dump 3 sks of Class "C" cement + 2% bentonite on top of sand plug. Mix cement w/22 gals total water. Plug back well to +/-3,925'. 5. WOC & tag cement plug. RD WL. PU & RIH w/Sonic Hammer on 2-7/8" workstring. RU stripping head. 6. MIRU acid co. Sonic Hammer openhole w/75 bbls brine while circulating to reverse pit. Circulate hole clean. Close in backside and SH openhole from 3,751-3925' w/2,500 gals 20% AcidTol (90/10) in injection mode. Flush acid with 40 bbls water. Drop ball to shift sleeve in tool. RDMO acid company. 7. Flow back or RU swab and swab back acid load. Determine flow rate and oil cut. POOH w/SH & WS. ND BOP. NU WH. RIH w/production equipment based on a rate derived from swab results. Assume initial rat								
Name (Printed/Typed)Kristy Ward			conv. Anallist	IVIAT 1 5 2500				
Buty Ward		Date 05/05/08	cory Analyst	JAMES A. AMOS SUPERVISOR-EPS				
	SPACE FOR FEDER	AL OR STATE OFF	ICE USE					
Approved by Chicklelliam OCD STMCT SITE Title Date Date								
Conditions of approval, if any, are attached. Approval of certify that the applicant holds legal or equitable title to the which would entitle the applicant to conduct operations the	this notice does not warranthose rights in the subject	nt or Office	ICKUI MARKAL	# N N N N N N N N N N N N N N N N N N N				

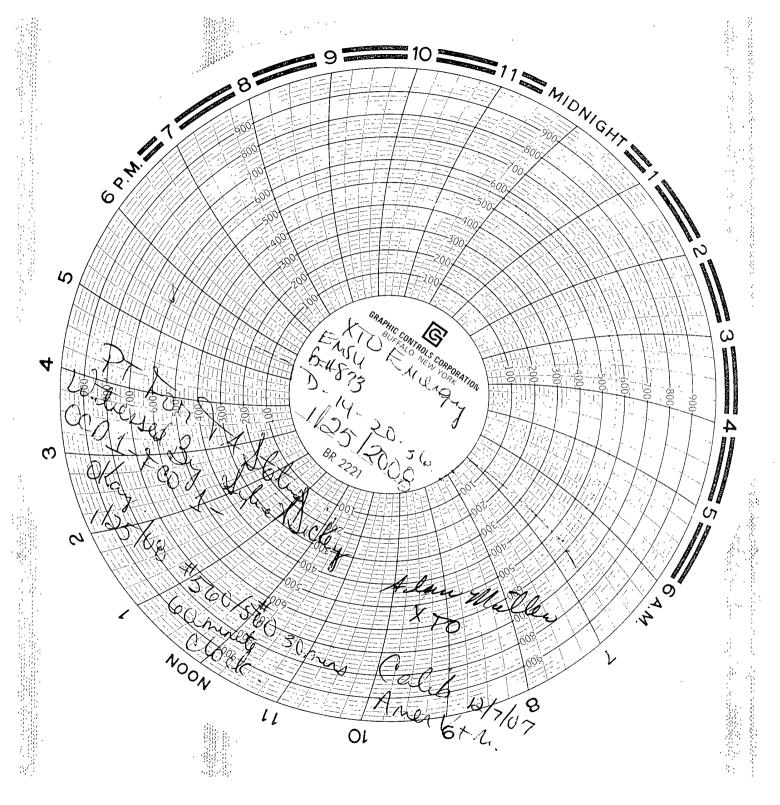

A STANSON

e krije zasaminim 136 kilikiba v na Na rij