

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)


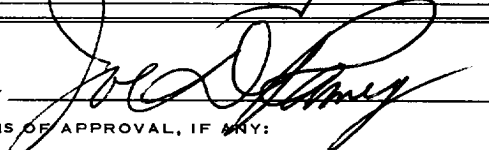
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Tom L. Ingram		8. Farm or Lease Name Cryer
3. Address of Operator P. O. Box 1757, Roswell, New Mexico 88201		9. Well No. 1
4. Location of Well UNIT LETTER L , 1980 FEET FROM THE South LINE AND 660 FEET FROM THE West LINE, SECTION 34 TOWNSHIP 10S RANGE 36E NMPM.		10. Field and Pool, or Wildcat Dickinson
15. Elevation (Show whether DF, RT, GR, etc.) 4005 Gr		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER Testing <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Perforated 19 holes 11,441-11,450'. Acidized w/500 gals. mud acid. Re-acidized w/1000 gals. mud acid.
Swabbed 2 BOPH.
Perforated 20 holes 11,249-259. Swabbed 10-15 Bbls. salt water per hr. with packer set at 11,347'. Re-acidized Perfs. 11,441-11,450 with 2000 gals. special acid.
Swabbed 2 BOPH.
Perforated 11,282-11,304 with 2 shots per foot.
Swabbed 8-10 bbls. water per hr. Reset packer at 11,352' and installed rods and pump.
Now pump testing.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Operator	DATE 11-5-68
APPROVED BY 	TITLE SUPERVISOR DISTRICT 6	DATE NOV 7 1968
CONDITIONS OF APPROVAL, IF ANY:		