

NEW MEXICO OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut-off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below:

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	X		

Hobbs, New Mexico

January 4, 1943

Place

Date

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO.

Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the

The Ohio Oil Company's State McCormick

Well No. 1 in the

Company or Operator

Lease

NE 1/4

of Sec. 36

T. 9S

R. 37E

N. M. P. M.,

Wildcat Well

Field,

Lea

County.

The dates of this work were as follows: December 22 to 28, 1942

Notice of intention to do the work was ~~submitted~~ submitted on Form C-102 on December 2, 1942 19and approval of the proposed plan was ~~obtained~~ obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

Circulated hole with mud and ran 12 sacks cement from 4,993' up to 4,848'. Set 24 hours and then ran tubing back and set weight of tubing on plug. Shot 4 1/2" casing off at 1,528'. Filled hole with mud up to 1,550'; bridged hole 10' and set 20 sacks cement 1,540' up to 1,489'. Set 24 hours. Pulled tubing up and ran mud to 210'. Bridged hole to 202' and set 10 sacks cement 202' up to 184'. Pulled tubing up and ran mud to 25'. Bridged hole to 17' and set 10 sacks cement to surface. Set 4" pipe marker 4' above ground. Did not pull surface pipe.

Witnessed by Paul B. Stewart The Ohio Oil Company Foreman
Name Company Title

Subscribed and sworn before me this

4th day of January, 1943



Notary Public

My commission expires July 10, 1945

I hereby swear or affirm that the information given above is true and correct.

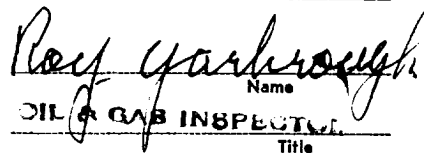
Name J. G. Bascom

Position District Foreman

Representing The Ohio Oil Company
Company or Operator

Address P. O. Box 1607, Hobbs, N. M.

Remarks:


Name
OIL & GAS INSPECTOR
Title