

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: STEVENS B-7 Well Location: T23S / R37E / SEC 7 / County or Parish/State: LEA /

SWSW /

Well Number: 11 Type of Well: CONVENTIONAL GAS **Allottee or Tribe Name:**

Unit or CA Number: Lease Number: NMLC030556B **Unit or CA Name:**

US Well Number: 3002510661 Well Status: Producing Gas Well **Operator:** APACHE

CORPORATION

Notice of Intent

Type of Action Plug and Abandonment Type of Submission: Notice of Intent

Date Sundry Submitted: 03/16/2021 Time Sundry Submitted: 10:51

Date proposed operation will begin: 04/16/2021

Procedure Description:

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

SUNDRY_NOI_SUB___Stevens_B_011_3_16_21_20210316105006.pdf

Conditions of Approval

Specialist Review

Stevens_B_7_11_20210403131703.pdf

Accepted for Record Only

NMOCD

Page 1 of 2

6/17/21

eceived by OCD: 5/21/2021 9:05:31 AM

Well Location: T23S / R37E / SEC 7 /

SWSW /

County or Parish/State: LEA/

1

Well Number: 11

Type of Well: CONVENTIONAL GAS

WELL

Lease Number: NMLC030556B Unit or CA Name:

Unit or CA Number:

Allottee or Tribe Name:

US Well Number: 3002510661

Well Status: Producing Gas Well

Operator: APACHE CORPORATION

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: GILBREATH Signed on: MAR 16, 2021 10:50 AM

Name: APACHE CORPORATION

Title: P& A Asst

Street Address: 303 VETERANS AIR PARK LN

City: Midland State: TX

Phone: (432) 818-1103

Email address: dianne.gilbreath@apache.com

Field Representative

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: ZOTA M STEVENS BLM POC Title: Petroleum Engineer

BLM POC Phone: 5752345998 BLM POC Email Address: ZSTEVENS@BLM.GOV

Disposition: Approved **Disposition Date:** 04/03/2021

Signature: Zota Stevens

Page 2 of 2

Final Abandonment Notice

Other

Received by OCD: 5/21/2021 9:05:31 AM Form 3160-5 FORM APPROVED UNITED STATES (March 2012) OM B No. 1004-0137 DEPARTMENT OF THE INTERIOR Expires: October 31, 2014 BUREAU OF LAND MANAGEMENT 5. Lease Serial No. LC 030556B SUNDRY NOTICES AND REPORTS ON WELLS 6. If Indian, Allottee or Tribe Name Do not use this form for proposals to drill or to re-enter an abandoned well Use Form 3160-3 (APD) for such proposals SUBMIT IN TRIPLICATE - Other instructions on reverse side. 7. If Unit of CA / Agreement, Name and/or No. Type of Well 071030556B 8. Well Name and No. Oil Well Gas Well Stevens "B" #011 2. Name of Operator 9. API Well No. **Apache Corporation** 30.025.10661 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory Area 303 Veterans Airpark Ln, Midland, Tx 79705 432-556-9143 **Jalmat Yates Gas** 11. County or Parish, State UI-M, Sec 07, T23S, R37E 990 FSL & 990 FWL 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Production (Start/Resume) Water Shut-off Acidize Deepen ✓ Notice of Intent Well Integrity Fracture Treat Reclamation Alter Casing New Construction Recomplete Subsequent Report Casing Repair

Change Plans

Convert to Injection

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the bond No. on file with the BLM / BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

✓ Plug and Abandon

Plug Back

Temporarily Abandon

Apache Corporation proposes to P&A the above mentioned well by the attached procedure. A closed loop system will be used for all fluids from this wellbore and disposed of required by **OCD Rule 19.15.17.**

14. I hereby certify th	nat the following is true and correct				
Name		1			
	Guinn Burks	Title	Sr. Reclamat	ion Foreman	
Signature	Guínn Burks	Date	12/2	2/20	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE					
Approved by		Title		Date	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operatins thereon.		Office			

Title 18 U.S.C., Section 1001 and Title 43 U.S.C., Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.


(Instructions on page 2)

4	pache
WELL	BORE INFO.

LEASE NAME	Stevens B
WELL#	#011
API#	30.025.10661
COUNTY	LEA, NM

DEPTH SX/CMT

	WELL BORE INFO.	_ п _
0		
·		
143		
0		
285		
428		
571		
714		
856		
999		
1142		
	11" Hole	
1284	7 5/8" ?# @ 1221' w/ 500 sx to surf	
.20.		
1427	Top of Salt @ 1325'	
1570		
1713		
1855		
1000		
1998		
	_	
2141		
2283		
2426		
	Prod equipment still in hole	
2569		
2711	Base of salt @ 2790' 7 3/8" Hole	
	5 1/2" 15.5# @ 2789'	
2854	w/ 500 sx Cal to surf	i i
2004		! !\
2997		
2001		/i i
3140	Yates/7 Rvrs @ 2830'-3134'_	{
0170		
3282		i i/
		(! !
3425	4" Slotted Liner @ 2728'-3415' OH @ 2789'-3425'	\
		<u> </u>
		TD @ 3425'

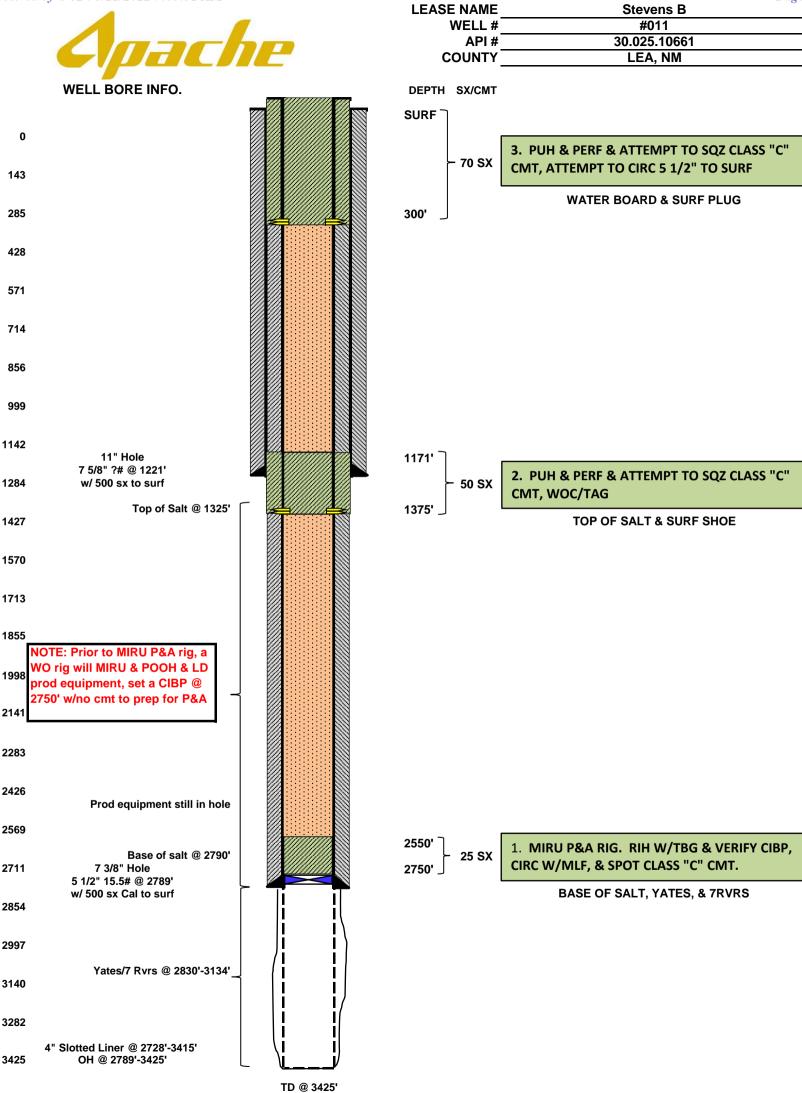

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90^{th} day provide this office, prior to the 90^{th} day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 29070

CONDITIONS

Operator:		OGRID:	
	APACHE CORPORATION	873	
	303 Veterans Airpark Ln	Action Number:	
	Midland, TX 79705	29070	
		Action Type:	
		[C-103] NOI Plug & Abandon (C-103F)	

CONDITIONS

Created By	Condition	Condition Date
kfortner	SEE ATTACHED CONDITIONS OF APPROVAL	6/17/2021