

Well Name: WEST BISTI COAL 25	Well Location: T25N / R13W / SEC 25 / SENW / 36.375287 / -108.173603	County or Parish/State: SAN JUAN / NM
Well Number: 2T	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM61273	Unit or CA Name:	Unit or CA Number:
US Well Number: 3004532233	Well Status: Gas Well Shut In	Operator: DJR OPERATING LLC

Notice of Intent

Sundry ID: 2707542

Type of Submission: Notice of Intent	Type of Action: Plug and Abandonment
Date Sundry Submitted: 12/15/2022	Time Sundry Submitted: 07:51
Date proposed operation will begin: 12/15/2022	

Procedure Description: DJR Operating, LLC requests permission to Plug & Abandon the subject well according to the attached Procedure, Current/Proposed Wellbore Diagram and Reclamation Plan.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

NOI_PA_BLM_20221215075048.pdf

Received by OCD: 12/19/2022 2:45:41 PM

Page 2 of 10

Well Name: WEST BISTI COAL 25	Well Location: T25N / R13W / SEC 25 / SENW / 36.375287 / -108.173603	County or Parish/State: SAN JUAN / NM
Well Number: 2T	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM61273	Unit or CA Name:	Unit or CA Number:
US Well Number: 3004532233	Well Status: Gas Well Shut In	Operator: DJR OPERATING LLC

Conditions of Approval

Specialist Review

2707542_NOIA_25_2T_3004532233_KR_12162022_20221216103249.pdf
General_Requirement_PxA_20221216103236.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: SHAW-MARIE FORD	Signed on: DEC 15, 2022 07:50 AM
Name: DJR OPERATING LLC	
Title: Regulatory Specialist	
Street Address: 1 Road 3263	
City: Aztec	State: NM
Phone: (505) 632-3476	
Email address: sford@djrlc.com	

Field

Representative Name:		
Street Address:		
City:	State:	Zip:
Phone:		
Email address:		

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK	BLM POC Title: Petroleum Engineer
BLM POC Phone: 5055647742	BLM POC Email Address: krennick@blm.gov
Disposition: Approved	Disposition Date: 12/16/2022
Signature: Kenneth Rennick	

Plug and Abandonment Procedure
for
DJR Operating, LLC
West Bisti Coal 25 Com 2T
API # 30-045-32233
SE/NW, Unit F, Sec. 25, T25N, R13W
San Juan County, NM

1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.
2. Check and record tubing, casing and bradenhead pressures.
3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
4. Trip out of hole with rods and pump. Lay down to be sent in for storage/salvage.
5. ND WH, NU BOP, function test BOP.
6. Trip out of hole with 2 3/8" tubing. LD tubing to be sent in for storage/salvage.
7. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 1020'. TOOH.
8. PU and RIH with a 5 1/2" cement retainer. Set the CR at +/- 1110'. Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.
9. RU cement equipment. Pump water to ensure that tubing is clear.
10. Plug 1. Mix and attempt to squeeze 10 sx cement through cement retainer. If zone pressures up, sting back out of retainer and continue with Plug 2.
11. Plug 2. Fruitland, Kirtland, Ojo Alamo, surface casing shoe, and surface plug. From 1110' to surface, mix and pump cement until cement circulation is achieved at surface.
12. RD cementing equipment. Cut off wellhead, fill annuli with cement as necessary. Install P&A marker as per regulatory requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.

13. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.

14. Send all reports and attachments to DJR Aztec office for regulatory filings.

Note: All cement is to be either Class G mixed at 15.8 ppg, yield 1.15 cu ft / sx, or type II/V mixed at 15.0 ppg, yield 1.29 cu ft/sx, depending on availability. Cement volumes are based on inside capacities + 50' excess and outside capacities + 100% excess.

DJR Operating, LLC

Current Wellbore Diagram

West Bisti Coal 25 Com 2T

API # 30-045-32233

SE/NW, Unit F, Sec 25, T25N, R13W
San Juan County, NM

GL 6370'

KB 6382'

Spud Date 1/10/2006

SURF CSG


Hole size 12.25"
Csg Size: 8.625"
Wt: 24#
Grade: K-55
ID: 6.336"
Depth 147'
casing cap ft³/ft: 0.3575
TOC: Circ cmt
to surface

FORMATION TOPS

Nacimiento	Surface
Ojo Alamo	N/A
Kirtland	172'
Fruitland	904
Pictured Cliffs	1190'

PROD CSG

Hole size 7.625"
Csg Size: 5.5"
Wt: 15.5#
Grade: J-55
ID: 4.95"
Depth 1372'
casing cap ft³/ft: 0.1336
8.625x5.5 cap ft³/ft: 0.1926
TOC: Circ cmt
to surface

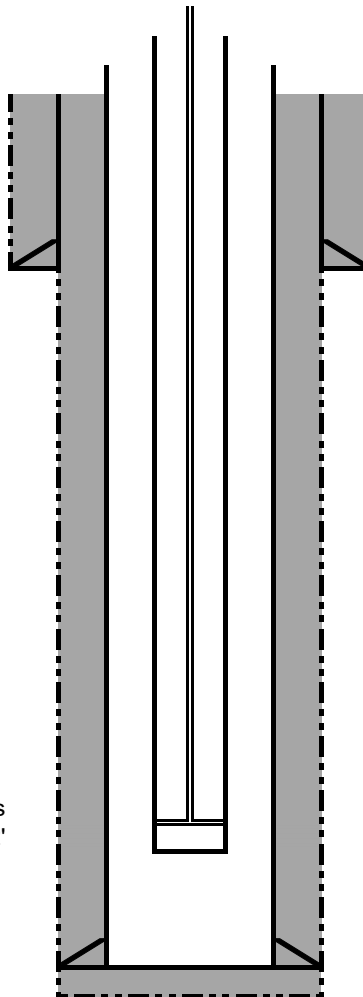Fruitland Coal perms
1138-1182'PBTD 1331'
TD 1380'**Production Tubing/Rod Detail**

NC, 1 jt. 2.375" tbg, SN, 36 jts. 2.375" tbg. EOT 1207'. SN at 1175'.
2"x1.5"x12' RWAC, 4' stabilizer sub,
4x7/8" K bars, 42x3/4" rods, 12' polished
rod with 8' liner.

12/15/2022

DJR Operating, LLC
Proposed Wellbore Diagram

West Bisti Coal 25 Com 2T

API # 30-045-32233

SE/NW, Unit F, Sec 25, T25N, R13W
 San Juan County, NM

GL 6370'

KB 6382'

Spud Date 1/10/2006

SURF CSG

Hole size 12.25"

Csg Size: 8.625"

Wt: 24#

Grade: K-55

ID: 6.336"

Depth 147'

casing cap ft3/ft: 0.3575

TOC: Circ cmt

to surface

FORMATION TOPS

Nacimiento Surface

Ojo Alamo N/A

Kirtland 172'

Fruitland 904

Pictured Cliffs 1190'

PROD CSG

Hole size 7.625"

Csg Size: 5.5"

Wt: 15.5#

Grade: J-55

ID: 4.95"

Depth 1372'

casing cap ft3/ft: 0.1336

8.625x5.5 cap ft3/ft 0.1926

TOC: Circ cmt

to surface


Cement Ret. 1110'

Fruitland Coal perms

1138-1182'

PBTD 1331'

TD 1380'

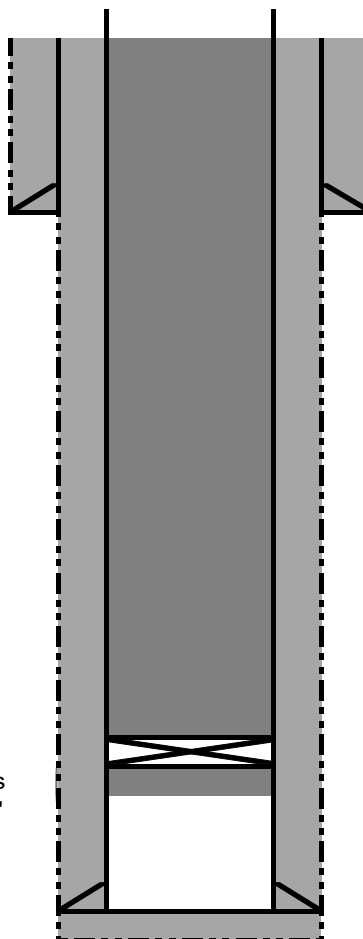

Plug 2: 1110' to surface, to cover Fruitland, Kirtland, Ojo Alamo, surface shoe.

Plug 1: Attempt to pump 10 sx through CR to Fruitland perms.

**GENERAL REQUIREMENTS FOR
PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES
FARMINGTON FIELD OFFICE**

- 1.0 The approved plugging plans may contain variances from the following minimum general requirements.
- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
- 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
- 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 **A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.**

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. **If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.**

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H₂S.

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

**UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
6251 COLLEGE BLVD.
FARMINGTON, NEW MEXICO 87402**

AFMSS 2 Sundry ID 2707542

Attachment to notice of Intention to Abandon

Well: West Bisti Coal 25 2T

*Fill Up Wellbore Proposal, Geology Report Not Applicable

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 12/16/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 168417

CONDITIONS

Operator: DJR OPERATING, LLC 1 Road 3263 Aztec, NM 87410	OGRID: 371838
	Action Number: 168417
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	12/22/2022
kpickford	Adhere to BLM approved COAs and plugs. See BLM COAs and GEO report.	12/22/2022