Submit 1 Copy To Appropriate District

Office	State of New Me	exico	Form C-103
District I - (575) 393-6161	Energy, Minerals and Natu	ıral Resources	Revised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION	DIVISION	30-005-63922
<u>District III</u> – (505) 334-6178	1220 South St. Fran	ncis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM 87	7505	STATE X FEE
1220 S. St. Francis Dr., Santa Fe, NM	,		6. State Oil & Gas Lease No.
87505			306692
(DO NOT USE THIS FORM FOR PROP	FICES AND REPORTS ON WELLS OSALS TO DRILL OR TO DEEPEN OR PLU ICATION FOR PERMIT" (FORM C-101) FO	UG BACK TO A	7. Lease Name or Unit Agreement Name Sycamore
	Gas Well X Other		8. Well Number 001
2. Name of Operator			9. OGRID Number
Wespac Energy, LLC			260245
3. Address of Operator			10. Pool name or Wildcat
8620 N. New Braunfels Ave. S	Suite 603, San Antonio, TX 78217		Lost Lake; Strawn
4. Well Location			
Unit LetterN:	660feet from theSouth_	line and	feet from theWestline
Section 36	Township 8S R	Range 29E	NMPM Chaves County
	11. Elevation (Show whether DR,	RKB, RT, GR, etc.	
		*	
12. Check	Appropriate Box to Indicate N	ature of Notice,	Report or Other Data
NOTICE OF I	NITENTION TO	l OUE	OCCUPAT DEPORT OF
PERFORM REMEDIAL WORK	NTENTION TO: PLUG AND ABANDON X	REMEDIAL WOR	SSEQUENT REPORT OF: RK
TEMPORARILY ABANDON			RILLING OPNS. □ P AND A XX
PULL OR ALTER CASING		CASING/CEMEN	
DOWNHOLE COMMINGLE	\$17-025 -000 \$30 F Med 2004 30 -000 \$200 \$300 \$300 \$300 \$300 \$300 \$300 \$	O/ (OINO/OLIVIE)	11 JOB
OTHER:		OTHER:	
	ork). SEE RULE 19.15.7.14 NMAC		nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of
	SEE ATTA	CHED bo	proved for plugging of well bore only. Liability under and is retained pending Location cleanup & receipt of
			103Q (Subsequent Report of Well Plugging) which ay be found at OCD Web Page, OCD Permitting @
			ww.emnrd.state.nm.us
		_	
hereby certify that the information	above is true and complete to the be	est of my knowledg	ge and belief.
014	G		/ /
	Fig /	la 1	1/19/2/
SIGNATURE ///e //.	TITLE //	larager	DATE 1/1/129
Type or print name / Lyle	D Ford E-mail address	V fan(a)	ford resources Com (210)310-31
For State Use Only	E-man address	1010 00	PHONE: CAID JOINT

Staff Manager

TITLE_

State of New Mexico

Released to Imaging: 3/7/2024 3:21:58 PM

3/7/24


Form C-103

Plugging Report Wespac Energy, LLC Sycamore #1 API 30-005-63922

- 11/13/2023 Moved in rig and equipment. Set matting board and rigged up. Worked to remove the wellhead bolts.
- 11/14/2023 Killed well and installed BOP. Released packer, POOH with tubing. 131 stands 2 3/8" tubing and an Arrow set packer. Set 5.5" CIBP at 8320'.
- 11/15/2023 Tagged CIBP with tubing at 8320'. Circulated MLF and tested casing. Good to 600#. Spot 25 sx Class H cement on top of CIBP. POOH and SION.
- 11/16/2023 Tagged cement at 8104'. POOH to 7632' and spot 25 sx Class H cement. POOH to 6901' and spot 25 sx Class H cement. POOH and SION.
- 11/17/2023 Spot 25 sx Class C cement at 6205'. POOH to 5501' and spot 25 sx cement. POOH to 3879' and spot 25 sx cement. POOH with tubing and shot on circulating hole at 3000'. Set packer and gained good circulation with intermediate head. POOH with tubing and started removing bolts from top spool.
- 11/20/2023 Removed top spool and welded on 5.5" 17# pull stub. Cut casing at 3000'. Laid down 5 ½" casing and reassembled the wellhead.
- 11/21/2023 RIH with tubing to 3052' and circulated MLF until balanced. Spot 50 sx Class C cement with CaCl at 3052'. WOC and tagged at 2925'. POOH to 2555' and spot 50 sx cement. POOH and SION.
- 11/22/2023 Tagged cement at 2413'. Caught circulation and tested to 500# and held. POOH to 1367' and spot 25 sx cement. POOH to 985' and spot 25 sx cement. POOH to 425' and circulated cement to surface with 115 sx cement. Lay down remaining tubing and rig down.
- 11/27/2023 Dug out and removed the wellhead. Good cement to surface in both strings. Installed marker, removed the anchors and cleaned the pit.

Received by OCD: 1/17/2024 4:34:11 PM

Wespac Energy, LLC Sycamore #1 API 30-005-63922 WBD After PA

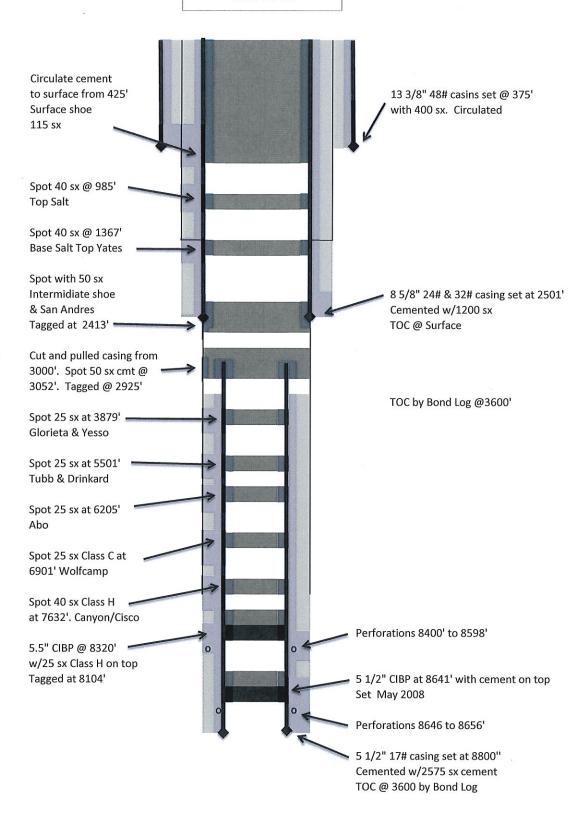

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 304737

COMMENTS

Operator:	OGRID:
WESPAC ENERGY, LLC	260245
8620 North New Braunfels Ave.	Action Number:
San Antonio, TX 78217	304737
	Action Type:
	[C-103] Sub. Plugging (C-103P)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM.	3/7/2024

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 304737

CONDITIONS

Operator:	OGRID:
WESPAC ENERGY, LLC	260245
8620 North New Braunfels Ave.	Action Number:
San Antonio, TX 78217	304737
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	3/7/2024