
	AM State of New Mex	xico	Form C-103
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Natur	ral Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	077 00000000000000000000000000000000000		WELL API NO. 30-025-33775
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION		5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fran		STATE FEE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87	303	6. State Oil & Gas Lease No.
87505	TICES AND REPORTS ON WELLS		
(DO NOT USE THIS FORM FOR PROP	OSALS TO DRILL OR TO DEEPEN OR PLU	G BACK TO A	7. Lease Name or Unit Agreement Name Northeast Pearl Queen Unit
PROPOSALS.)	ICATION FOR PERMIT" (FORM C-101) FO	R SUCH	8. Well Number.
1. Type of Well: Oil Well	Gas Well Other		028
2. Name of Operator	eitburn Operating LP		9. OGRID Number. 370080
3. Address of Operator			10. Pool name or Wildcat
	reet, Ste. 2900 Houston, TX 77002		(49780) Pearl; Queen
4. Well Location			
Unit LetterN: Sectional 15			2310feet from theWestline
Sectional 15	Township 19S Range 11. Elevation (Show whether DR,		MPM. County Lea
	3677		
12. Check A	appropriate Box to Indicate Nat	ure of Notice,	Report or Other Data
NOTICE OF I	NTENTION TO:	SUE	BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WO	RK ALTERING CASING
TEMPORARILY ABANDON DULL OR ALTER CASING	CHANGE PLANS		RILLING OPNS. PAND A
PULL OR ALTER CASING DOWNHOLE COMMINGLE	MULTIPLE COMPL	CASING/CEMEN	NT JOB ☐ PNR
CLOSED-LOOP SYSTEM			
OTHER:		OTHER:	
			d give partinent dates including estimated data
13. Describe proposed or complete of starting any proposed wo	rk). SEE RULE 19 15 7 14 NMAC	For Multiple Cor	unletions: Attach wellhore diagram of
of starting any proposed wo proposed completion or reco	rk). SEE RULE 19.15.7.14 NMAC.	For Multiple Cor	npletions: Attach wellbore diagram of
of starting any proposed wo	rk). SEE RULE 19.15.7.14 NMAC.	For Multiple Cor	npletions: Attach wellbore diagram of
of starting any proposed wo	rk). SEE RULE 19.15.7.14 NMAC.	For Multiple Cor	npletions: Attach wellbore diagram of
of starting any proposed wo proposed completion or reco	rk). SEE RULE 19.15.7.14 NMAC.	For Multiple Cor	mpletions: Attach wellbore diagram of
of starting any proposed wo proposed completion or reco	rk). SEE RULE 19.15.7.14 NMAC. ompletion.	For Multiple Cor	npletions: Attach wellbore diagram of
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 51/	rk). SEE RULE 19.15.7.14 NMAC. ompletion.	For Multiple Cor	mpletions: Attach wellbore diagram of
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 51/6/04/24—Cap BP w/ 25 sxs CTOC @6/05/24—Ok'd to spot 30 sxs @ 385	rk). SEE RULE 19.15.7.14 NMAC. ompletion. 2 CIBP @ 4850' tagged circ well w/ N 2 4603' WOC Tag @ 4640', perf @ 3 4' CTOC @ 3554' WOC Tag @ 3550	For Multiple Cor MLF. 8800' no rate.	npletions: Attach wellbore diagram of
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'.	For Multiple Cor MLF. 8800' no rate. 9', perf @ 3425'.	npletions: Attach wellbore diagram of
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5'/ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025'	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N	For Multiple Cor MLF. 8800' no rate. 9', perf @ 3425'.	WOC Tag @ 2710', perf @ 450' no rate ok'd
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' ne	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. 2 rate ok'd to spot 50 sxs from 190' to	MLF. 8800' no rate. 3425'. CTOC @ 2779'	woc Tag @ 2710', perf @ 450' no rate ok'd
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5'/ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385. 6/06/24—Ok'd to spot 30 sxs @ 348. 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTO	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. 2 rate ok'd to spot 50 sxs from 190' to	MLF. 8800' no rate. 3425'. CTOC @ 2779'	woc Tag @ 2710', perf @ 450' no rate ok'd
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' ne	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. 2 rate ok'd to spot 50 sxs from 190' to	MLF. 8800' no rate. 3425'. CTOC @ 2779'	woc Tag @ 2710', perf @ 450' no rate ok'd
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' ne	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. 2 rate ok'd to spot 50 sxs from 190' to	MLF. 1800' no rate. 1900', perf @ 3425'. 1900' o surface verified	woc Tag @ 2710', perf @ 450' no rate ok'd
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' ne 6/10/2024 - Surface casing cut an	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ M 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. 2 or rate ok'd to spot 50 sxs from 190' to d capped	MLF. 1800' no rate. 1900', perf @ 3425'. 1900' o surface verified	woc Tag @ 2710', perf @ 450' no rate ok'd
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 51/6/04/24—Cap BP w/ 25 sxs CTOC @6/05/24—Ok'd to spot 30 sxs @ 385/6/06/24—Ok'd to spot 30 sxs @ 348/6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' nc 6/10/2024 - Surface casing cut an Spud Date:	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ M 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' coc @ 259'. 2 rate ok'd to spot 50 sxs from 190' to d capped Rig Release Date:	MLF. 8800' no rate. 0', perf @ 3425'. CTOC @ 2779' vo surface verified	woc Tag @ 2710', perf @ 450' no rate ok'd RDMO.
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' ne 6/10/2024 - Surface casing cut an	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ M 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. 1 no rate ok'd to spot 30 sxs @ 3075' coc @ 259'. 2 rate ok'd to spot 50 sxs from 190' to d capped Rig Release Date:	MLF. 8800' no rate. 0', perf @ 3425'. CTOC @ 2779' vo surface verified	woc Tag @ 2710', perf @ 450' no rate ok'd RDMO.
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTO 6/10/24—Tag @ 190' perf @ 150' ne 6/10/2024 - Surface casing cut an Spud Date:	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. or rate ok'd to spot 50 sxs from 190' to d capped Rig Release Date:	MLF. 1800' no rate. 1', perf @ 3425'. CTOC @ 2779' Volume of my knowledge	WOC Tag @ 2710', perf @ 450' no rate ok'd RDMO.
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 51/6/04/24—Cap BP w/ 25 sxs CTOC @6/05/24—Ok'd to spot 30 sxs @ 385/6/06/24—Ok'd to spot 30 sxs @ 348/6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' nc 6/10/2024 - Surface casing cut an Spud Date:	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ N @ 4603' WOC Tag @ 4640', perf @ 34' CTOC @ 3554' WOC Tag @ 35504' CTOC @ 3188'. no rate ok'd to spot 30 sxs @ 3075' oc @ 259'. or rate ok'd to spot 50 sxs from 190' to d capped Rig Release Date:	MLF. 1800' no rate. 1', perf @ 3425'. CTOC @ 2779' Volume of my knowledge	WOC Tag @ 2710', perf @ 450' no rate ok'd RDMO.
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTO 6/10/24—Tag @ 190' perf @ 150' ne 6/10/2024 - Surface casing cut an Spud Date: I hereby certify that the information a	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ M	MLF. 1800' no rate. 1900' no rate. 1	WOC Tag @ 2710', perf @ 450' no rate ok'd RDMO. e and belief. DATE6/13/24
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5½ 6/04/24—Cap BP w/ 25 sxs CTOC @ 6/05/24—Ok'd to spot 30 sxs @ 385 6/06/24—Ok'd to spot 30 sxs @ 348 6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTO 6/10/24—Tag @ 190' perf @ 150' ne 6/10/2024 - Surface casing cut an Spud Date: I hereby certify that the information a	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ M 2 4603' WOC Tag @ 4640', perf @ 3 4' CTOC @ 3554' WOC Tag @ 3550 4' CTOC @ 3188'. no rate ok'd to spot 30 sxs @ 3075' or rate ok'd to spot 50 sxs from 190' to d capped Rig Release Date: Dimero E-mail address:	MLF. 1800' no rate. 1900', perf @ 3425'. 1900' of my knowledge	WOC Tag @ 2710', perf @ 450' no rate ok'd RDMO. e and belief. DATE6/13/24 PHONE:432-212-9165
5/30/24—MIRU. 6/03/24—RIH w/ GR to 4900' set 5'/6/04/24—Cap BP w/ 25 sxs CTOC @6/05/24—Ok'd to spot 30 sxs @ 385/6/06/24—Ok'd to spot 30 sxs @ 348/6/07/24—Tag @ 3445' perf @ 3025' to spot 25 sxs @ 506' CTC 6/10/24—Tag @ 190' perf @ 150' nc 6/10/2024 - Surface casing cut an Spud Date: I hereby certify that the information a SIGNATURE	rk). SEE RULE 19.15.7.14 NMAC. completion. 2 CIBP @ 4850' tagged circ well w/ M 2 4603' WOC Tag @ 4640', perf @ 3 4' CTOC @ 3554' WOC Tag @ 3550 4' CTOC @ 3188'. no rate ok'd to spot 30 sxs @ 3075' or rate ok'd to spot 50 sxs from 190' to d capped Rig Release Date: Dimero E-mail address:	MLF. 1800' no rate. 1900', perf @ 3425'. 1900' of my knowledge	WOC Tag @ 2710', perf @ 450' no rate ok'd RDMO. e and belief. DATE6/13/24

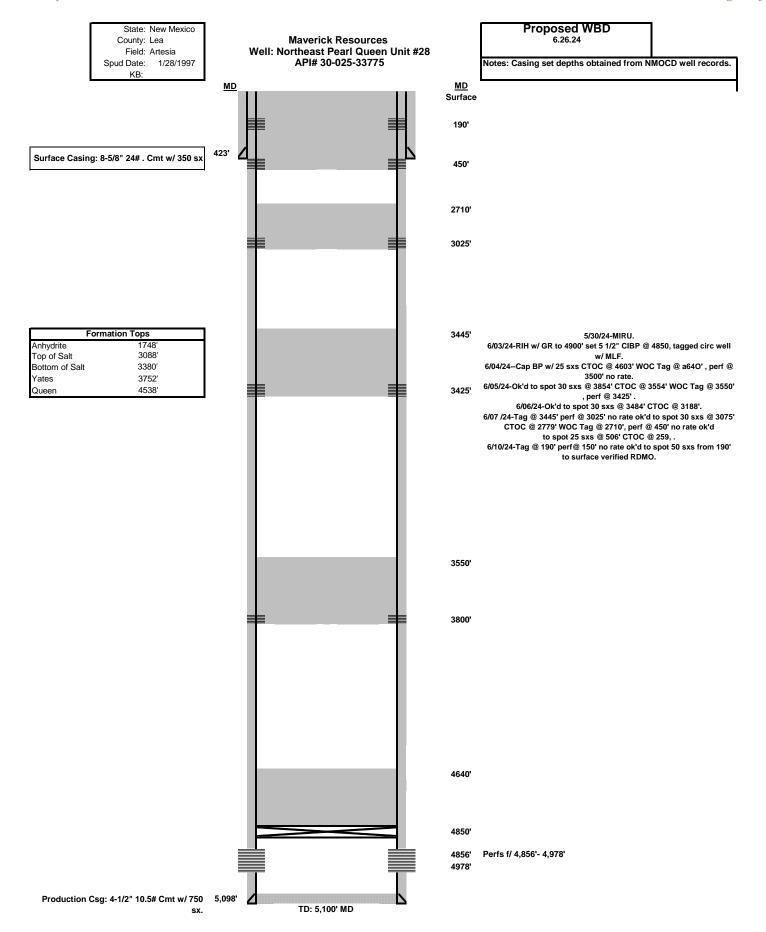

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 359024

COMMENTS

Operator:	OGRID:
Maverick Permian LLC	331199
1000 Main Street, Suite 2900	Action Number:
Houston, TX 77002	359024
	Action Type:
	[C-103] Sub. Plugging (C-103P)

COMMENTS

Created By	Comment	Comment Date
plmartine	DATA ENTRY PM.	7/1/2024

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 359024

CONDITIONS

Operator:	OGRID:
Maverick Permian LLC	331199
1000 Main Street, Suite 2900	Action Number:
Houston, TX 77002	359024
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By		Condition Date
kfortner	Need C103Q and marker photo to release	7/1/2024