


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

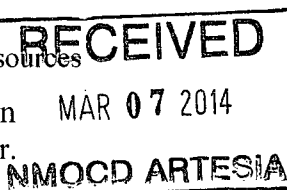

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

Initial Report

☒ Final Report

Name of Company	BOPCO, L.P.	260737	Contact	Tony Savoie
Address	522 W. Mermod, Suite 704 Carlsbad, N.M. 88220		Telephone No.	575-887-7329
Facility Name:	Poker Lake Unit Well #149 (2RP-1206)		Facility Type	E & P

Surface Owner: Federal	Mineral Owner: Federal	API No. 30-015-31416
------------------------	------------------------	----------------------

LOCATION OF RELEASE

Unit Letter I	Section 31	Township 23S	Range 30E	Feet from the	North/South Line	Feet from the	East/West Line	County Eddy
------------------	---------------	-----------------	--------------	---------------	------------------	---------------	----------------	----------------

Latitude N 32.260954 Longitude W 103.914777

NATURE OF RELEASE

Type of Release: Produced water and crude oil	Volume of Release 30 bbls of Produced water and 15 bbls crude oil	Volume Recovered None
Source of Release: 2 7/8" flow line	Date and Hour of Occurrence 5/29/12 Time unknown	Date and Hour of Discovery: 5/29/12 2:00 p.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NMOCD Mike Bratcher and BLM Jim Amos	
By Whom? Tony Savoie	Date and Hour: 6/1/12, NMOCD at 11:42 a.m. BLM at 11.45 a.m. The report was delayed to a medical situation with T.S.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken: The flow line developed a leak due to external corrosion. A temporary repair clamp was placed on the pipe. Four joints of pipe were replaced between 5/30/12 and 6/14/12.

Describe Area Affected and Cleanup Action Taken.* Approximately 2000 sq. ft. of pasture land. All of the released fluid soaked into the ground. The spill happened on top of an area previously impacted by at least 2 prior flow line releases. The is also an area in the impact zone that has exposed plastic from a reserve pit location. The release site will be reviewed with the BLM and NMOCD to determine the best course of action. The remediation will comply with the NMOCD and BLM requirements for spills.

Remediation activities conducted at the PLU Well #149 Remediation Site met the objectives set forth by the NMOCD and BLM. The final dimensions of the western excavation were approximately 40' in width, 40' in length and 5' in depth. Approximately 300' of a narrow flowpath traveling north from the western excavation was excavated to 3' bgs. The final dimensions of the eastern excavation were approximately 40' in width, 40' in length and 4' in depth. On December 31, 2013, a 20-mil liner was placed on the floor of the eastern excavation to inhibit the vertical migration of contaminants left in-situ. Between Dec. 18, 2013, and Jan. 16, 2014, approximately 740 cy of impacted soil was excavated and transported to an NMOCD-approved disposal facility. **Please reference the attached Basin Environmental Services Technologies Remediation Summary and Risk-Based Site Closure Request for details of remediation activities.**

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases, which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	OIL CONSERVATION DIVISION	
Printed Name: Tony Savoie	Approved by District Supervisor:	
Title: Waste Mgmt. & Remediation Specialist	Approval Date: 10/27/14	Expiration Date: NA
E-mail Address: TASavoie@BassPet.com	Conditions of Approval: Final	
Date: 3/7/14	Phone: 432-556-8730	