



AE Order Number Banner

Report Description

This report shows an AE Order Number in Barcode format for purposes of scanning. The Barcode format is Code 39.



App Number: pKL1623638378

1RP - 4412

BC OPERATING, INC.

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

NMOCB accepts this as
initial only. KL

OPERATOR

☒ Initial Report ☒ Final Report

Name of Company BC OPERATING, INC.	Contact BRUCE MADDEN
Address P.O. BOX 50820, MIDLAND, TX 79710	Telephone No. 432-894-0721
Facility Name PECOS PUB STATE #1	Facility Type OIL WELL

Surface Owner	Mineral Owner	API No. 30-025-40610
---------------	---------------	----------------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
J	27	11 S	33 E	1980	SOUTH	1880	EAST	LEA

Latitude _____ Longitude _____

NATURE OF RELEASE

Type of Release PRODUCED WATER	Volume of Release 52 BBLS	Volume Recovered 62 BBLS
Source of Release LIGHTNING STRIKE	Date and Hour of Occurrence 8/3/2016 EVENING HOURS	Date and Hour of Discovery 8/3/2016 @ 8:25 PM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? MAXEY BROWN OF THE NMOCB	
By Whom? BRUCE MADDEN	Date and Hour 8/4/2016 @ 8:08 AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

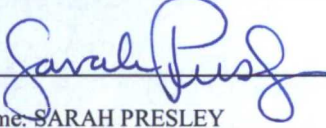
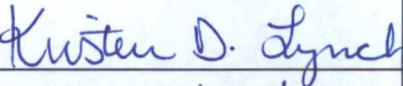
Describe Cause of Problem and Remedial Action Taken.*

LIGHTNING STRUCK THE FIBERGLASS PRODUCED WATER TANK AT THE BATTERY ON LOCATION.

Describe Area Affected and Cleanup Action Taken.*

FIBERGLASS WATER TANK WAS STRUCK BY LIGHTNING. 32 BBLS OF WATER REMAINED IN THE TANK, 20 BBLS WERE RELEASED IN TO THE FIREWALL. FIREWALL WAS EMPTIED BY G&L ON 8/4/2016. THEY RECOVERED A TOTAL OF 62 BBLS, 32 BBLS FROM THE TANK, 20 BBLS PRODUCED WATER FROM THE FIREWALL AND 10 BBLS RAIN WATER FROM THE FIREWALL. REMOVED ALL DAMAGED EQUIPMENT AND REPLACED THE WATER TANK. WELL HAS BEEN RETURNED TO PRODUCTION.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCB rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCB marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCB acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: SARAH PRESLEY	Approved by Environmental Specialist: 	
Title: REGULATORY ANALYST	Approval Date: 8/23/16	Expiration Date: 10/23/16
E-mail Address: spresley@bcoperating.com	Conditions of Approval: Discrete Samples only	Attached <input type="checkbox"/>
Date: 8/17/2016 Phone: 432-684-9696	Delineate + Remediate per NMOCB Guidelines. IRP-4413	

* Attach Additional Sheets If Necessary

Please See Email for Additional.
nKL14236387834
PKL1423638378

Lynch, Kristen, EMNRD

To: spresley@bcoperating.com
Cc: Keyes, Jamie, EMNRD; Oberding, Tomas, EMNRD
Subject: 1RP 4412 Pecos Pub State 01 Initial C141

Good Morning,

NMOCD did receive your Initial C-141 for the Pecos Pub State 01 Oil Well. The RP for this event is #4412.

In response to your C-141 dated 8/17/2016. NMOCD approves this C-141 as the Initial only, the reasoning being that this firewall is not lined and needs further testing. NMOCD conducted an on-site inspection on 8/4/2016. The findings showed that the spill was located at both inside the unlined firewall and also outside of the firewall. Please see attached pictures for validation.

- A.) Verify Depth to Ground Water via NMOSE
- B.) Discrete Samples be taken
- C.) Delineation and Remediation work plan needs to be submitted by 10/23/2016.
- D.) Notify NMOCD prior to sampling to provide opportunity for sample witnessing.
- E.) Final C-141 will need to be submitted once all requirements have been met.

An electronic copy of the Initial C-141 will be uploaded to NMOCD website Administrative/Environmental Orders.

An electronic copy of the C-141 is preferred and can be sent to Jamie.keyes@state.nm.us and Kristen.lynch@state.nm.us

4413	8/23/2016	A	BC Operating	Pecos Pub State 01	11S 33E 27 J
------	-----------	---	--------------	--------------------	--------------

*Kristen D. Lynch
Environmental Specialist, District 1
Oil Conservation Division, EMNRD
(575) 393-6161 ext. 111
575-370-3180 (emergency-cell)*

OCD approval does not relieve the operator of liability should their operations fail to adequately investigate and remediate contamination that may pose a threat to ground water, surface water, human health or the environment. In addition, OCD approval does not relieve the operator of responsibility for compliance with any other federal, state, local laws and/or regulations.



BC OPERATING, INC.
(432) 684-9696
(432) 684-9696

PECOS PUB State #1
• 1980' FSL & 1880' FEL - Unit J
• Sec. 27 - T. 11 S - R. 33 E
• Lea County, New Mexico
• API #30-025-40610

