## NM OIL CONSERVATION ARTESIA DISTRICT

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

# State of New Mexico Energy Minerals and Natural Resources

JAN 3 1 2017

Form C-141 Revised August 8, 2011

2RP-4096

Ē

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 SUBmit I Copy to appropriate District Office in accordance with 19.15.29 NMAC.

Release Notification and Corrective Action													
nAB1703253156						OPERATOR 🛛 Initia				Report		Final Report	
Name of Company: COG Operating LLC 2/1455						Contact:		Robert McNeill					
Address: 600 West Illinois Avenue, Midland TX 79701						Telephone No. 432-683-7443							
Facility Name: Patron 23 Federal #004H						Facility Type: Flowline							
Surface Owner: Federal Mineral Owner:						API No. 30-015-4245					451		
LOCATION OF RELEASE													
Unit Letter						/South Line   Feet from the   East/West Li							
A	23	25S	29E	190		North	660		ast		Edd	у	
Latitude 32.1222382 Longitude -103.9487228													
NATURE OF RELEASE													
Type of Rele	ase:	Produced	Water			Volume of	200 bbls		Volume Ro	0 bł			
Source of Re	Source of Release: Flowline						Date and Hour of Occurrence: Date and January 28, 2017 11:00 am			d Hour of Discovery: January 28, 2017 11:00 am			
Was Immediate Notice Given?						If YES, To Whom?							
	☐ Yes ☐ No ☐ Not Required												
By Whom? Rebecca Haskell						Date and Hour: January 28, 2017 5:11 pm							
Was a Watercourse Reached?  ☐ Yes ☒ No						If YES, VO	olume impacting	ine water	course.	•			
If a Watercourse was Impacted, Describe Fully.*													
n a watercourse was impacted, Describe runy.													
Danilla Company Compan													
Describe Car	Describe Cause of Problem and Remedial Action Taken.*												
				eplaced section o	f the flo	wline.							
Describe Are	Describe Area Affected and Cleanup Action Taken.*												
The release was within a pasture. Concho will have the spill area sampled to delineate any possible impact from the release and we will present a remediation work plan to the NMOCD for approval prior to any significant remediation activities.													
I hereby cert	ify that the i	nformation gi	ven above	is true and comp	lete to t	he best of my	knowledge and i	ınderstan	d that pursu	ant to NM	OCD 1	rules and	
regulations a	I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger												
	public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability												
should their	should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other												
	federal, state, or local laws and/or regulations.												
The second secon		a Has	CONTRACTOR OF THE PROPERTY OF	-			OIL CON	SERV	ATION	DIVISIO	<u>N</u>		
						Signed By Mike Bennice_							
Printed Nam	ne:	Rebecca	ebecca Haskell			Approved by Environmental Specialist:							
Title:		Senior H	SE Coordi	nator		Approval Da	ite: 21111	E	xpiration E	Date: N/	A		
E-mail Addı	ress:	rhaskell@	concho.c	om_		Conditions of	f Approval:		1	Attached			
		5)	100 (0)	2442			Suatt	ach	ock	Aunched			
Date: Januar  * Attach Add		Phone: ets If Necess	432-683 arv	)-/44 <i>3</i>		<del>7</del>	NUVII	vvvi		<u> </u>	<b>^</b> ^	0 400/	

Operator/Responsible Party,

The OCD has received the form C-141 you provided on 1/31/11 regarding an unauthorized release. The information contained on that form has been entered into our incident database and remediation case number 200-4096 has been assigned. Please refer to this case number in all future correspondence.

It is the Division's obligation under both the Oil & Gas Act and Water Quality Act to provide for the protection of public health and the environment. Our regulations (19.15.29.11 NMAC) state the following,

The responsible person shall complete <u>division-approved corrective action</u> for releases that endanger public health or the environment. The responsible person shall address releases in accordance with a remediation plan submitted to and approved by the division or with an abatement plan submitted in accordance with 19.15.30 NMAC. [emphasis added]

Release characterization is the first phase of corrective action unless the release is ongoing or is of limited volume and all impacts can be immediately addressed. Proper and cost-effective remediation typically cannot occur without adequate characterization of the impacts of any release. Furthermore, the Division has the ability to impose reasonable conditions upon the efforts it oversees. As such, the Division is requiring a workplan for the characterization of impacts associated with this release be submitted to the OCD District  $\frac{2}{2}$  office in  $\frac{2}{2}$  on or before  $\frac{3}{2}$ . If and when the release characterization workplan is approved, there will be an associated deadline for submittal of the resultant investigation report. Modest extensions of time to these deadlines may be granted, but only with acceptable justification.

The goals of a characterization effort are: 1) determination of the lateral and vertical extents along with the magnitude of soil contamination. 2) determine if groundwater or surface waters have been impacted. 3) If groundwater or surface waters have been impacted, what are the extents and magnitude of that impact. 4) The characterization of any other adverse impacts that may have occurred (examples: impacts on vegetation, impacts on wildlife, air quality, loss of use of property, etc.). To meet these goals as quickly as possible, the following items must, at a minimum, be addressed in the release characterization workplan and subsequent reporting:

- Horizontal delineation of soil impacts in each of the four cardinal compass directions. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C<sub>6</sub> thru C<sub>36</sub>), and for chloride by Method 300. This is not an exclusive list of potential contaminants. Analyzed parameters should be modified based on the nature of the released substance(s). Soil sampling must be both within the impacted area and beyond.
- Vertical delineation of soil impacts. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C<sub>6</sub> thru C<sub>36</sub>), and for chloride by Method 300. As above, this is not an exclusive list of potential contaminants and can be modified. Vertical characterization samples should be taken at depth intervals no greater than five feet apart. Lithologic description of encountered soils must also be provided. At least ten vertical feet of soils with contaminant concentrations at or below these values must be demonstrated as existing above the water table.
- Nominal detection limits for field and laboratory analyses must be provided.
- Composite sampling is not generally allowed.
- Field screening and assessment techniques are acceptable (headspace, titration, EC [include algorithm for validation purposes], EM, etc.), but the sampling and assay procedures must be clearly defined. Copies of field notes are highly desirable. A statistically significant set of split samples must be submitted for confirmatory laboratory analysis, including the laterally farthest and vertically deepest sets of soil samples. Make sure there are at least two soil samples submitted

for laboratory analysis from each borehole or test pit (highest observed contamination and deepest depth investigated). Copies of the actual laboratory results must be provided including chain of custody documentation.

- •Probable depth to shallowest protectable groundwater and lateral distance to nearest surface water. If there is an estimate of groundwater depth, the information used to arrive at that estimate must be provided. If there is a reasonable assumption that the depth to protectable water is 50 feet or less, the responsible party should anticipate the need for at least one groundwater monitoring well to be installed in the area of likely maximum contamination.
- If groundwater contamination is encountered, an additional investigation workplan may be required to determine the extents of that contamination. Groundwater and/or surface water samples, if any, must be analyzed by a competent laboratory for volatile organic hydrocarbons (typically Method 8260 full list), total dissolved solids, pH, major anions and cations including chloride and sulfate, dissolved iron, and dissolved manganese. The investigation workplan must provide the groundwater sampling method(s) and sample handling protocols. To the fullest extent possible, aqueous analyses must be undertaken using nominal method detection limits. As with the soil analyses, copies of the actual laboratory results must be provided including chain of custody documentation.
- Accurately scaled and well-drafted site maps must be provided providing the location of borings, test pits, monitoring wells, potentially impacted areas, and significant surface features including roads and site infrastructure that might limit either the release characterization or remedial efforts. Field sketches may be included in subsequent reporting, but should not be considered stand-alone documentation of the site's layout. Digital photographic documentation of the location and fieldwork is recommended, especially if unusual circumstances are encountered.

Nothing herein should be interpreted to preclude emergency response actions or to imply immediate remediation by removal cannot proceed as warranted. Nonetheless, characterization of impacts and confirmation of the effectiveness of remedial efforts must still be provided to the OCD before any release incident will be closed.

Jim Griswold

OCD Environmental Bureau Chief
1220 South St. Francis Drive
Santa Fe, New Mexico 87505
505-476-3465
jim.griswold@state.nm.us

#### Bratcher, Mike, EMNRD

From: Rebecca Haskell <RHaskell@concho.com>

**Sent:** Monday, January 30, 2017 4:05 PM

To: Weaver, Crystal, EMNRD; stucker@blm.gov

Cc: Bratcher, Mike, EMNRD; Jim Amos (jamos@blm.gov)

**Subject:** (C-141 Initial) Patron 23 Federal 4H Battery 1/28/17 (30-015-42451)

Attachments: Patron 23 Federal 4H Battery Initial C-141 1-28-17 (30-015-42451).pdf


Ms. Weaver / Ms. Tucker,

Attached is a Revised C-141 for your consideration. If you have any additional questions please feel free to contact me.

Thank You,

Becky Haskell Senior HSE Coordinator COG Operating LLC 600 W Illinois Avenue | Midland, TX 79701 Direct: 432-818-2372 | Main: 432.683.7443

Cell: 432-556-5130 rhaskell@concho.com

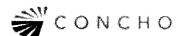

CONFIDENTIALITY NOTICE: The information in this email may be confidential and/or privileged. If you are not the intended recipient or an authorized representative of the intended recipient, you are hereby notified that any review, dissemination or copying of this email and its attachments, if any, or the information contained herein, is prohibited. If you have received this email in error, please immediately notify the sender by return email and delete this email from your system. Thank you.

### Weaver, Crystal, EMNRD

From: Rebecca Haskell < RHaskell@concho.com>

Sent: Saturday, January 28, 2017 4:11 PM

To: Weaver, Crystal, EMNRD; stucker@blm.gov

Cc: Bratcher, Mike, EMNRD; Jim Amos (jamos@blm.gov)

Subject: (Notification) Patron 23 Federal Battery 1-28-17 (30-015-42451)

Ms. Weaver / Ms. Tucker,

COG OPERATING LLC IS REPORTING A RELEASE ON THE PATRON 23 FEDERAL BATTERY ((30-015-42451)

UNIT A SECTION 23 TOWNSHIP 25S RANGE 29E

THE RELEASE OCCURRED AT APPROXIMATELY 11:00 AM ON 1-28-2017

ESTIMATED RELEASED: APPROX. 200 BBLS PRODUCED WATER ESTIMATED RECOVERED: APPROX. 0 BBLS PRODUCED WATER

THE RELEASE WAS DUE TO A RUPTURE IN A FLOW LINE. THIS AREA IS BEING EVALUATED AND A C-141 WILL BE SUBMITTED. IF YOU HAVE ANY ADDITIONAL QUESTIONS PLEASE FEEL FREE TO CONTACT ME.

THANK YOU,

#### **BECKY HASKELL**

CONFIDENTIALITY NOTICE: The information in this email may be confidential and/or privileged. If you are not the intended recipient or an authorized representative of the intended recipient, you are hereby notified that any review, dissemination or copying of this email and its attachments, if any, or the information contained herein, is prohibited. If you have received this email in error, please immediately notify the sender by return email and delete this email from your system. Thank you.