

# NM OIL CONSERVATION

ARTESIA DISTRICT

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources

Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

FEB 09 2017

Form C-141  
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in  
RECEIVED accordance with 19.15.29 NMAC.

## Release Notification and Corrective Action

**DAB1705132791**

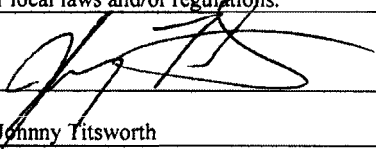

<b>OPERATOR</b>		<input checked="" type="checkbox"/> Initial Report	<input type="checkbox"/> Final Report
Name of Company: Burnett Oil Co., Inc. <b>3080</b>		Contact: Johnny Titsworth	
Address: Burnett Plaza-Ste 1500, 801 Cherry St-Unit 9, Fort Worth, TX 76102		Telephone No. (432) 425-2891	
Facility Name: Jackson B 004WIW		Facility Type: Injection Well	
Surface Owner: BLM		Mineral Owner: BLM	API No. 30-015-04036

### LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
D	1	17S	30E	660	FNL	660	FWL	Eddy

Latitude: 32.86162 Longitude: -103.92887

### NATURE OF RELEASE

Type of Release: Produced Water	Volume of Release: 165 BBLS	Volume Recovered 145 BBLS
Source of Release: flowline leak	Date and Hour of Occurrence: 2/8/17	Date and Hour of Discovery: 9:00 am 2/8/17
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? OCD - M. Bratcher BLM - S. Tucker	
By Whom? Johnny Titsworth	Date and Hour:	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	
If a Watercourse was Impacted, Describe Fully.*  N/A		
Describe Cause of Problem and Remedial Action Taken.* Steel injection line corroded and release produced water. Standing fluid has been picked up and hauled to disposal. Area will be remediated to regulatory standards		
Describe Area Affected and Cleanup Action Taken.* the release impacted an area on the lease road and an unfinished facility location, as well as an 2'x30' area in pasture.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		
Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Johnny Titsworth	Approved by Environmental Specialist: 	
Title: HSE Coordinator	Approval Date: 2/20/17	Expiration Date: N/A
E-mail Address: jtitsworth@burnettoil.com	Conditions of Approval: See attached	Attached <input type="checkbox"/>
Date: Phone: (432) 425-2891		

\* Attach Additional Sheets If Necessary

2RP-4122

Operator/Responsible Party,

The OCD has received the form C-141 you provided on 2/9/17 regarding an unauthorized release. The information contained on that form has been entered into our incident database and remediation case number ARP-4122 has been assigned. **Please refer to this case number in all future correspondence.**

It is the Division's obligation under both the Oil & Gas Act and Water Quality Act to provide for the protection of public health and the environment. Our regulations (19.15.29.11 NMAC) state the following,

*The responsible person shall complete division-approved corrective action for releases that endanger public health or the environment. The responsible person shall address releases in accordance with a remediation plan submitted to and approved by the division or with an abatement plan submitted in accordance with 19.15.30 NMAC. [emphasis added]*

Release characterization is the first phase of corrective action unless the release is ongoing or is of limited volume and all impacts can be immediately addressed. Proper and cost-effective remediation typically cannot occur without adequate characterization of the impacts of any release. Furthermore, the Division has the ability to impose reasonable conditions upon the efforts it oversees. **As such, the Division is requiring a workplan for the characterization of impacts associated with this release be submitted to the OCD District 2 office in ARTESIA on or before 4/3/17.** If and when the release characterization workplan is approved, there will be an associated deadline for submittal of the resultant investigation report. Modest extensions of time to these deadlines may be granted, but only with acceptable justification.

The goals of a characterization effort are: 1) determination of the lateral and vertical extents along with the magnitude of soil contamination. 2) determine if groundwater or surface waters have been impacted. 3) If groundwater or surface waters have been impacted, what are the extents and magnitude of that impact. 4) The characterization of any other adverse impacts that may have occurred (examples: impacts on vegetation, impacts on wildlife, air quality, loss of use of property, etc.). To meet these goals as quickly as possible, the following items must, at a minimum, be addressed in the release characterization workplan and subsequent reporting:

- Horizontal delineation of soil impacts in each of the four cardinal compass directions. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C<sub>6</sub> thru C<sub>36</sub>), and for chloride by Method 300. This is not an exclusive list of potential contaminants. Analyzed parameters should be modified based on the nature of the released substance(s). Soil sampling must be both within the impacted area and beyond.

- Vertical delineation of soil impacts. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C<sub>6</sub> thru C<sub>36</sub>), and for chloride by Method 300. As above, this is not an exclusive list of potential contaminants and can be modified. Vertical characterization samples should be taken at depth intervals no greater than five feet apart. Lithologic description of encountered soils must also be provided. At least ten vertical feet of soils with contaminant concentrations at or below these values must be demonstrated as existing above the water table.

- Nominal detection limits for field and laboratory analyses must be provided.

- Composite sampling is not generally allowed.

- Field screening and assessment techniques are acceptable (headspace, titration, EC [include algorithm for validation purposes], EM, etc.), but the sampling and assay procedures must be clearly defined. Copies of field notes are highly desirable. A statistically significant set of split samples must be submitted for confirmatory laboratory analysis, including the laterally farthest and vertically deepest sets of soil samples. Make sure there are at least two soil samples submitted

for laboratory analysis from each borehole or test pit (highest observed contamination and deepest depth investigated). Copies of the actual laboratory results must be provided including chain of custody documentation.

- Probable depth to shallowest protectable groundwater and lateral distance to nearest surface water. If there is an estimate of groundwater depth, the information used to arrive at that estimate must be provided. If there is a reasonable assumption that the depth to protectable water is 50 feet or less, the responsible party should anticipate the need for at least one groundwater monitoring well to be installed in the area of likely maximum contamination.

- If groundwater contamination is encountered, an additional investigation workplan may be required to determine the extents of that contamination. Groundwater and/or surface water samples, if any, must be analyzed by a competent laboratory for volatile organic hydrocarbons (typically Method 8260 full list), total dissolved solids, pH, major anions and cations including chloride and sulfate, dissolved iron, and dissolved manganese. The investigation workplan must provide the groundwater sampling method(s) and sample handling protocols. To the fullest extent possible, aqueous analyses must be undertaken using nominal method detection limits. As with the soil analyses, copies of the actual laboratory results must be provided including chain of custody documentation.

- Accurately scaled and well-drafted site maps must be provided providing the location of borings, test pits, monitoring wells, potentially impacted areas, and significant surface features including roads and site infrastructure that might limit either the release characterization or remedial efforts. Field sketches may be included in subsequent reporting, but should not be considered stand-alone documentation of the site's layout. Digital photographic documentation of the location and fieldwork is recommended, especially if unusual circumstances are encountered.

**Nothing herein should be interpreted to preclude emergency response actions or to imply immediate remediation by removal cannot proceed as warranted. Nonetheless, characterization of impacts and confirmation of the effectiveness of remedial efforts must still be provided to the OCD before any release incident will be closed.**

**Jim Griswold**  
OCD Environmental Bureau Chief  
1220 South St. Francis Drive  
Santa Fe, New Mexico 87505  
505-476-3465  
jim.griswold@state.nm.us

## **Bratcher, Mike, EMNRD**

---

**From:** Johnny Titsworth <jtitsworth@burnettoil.com>  
**Sent:** Thursday, February 9, 2017 2:46 PM  
**To:** Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD; Tucker, Shelly  
**Cc:** Kyle Adams; Leslie Garvis  
**Subject:** Jackson B 4 WIW  
**Attachments:** Jackson B 4 WIW initial C-141.pdf

All

We had a release yesterday on the flowline going to the Jackson B 4 WIW. The majority of the release stayed on the lease road and the pad of a future facility. We did have a 2'x30' area in the pasture to the east of the location. If there are any questions or concerns, let us know. Thanks

**Johnny Titsworth**  
HSE COORDINATOR

**BURNETT OIL CO., INC.**  
P.O. Box 188  
CR 220 North  
Loco Hills, NM 88255  
MOBILE: (432)-425-2891  
EMAIL: [jtitsworth@burnettoil.com](mailto:jtitsworth@burnettoil.com)

This message is intended only for the person(s) to which it is addressed and may contain privileged, confidential and/or insider information. If you have received this communication in error, please notify us immediately by replying to the message and deleting it from your computer. Any disclosure, copying, distribution, or the taking of any action concerning the contents of this message and any attachment(s) by anyone other than the named recipient(s) is strictly prohibited.