1R-418-41

REPORTS

DATE:

3-31-08

Hobbs I-29 Vent

1R428-41

CLOSURIC

RICE OPERATING COMPANY JUNCTION BOX CLOSURE REPORT

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX D	IMENSIONS	- FEET
Hobbs	I-29 vent	1	29	18S	38E	Lea	Length	Width	Depth
TIODDS	(#1R428-41)	l	29	103	30E	Lea	no box-	-System aba	ndoned

LAND TYPE: BLM	STATE	EEE LANDOWNER	Occidental Petro (Oxy)	oleum OTHER		
. 5 //5 / / -	<u> </u>		(-7,5)	<u></u>		
Depth to Groundwater	63r	eet NMOCD	SITE ASSESSI	MENT RANKING SCC	PRE: 10	_
Date Started	11/4/2004	Date Completed	8/20/2007	NMOCD Witness	no	_
Soil Excavated	0 procubic yard	Excavation Le	ength n/a	Width n/a%	Depth <u>이 n/a 출판 in</u> fee	對學。
		•				
Soil Disposed	0 cubic yard	sec. Offsite Facility	n/a	Location	n/a 🔻 😋	<u>:@</u> ;#80
General Description of Re		his junction box site was c	lelineated using a s	oil boring according to the I	nvestigation and	·.
Characterization Plan submitted	by R.T. Hicks Consultant	s. One monitoring well wa	is installed at the sit	e in Nov. 2004. A Correcti	/e Action Plan (CAP) was	_
verbally approved by NMOCD on	7/18/2007 and confirme	d via email on 8/8/2007. A	site visit on 8/20/20	007 revealed that healthy ve	getation surrounds the	-
site; additional seed was added.	The enclosed Hicks repo	ort (December 2007) docur	ments the fulfillment	of the approved CAP and r	equests closure of this	
site. The monitoring well will rem	ain for possible future us	e for other sites in the Hob	bbs abandonment in	vestigation.		
					enclosures as state	<u>d</u>
I HEREBY CER	ΓΙFY THAT THE INF	ORMATION ABOVE KNOWLEDGE AN		COMPLETE TO THE E	BEST OF MY	=
REPORT ASSEMBLED BY	Kristin Farris Pope		·	n Harris)	D pe	
UNIE	11/20/2007	TITLE		Project Scientist		

R. T. HICKS CONSULTANTS, LTD.

901 Rio Grande Blvd NW ▲ Suite F-142 ▲ Albuquerque, NM 87104 ▲ 505.266.5004 ▲ Fax: 505.266-0745

December 4, 2007

Mr. Ed Hansen New Mexico Oil Conservation Division 1220 South St. Francis Drive Santa Fe, New Mexico 87505

RE:

NMOCD Case #1R428-41, I-29-Vent

Hobbs SWD System Abandonment

Closure Report

Dear Mr. Hansen:

This letter and Appendices are the final Closure Report for the I-29 Vent. The NMOCD approved Corrective Action Plan (Section 4.0, page 3) included creating an infiltration barrier by re-vegetation of the ground surface at the I-29 Vent. Appendix A includes the junction box closure form. Appendix B provides a photograph of the re-vegetation at the site. Appendix C includes copies of previous submissions and the NMOCD approval email. As noted in the CAP, ROC plans to leave the well at this site in place pending investigation of other Section 29 sites.

We respectfully request NMOCD approve site closure in writing. Thank you for your attention to work this matter.

Alexander Say

Sincerely,


R.T. Hicks Consultants, Ltd.

Katie Lee

Staff Scientist

Copy: Rice Operating Company

Hobbs NMOCD Office

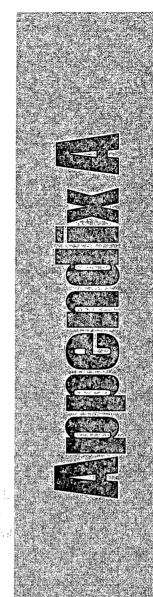

Solvitain a thre

stant in writing. Therefore is secretally considered to the consideration of this results.


23-12-13-5

RICE OPERATING COMPANY JUNCTION BOX CLOSURE REPORT

BOX LOCATION

SWD SYSTEM	NOITSMUL	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX D	IMENSIONS	- FEET
Priza La	#29 vent		29	4:00	38 E	i i i	Length	Width	Depth
Hobbs	(#1R428-41)		-29	185	SOC	Lea	no box-	-System aba	indoned

	LAND TYPE: BLM	STATE	FEE LANDOWNER	Occidental Petro (Oxy)	oleum OTHER	
	Depth to Groundwater	63	feet NMOC	O SITE ASSESS	MENT RANKING SCORE	: 10
	Date Started	11/4/2004	Date Completed	8/20/2007	NMOCD Witness	no
randa ya 1000 ese sekaranga	Soil Disposed	O cub	c yards Excavation c yards Offsite Facili		Width n/a Dept	h n/a fee
C	Seneral Description of Re	medial Action:	This junction box site wa	s delineated using a	Soll boring according to the Inve	
<u>C</u> I	naracterization Plan submitted t	oy R.T. Hicks Can	sulfants. One monitoring well	was installed at the s	ite In Nov. 2004. A Corrective A	Action Plan (CAP) was
·Ve	rbally approved by NMOCD on	7/18/2007 and co	offirmed via email on 8/8/2007.	A site visit on 8/20/2	2007 revealed that healthy vegeta	ition surrounds the
Sil	e; additional seed was added.	The enclosed Hick	ks report (December 2007) doc	uments the fulfillmen	nt of the approved CAP and requ	ests closure of this
si	te. The monitoring well will rem	ain for possible fu	ture use for other sites in the H	obbs abandonment l	nvestigation.	
شد						enciosures as state
,	I HEREBY CER	TIFY THAT TH	E INFORMATION ABOV KNOWLEDGE		COMPLETE TO THE BE	ST OF MY
R	EPORT ASSEMBLED BY	Kristin Farr	ls Pape SIGNATU	RE KN122	un dania Po) pe
	DATE	11/28/2	007 TIT	LE	Project Scientist	

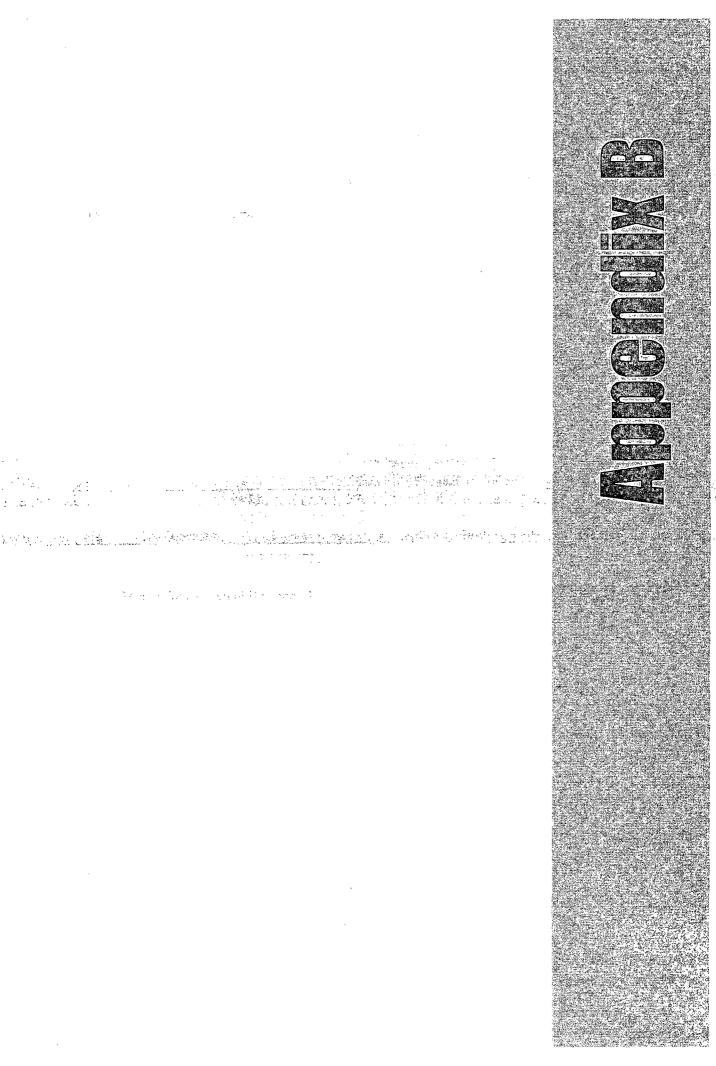

the growth of the same to

Appendix B – Photograph Documenting Re-Vegetation at I-29 Vent

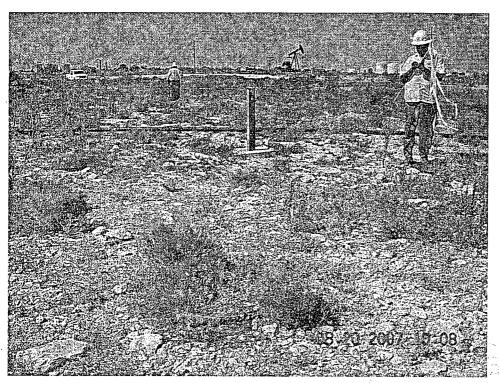


Figure 1: View of I-29-Vent showing re-vegetation

Pigner In View of 1-29-Vert showing serv

 $(x_{i_1}, \dots, x_{i_{k-1}}, \dots, x_{i_k}, \dots, x_{i_k}) \in \mathcal{K}_{i_1} \times \mathcal{K}_{i_1} \times \mathcal{K}_{i_2} \times \mathcal{K$

Katie Lee

Kristin Pope [kpope@riceswd.com] From:

Sent: Wednesday, October 31, 2007 3:30 PM

To: Katie Lee

Subject: Fw: Summary of July 18 meeting

---- Original Message -----

From: Hansen, Edward J., EMNRD

To: Kristin Pope

Cc: Carolyn Haynes; Scott Curtis; Sanchez, Daniel J., EMNRD; Price, Wayne, EMNRD

Sent: Wednesday, August 08, 2007 11:26 AM Subject: RE: Summary of July 18 meeting

Kristin.

Your summary appears to be accurate and complete.

Attached is the summary that you sent with comments from me [OCD case #s and formal (email) approval dates]. I'll be sending more formal (via email) approvals for the closures and some of the CAPs soon.

the city classing whowait were re-

Also, I will review and comment on the other CAPs and the APs a.s.a.p.

Thanks for the summary.

Let me know if you have any questions regarding my comments.

Edward J. Hansen

Hydrologist

Hydrologist

Environmental Bureau Francis Serve of Education Servers of Servers of Servers (1997). Hydrologist

505-476-3489

From: Kristin Pope [mailto:kpope@riceswd.com] Sent: Wednesday, August 08, 2007 10:34 AM

To: Sanchez, Daniel J., EMNRD; Price, Wayne, EMNRD; Hansen, Edward J., EMNRD

Cc: Carolyn Haynes; Scott Curtis Subject: Summary of July 18 meeting

Gentlemen,

Please review the attached summary of our July 18 meeting. Please let me know if anything needs to be changed. OCD and ROC have already moved forward with several of the projects listed but I would like written confirmation for our files. Thanks again for your time.

Kristin Farris Pope Project Scientist RICE Operating Company Hobbs, New Mexico (505) 393-9174

This inbound email has been scanned by the MessageLabs Email Security System.

Confidentiality Notice: This e-mail, including all attachments is for the sole use of the intended recipient (s) and may contain confidential and privileged information. Any unauthorized review, use, disclosure or distribution is prohibited unless specifically provided under the New Mexico Inspection of Public Records Act. If you are not the intended recipient, please contact the sender and destroy all copies of this message. -- This email has been scanned by the Sybari - Antigen Email System.

OCD/ROC MEETING SUMMARY

July 18, 2007

CLOSURES

- 1. Abatement Completion Report for <u>BD Zachary Hinton EOL</u> submitted by R.T. Hicks Consultants on 3/15/2007. AP-50
- 2. Abatement Completion Report for <u>EME Marathon Barber (jct. E-5)</u> submitted by R.T. Hicks Consultants on 5/16/2007. 1R0427-91 *Approved soil work completed Dec. 2006*
- 3. Closure Report for <u>Hobbs I-29 EOL boot</u> submitted by R.T. Hicks Consultants on 5/23/2007. Approved soil work completed in 2006. 1R428-42
- 4. Closure Request for <u>BD jct. N-29</u> submitted by R.T. Hicks Consultants on 2/10/2007. #1R0426-37

APPROVALS

- 1. Stage 1&2 Abatement Plan for <u>Vacuum F/G-35 SWD</u> submitted by R.T. Hicks

 Consultants; proof of public notice submitted Feb. 2006; AP-59

 Vadose zone remedy complete; reclaiming surface; groundwater

 treatment ongoing at F-35; evaluating treatment potential at G-35
- 2. INVESTIGATION & CHARACTERIZATION PLANS (ICP) NMOCD Approved (1 14) via email August 6, 2007
 - 1. Hobbs O-5 Historical Release by Hicks on 4/11/2007 #1R428-69
 - 2. EME State 'H' EOL by P. Galusky on 5/1/2007 #1R427-15
 - 3. Justis E-1 vent by Highlander on 11/29/2006. #1R0432-06
 - 4. <u>Vacuum State 'P' EOL</u> by Galusky on 4/20/07 #1R425-26
 - 5. Vacuum jct. F-31-1 by Hicks on 4/17/07. #1R425-27
 - 6. <u>BD P-26-1 vent</u> by Trident on 2/12/2007. #1R0426-106
 - 7. BD jct. P-26-2 by Trident on 2/12/2007. #1R0426-107
 - 8. <u>Hobbs jct. E-4, M-4 vent, & N-4 vent</u> (1 plan) by Hicks on 4/17/07 #1R428-71, #1R428-76, #1R428-68, respectively
 - 9. EME L-6 boot by Trident on 12/1/2006. #1R0427-09
 - 10. EME B-8 leak by Trident on 12/1/2006. #1R0480
 - 11. EME jct. F-18 by Arcadis on 7/6/2007 #1R427-16
 - 12. BD jct. F-25-1 by Arcadis on 7/12/2007 #1R426-10
 - 13. EME L-15-1 vent by Galusky on 7/16/2007 #1R427-173
 - 14. EME State 'Q' EOL boot by Galusky on 7/16/2007 #1R427-174
- 3. Corrective Action Plan (CAP) for Hobbs E-15 SWD submitted on 11/28/2006 by Arcadis G&M. *Approved with clay or GCL condition* #1R428-40 NMOCD Approved with conditions via email July 27, 2007

- 4. CAP for Hobbs F-29-1b boot submitted by R.T. Hicks Consultants on 4/2/2007. #1R428-45
- 5. CAP for Hobbs O-29 vent submitted by R.T. Hicks Consultants on 4/2/2007. #1R428-43
- 6. CAP for <u>Hobbs I-29 vent</u> submitted by R.T. Hicks Consultants on 4/13/2007. #1R428-41
- 7. CAP for Hobbs jct. E-33-1 submitted by R.T. Hicks Consultants on 1/2/2007. #1R428-67
- 8. CAP for Hobbs B-32 boot submitted by R.T. Hicks Consultants on 1/22/2007. #1R428-57
- 9. CAP for <u>Hobbs jet. E-32-1</u> submitted by R.T. Hicks Consultants on 1/22/2007. #1R428-65
- 10. CAP for Hobbs F-33 vent submitted by R.T. Hicks Consultants on 1/22/2007. #1R428-58
- 11. CAP for EME A-2 leak submitted by Highlander on 5/23/2007. # 1R0427-62 condition: install clay at 4 ft instead of 3 ft as proposed
 - 12. CAP for jet. A-2-1 submitted by Highlander on 5/23/2007. # 1R0427-177 AP to install condition: install clay at 4 ft instead of 3 ft as proposed
 - 13. CAP for <u>EME I-1 off-site encroachment</u> submitted by Trident on 2/27/07. #1R0464

Rule 19 ABATEMENT PLANS

Harry C. M.

OCD granted approval to install monitoring wells as proposed while reviewing plans for administrative completeness:

- 1. Stage 1 & 2 Abatement Plan for <u>Hobbs F-29 SWD</u> submitted on 10/27/2006 by R.T. Hicks Consultants. *Public notice ready to submit upon approval*. AP-64
- 2. Stage 1 Abatement Plan for <u>EME C-16(1) leak</u> submitted on 5/25/2007 by L. Peter Galusky; #1R0476 *Public notice ready to submit upon approval*.
- 3. Stage 1 Abatement Plan for <u>EME C-16(2) leak</u> submitted on 5/25/2007 by L. Peter Galusky; #1R0477 *Public notice ready to submit upon approval.*
- 4. Stage 1&2 Abatement Plan for <u>BD Santa Rita release</u> site submitted on 12/11/2006 by Trident. AP-58 want to drill more MWs

- 5. Stage 1&2 Abatement Plan for <u>EME jct. M-16-1</u> submitted on 1/29/2007 by Arcadis G&M. AP-42
- 6. Stage 1&2 Abatement Plan for <u>EME jct. A-20</u> submitted on 1/29/2007 by Arcadis G&M. AP-43
- 7. Stage 1 Abatement Plan for <u>BD H-35 pit</u> submitted by Arcadis G&M on 3/23/2007. #1R0216
- 8. Stage 1 & 2 Abatement Plan for <u>Justis jct. L-1 boot</u> submitted by Highlander on 1/17/07. AP-48

OCD WILL REVIEW

1. Stage 1 Final Report & Closure Request for <u>EME jct. K-33-1</u> submitted by Whole Earth on 12/28/2006. AP-60

OCD requests confirmation of regional gradient/impact

- 2. CAP for EME M-5 SWD submitted by Hicks on 9/10/2004. #1R424
- Rule 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 19 Release and CAP for soil for BD jett. F-17 submitted by Highlander on 12/29/06 Section of CAP for soil for Soi
- 4. Request for Release from Rule 19 for <u>EME H-13 release</u> submitted on 8/30/2006 and by Highlander Environmental. AP-44

 Additional information requested by OCD was submitted on 12/29/06 and presented at meeting on 2/21/2007. Showed current site photos.
- 5. Final Investigation Report & CAP for <u>EME jet</u>. K-6 submitted by Trident on 3/7/2007. AP-46.

OTHER

- 1. CAP for <u>BD K-4 leak</u> submitted by Highlander on 4/23/2007. #1R0459 APPROVAL to begin pumping from MW-1 as proposed; OCD will evaluate CAP (soil work)
- 2. CAP for <u>BD O-17-1</u> vent submitted by Highlander on 5/11/2007. #1R426-12 No groundwater impact; soil work only ROC WILL REVISE AND RE-SUBMIT FOR CLARIFICATION

3. GEOSYNTHETIC CLAY LINER (GCL) option for Junction Box Upgrade Program

Modification request required; can be emailed.

NMOCD Approved with conditions via email July 27, 2007

Gal Mahinggleghe 1979 bise is and Gall Capital of the Library Library Algebra String on

The Address of the Figure of the Anna Section of the Anna Section (Anna Section Sectio

USSEL WOOD was in buildined by the William Loutines of Equational Control for SOF bear in realization of Marie Williams

of the East Report of the Control of the State of the Control of t

* PAR HOLD FOR STATE OF THE STATE OF THE STATE OF

R. T. HICKS CONSULTANTS, LTD.

901 Rio Grande Blvd NW ▲ Suite F-142 ▲ Albuquerque, NM 87104 ▲ 505.266.5004 ▲ Fax: 505.266-0745

April 12, 2007

Mr. Wayne Price Environmental Bureau Chief New Mexico Oil Conservation Division 1220 South St. Francis Drive Santa Fe, New Mexico 87505

RE:

NMOCD Case # 1R0428-41, I-29 Vent Hobbs SWD System Abandonment Corrective Action Plan

Dear Mr. Price:

On behalf of Rice Operating Company, R.T. Hicks Consultants, Ltd. is pleased to submit the attached Corrective Action Plan for the I-29 Vent site. This plan presents characterization activities, evaluations and conclusions as well as a proposal for closure of the site after the selected remedy is implemented.

If you have any questions or concerns, please do not hesitate to contact us: fave any questions or concerns.

スープ、アラー Tomby transation (東の大) (東の High College Coll

Sincerely,

R.T. Hicks Consultants, Ltd.

Katie Lee

Staff Scientist

Copy: Rice Operating Company

Hobbs NMOCD Office

Corrective Action Plan I-29 Vent Site


Section 29, T185, R 38E NMOCD Case #: 1-R0428-41

Prepared for:

Rice Operating Company 122 West Taylor Hobbs, NM 88240

> R.T. Hicks Consultants, Ltd. 901 Rio Grande Blvd. NW, Suite F-142, Albuquerque, NM 87104

Table of Contents
1.0 Introduction
2.0 Work Elements Performed
3.0 Conclusions
4.0 Recommendation
Plates
Plate 1: 2004 Aerial Photograph of I-29 Vent Site
Plate 2: I-29 Boring Log
Plate 3: HYDRUS-1D Vadose Zone Soil Profile
Appendices
Appendix A: Details of Characterization Activities At the I-29 Vent Site Figure A-1: Chloride Concentrations and PID Readings From I-29 Soil Boring Samples A2 Table A-1: Laboratory Analysis Results of I-29 Boring Samples A2 Table A-2: Quarterly Ground Water Data From the I-29 Vent Site A3 Appendix B: Field Measurements & Laboratory Results For Soil Samples
Appendix C: Model Input Parameters and Results Table C-1: Hydrus-1D and Mixing Model Input Parameters
Appendix D: Works Consulted

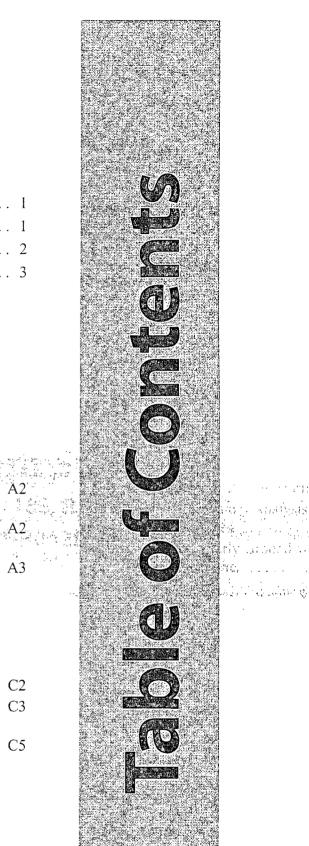

R.T. Hicks Consultants, LTD

1.0 INTRODUCTION

The I-29 Vent, located west of Hobbs, New Mexico, in section 29, T18S, R38E, was a junction box-in the Hobbs Salt Water Disposal (SWD) system, which disposed of produced water from the late 1950s until 2002, when the system was closed. Future impacts from the system are not possible. With the abandonment of the system in 2002, Rice Operating Company (ROC) excavated and removed the SWD I-29 Vent and the uppermost 5-10 feet of the vadose zone. At the time of investigation, the excavation was filled with a mixture of sand-clay-caliche. Activities at the site followed the NMOCD-approved workplan (August 6, 2004).

This Corrective Action Plan presents:

- A description of the characterization activities performed by R.T. Hicks Consultants (Hicks Consultants) and Rice Operating Company (ROC) at the I-29 Vent site located in the Hobbs SWD,
- 2). Evaluation and conclusions drawn from activities performed,
- 3) A proposal for closure of the site after the selected remedy is implemented.

WORK ELEMENTS PERFORMED

Detailed descriptions of characterization activities are provided in Appendix A. Appendix B shows the results of field chloride measurements. Plate 1 is an aerial photograph of the site when it was active, taken between 1996 and 1998, showing the locations of the boring and background boring.

Activities included:

- I-29 soil boring characterization.
- 2. Background soil boring characterization.
- Field measurements consisting of chloride titration and PID readings for volatiles.
- Submission of two selected soil samples for laboratory analysis in accordance with the workplan.

R.T. Hicks Consultants, LTD.

- 5. Completion of the soil boring as a monitoring well.
- 6. HYDRUS-1D simulation of the site.
- 7. Quarterly monitoring of ground water at the site from December, 2004, to the present day.
- 8. Development of a corrective action plan.

3.0 CONCLUSIONS

法 自然 開門

3.1 ACTIVITIES AT THE I-29 VENT HAVE NOT CAUSED COCS TO REACH GROUND WATER.

From chloride concentration and PID measurement profiles (confirmed by laboratory analysis), Hicks Consultants concludes that saturated conditions between the surface and ground water never developed and that constituents of concern (COCs) reside in the upper two-thirds of the vadose zone. Ground water monitoring also shows that ground water remains unimpaired and that activities at this site have not caused COCs to reach ground water.

3.2 CHLORIDE CONCENTRATIONS WILL NOT EXCEED WQCC GROUND WATER STANDARDS.

Using highly conservative input data, HYDRUS-1D modeling of the vadose zone chlorides predicts that resulting ground water chloride concentrations will be below the 250 ppm Water Quality Control Commission (WQCC) secondary drinking water standard. At a nearby background monitoring well, over four years of data show that chloride concentration ranges from 111 mg/L to 301 mg/L, with an average concentration of 159 mg/L. The predicted chloride concentration increase at the I-29 site (42 mg/L) could not be differentiated from natural vegetation. The model inputs and methodology are discussed in Appendix C.

3.3 THE SITE PRESENTS NO THREAT TO FRESH WATER, PUBLIC HEALTH OR THE ENVIRONMENT.

Ground water quality exhibits background levels of chloride concentrations and no detection of hydrocarbons. Because residual petroleum hydrocarbons and chloride are not present in sufficient concentration or sufficient mass, Hicks Consultants concluded



R.T. HICKS CONSULTANTS, LTD.


that the site represents no threat to fresh water, public health, or the environment (see discussion in Appendix A and Appendix C).


4.0 RECOMMENDATION

Hicks Consultants recommends that ROC create an infiltration barrier through re-vegetation of the ground surface at the I-29 Vent site. This remedy is protective of ground water quality, human health, and the environment. Upon documentation of this action, a closure report/request will be submitted to NMOCD.

ROC will leave the monitoring well in place pending investigation of other Section 29 sites.



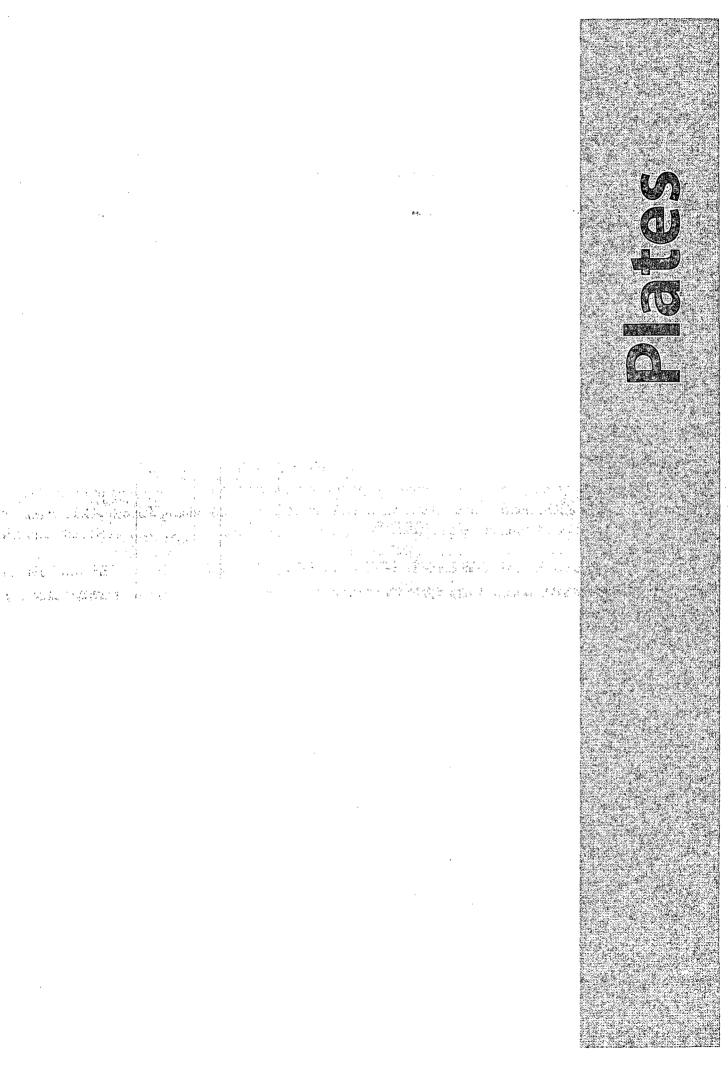

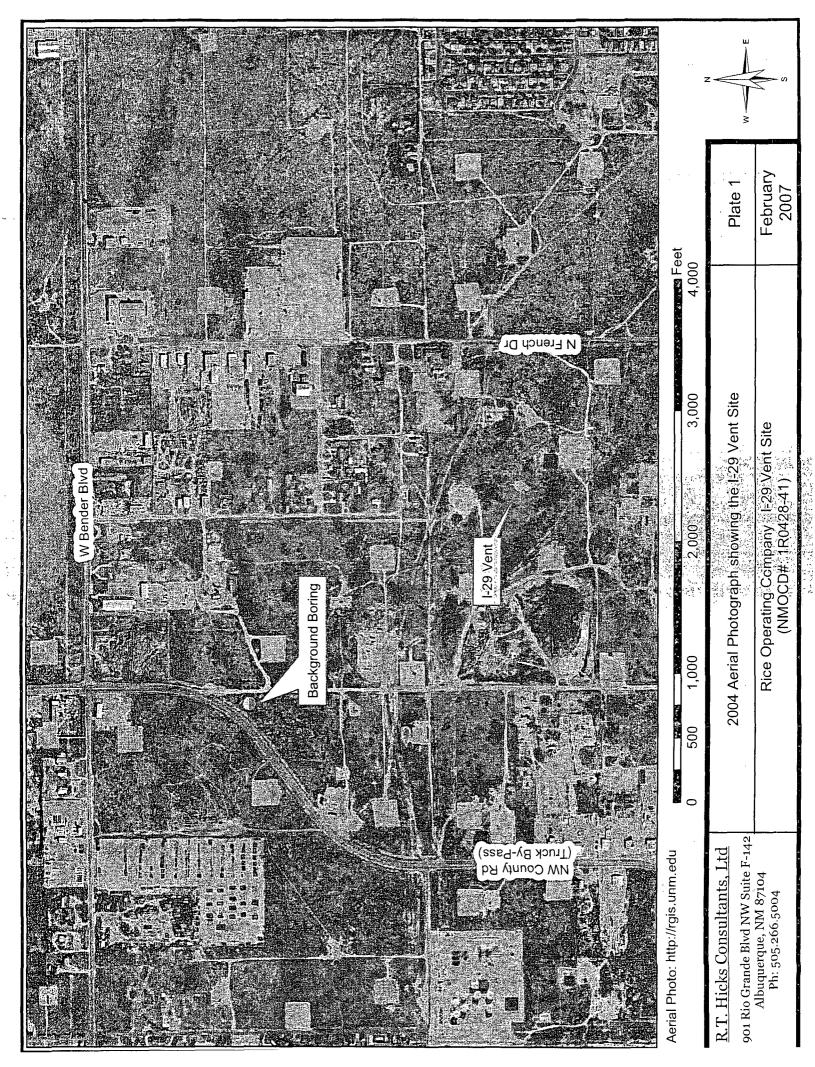

Logger:			Client:			Well ID:		
Driller:	Eades Drilling (0-62 feet) / Atkins Enginee			Company	ļ ·			
Drilling	Air Rotary / Hollow Stem Auge		Project Name			1		
Start Date:	11/4/2004 / 11/12/2004	. **	1 4	Hobbs I-29	Vent 🥗		5754 1 00 3/2 - 4 8884	
End Date:	11/4/2004 / 11/12/2004		Location:	T400 D2	105		I-29 Vent MW	
				T18S R3 Section 29,		1		
				Section 29,	Offici	1		
Depth							Field data	ACTIVITIES DATES
(feet)	Description	Lithology	Comments	Well	Construction	Depth ft.	Chloride mg/kg	PID p
0.0	Surface, light tan, 0-1 feet				thick			
2.0								
4.0	Caliche, sand, tan, 1-8 feet							
- 6.0-			Some odor			6.0	205	2.9
8.0								
10.0	Caliche, sand, silt, 8-17 feet					11.0		24.
12.0	• • • •							
14.0	M. H							
16.0	Well indurated caliche, 17-19 feet	2/15				16.0	366	202
18.0	Caliche, sand, silt, 19-20 feet	Z.E. SPACES						
20.0	Very well indurated caliche, 20-22 feet	11 (12)		Casing		20.0	423	504
22.0 Va	ry fine grained sand silt, yellow-tan, 22-29 feet		Odor	ပို	The Contract of the Contract o	ia maturali	The State of the S	1
24.0 Ve 26.0	ry line grained salursing yellowitan, 22-25 leet			2				400
28.0				40 PVC	Grout; 0.3-54 feet //	26:0	512	1049
	y fine grained sand silt, reddish-tan, 29-34 feet		Adder the supering toll a	ਰੰ	Philippine	31.0	454	26.
32.0				t S		为中国的特别的		(51) (7 (4))
	Caliche sand 34-35 feet			2 inch Sch.		53 73	the obtained the	
	/sf.grained sand silt, reddish-tan, 35-38 feet		4.000000000000000000000000000000000000		REAL PROOFERS AND	36.0	374	10
38.0 (1855)	Caliche, 38-38.75 feet		Hard drilling			Lating 18 C.	自然 医单流性	23
40.0	<mark>प्रस्त दुर्भ स्थान सम्बद्धाः व्यास्त्रीसम्बद्धाः स्थान स्थान</mark>		We entropy			41.0	209	7.8
42.0 Very	fine grained sand silt, reddish-tan, 38.75-46 feet					2.5.5		
44.0								
46.0	Sand silt, some caliche, 46-51 feet					46.0	284	17.
48.0								
50.0		4				51.0	123	5.7
52.0 Yes	y fine grained sand silt, reddish-tan, 51-60 feet							
54.0 Ver 56.0	y mio gramoù sanù siit, reduisir-tari, 5 1-00 feet				Bentonite, 54-57 feet	56.0	85	6.9
58.0								
60.0				H		61.0	56	7.4
	ands with broken sandstone, tan, dry, 60-65 feet		Dry	H				L
64.0			,	Н	12/20 Silica sand, 57-			
66.0				П	75 feet. 0.010 Slot			
68.0					Screen, 60-75 feet			
70.0	Silty fine sand,loose,tan, wet, 65-75 feet		Wet					
72.0				Ш				
74.0								
			,					
	R.T. Hicks Consultants, Ltd		н	obbs I-29 V	ent Site		Plate 2	
	901 Rio Grande Blvd NW Suite F-142		<u> </u>					
1 100	Albuquerque, NM 87104 505-266-5004	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	Mo	nitoring We	Il Boring		April 2007	

HYDRUS-1D Vadose Zone Soil Profile

Client:	Location:
Rice Operating Company	
Project Name:	T18S R38E
I-29 Vent	Section 29

Depth	esce _{ll} :	 Description 	Model Profile		Depth
(feet)	1.1	Description	Wodel Frome		(feet)
0.0		Sandy loam 0-1 feet			0.0
2.0					2.0
4.0					4.0
6.0					6.0
8.0		Loamy sand, 1-19 feet			8.0
10.0		, ,			10.0
12.0					12.0
14.0					14.0
16.0					16.0
18.0		Sand, silt 19-20feet			18.0
20.0		Caliche, 20-22-feet	30000885765704851861846868686		20.0
22.0	建艺科。			ار پارتان خواند خود او در او دارستان او پارتان در او در او	-22.0
24.0					24.0
26.0 · 28.0 ·		Sand; silt 22-34 feet			26.0
30.0	KALL		m		28.0
32.0					30.0 32.0
34.0	Annual Control of the	Caliche, 34-35 feet			34.0
36.0					36.0
38.0					38.0
40.0		Sand, silt, 35-45 feet			40.0
42.0		•		:	42.0
44.0		Sand , caliche, 45-47 feet	nseressesasuuseisaupanandinankenseineuseöääääää		44.0
46.0					46.0
48.0					48.0
50.0					50.0
52.0		Sand, silt, 47-60 feet			52.0
54.0					54.0
56.0					56.0
58.0					58.0
60.0			BANGAR THE		60.0
	<i></i>				

R.T. Hicks Consultants, Ltd 901 Rio Grande Blvd NW Suite F-142	I-29 Vent Site	Plate 3
Albuquerque, NM 87104 505-266-5004	1-25 Vent Oile	April, 2007

Details of Characterization Activities At the I-29 Vent Site



R.T. HICKS CONSULTANTS, LTD.

APPENDIX A

1) I-29 SOIL BORING CHARACTERIZATION

The boring at the I-29 Vent site was drilled in November, 2004, to a depth of 75 feet within the capillary fringe at the site. Plate 2 illustrates the lithology and distribution of constituents of concern.

From 0-35 feet bgs, the split spoon obtained samples at 5-foot intervals. The dry and unconsolidated nature of the sand-silt from 35-60 feet bgs caused loss of split spoon samples during retrieval. In the interval between 35 feet bgs and 60 feet bgs, samples were collected from cuttings. This is the only material deviation from the NMOCD-approved workplan. Moist soil was observed at 61 feet bgs and depth to ground water was estimated at approximately 63 feet bgs. The boring was completed as a monitoring well.

2) BACKGROUND SOIL BORING CHARACTERIZATION

Samples taken from a background boring located about 2,000 feet northwest of the site show that background chloride concentrations in the area are approximately 80 ppm. Appendix B presents the field data from this boring.

3) FIELD MEASUREMENTS


ROC took field measurements from each 5-foot sampling interval for chloride and volatiles in the field using the heated headspace method to measure total organic vapors by photoionization detector (PID). Samples were submitted to a laboratory from depths showing the highest field chloride and PID measurements (26 feet bgs) and from the capillary fringe (61 feet bgs); see Figure A-1. Plate 2 is a lithologic log of the boring with field chloride concentrations and PID measurements. Appendix B provides additional chemical data for the soil samples.

The maximum chloride concentration in the soil is 512 ppm at 26 feet bgs and chloride declines with depth, as shown by Figure A-1.



R.T. Hicks Consultants, LTD.

Figure A-1: Chloride Concentrations and PID Readings From Soil Boring Samples, I-29 Vent Site, November 4, 2004

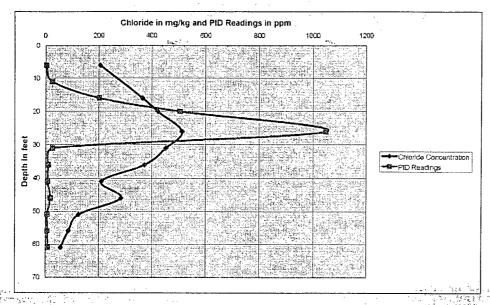

Chloride concentrations reach approximate background levels (about 80 ppm) at a depth of 51 feet bgs. Field evidence demonstrates that the chloride mass resides in the upper two-thirds of the vadose zone.

PID readings follow a pattern similar to that of chloride, peaking at 26 feet bgs with 1049 ppm total organic vapors, and reaching background concentrations below 36 feet bgs.

Laboratory analysis of the soil sample from 26 feet bgs showed benzene, toluene, ethylbenzene, and zylene (BTEX) are present in total aggregate concentratins below 50 ppm (see Table A-1).

Table A-1: Laboratory Analysis Results of Samples From the I-29 Boring.

	SWD B-5 (I	l-29 Vent), No	vember, 2004	1
Constituent	26 ft. bgs	65 ft. bgs	Detection Limit	NMED Screening Guideline October, 2006
of Concern		m	g/kg (dry)	
Benzene	0.0531	ND		0.0201
Toluene	0.311	ND		21.7
Ethyl benzene	0.546	ND	0.025	20.2
Xylene (p/m)	1.58	ND		81.4
Xylene (o)	0.245	ND		2.06



PAGE

R.T. HICKS CONSULTANTS, LTD.

BTEX was not detected in field laboratory analysis of the soil sample from the capillary fringe (61 feet bgs).

4) GROUND WATER MONITORING

As Table A-2 shows, quarterly monitoring since December, 2004, indicates that activities at the site have not adversely impacted ground water.

Table A-2: Quarterly Ground Water Data From the I-29 Vent Site

Date	Chloride	Sulfate	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes
				(mg/L)			
12/2/2004	103	97.7	521	ND	ND	ND	ND
3/21/2005	116	96.6	617	ND	ND	ND	ND
5/19/2005	104	89.7	647	ND	ND	ND	ND
8/9/2005	97.7	87.5	538	ND	ND	ND	ND
11/1/2005	82.7	68	600	ND	ND	ND	ND
1/31/2006	83.1	59.6	508	ŊŊ	ND	ŅD	//ND ^(c)
5/2/2006	102	69.6	572	ND	ND	, ND,	ND ".
8/14/2006	98.9	65.9	526.	ŅĎ	ND	ND.	ND
10/31/2006	100	80.3	454	ND	ND	ND	ND:
2/3/2006	132	96.4	504	ND	ND	ND.	ND N

"ND" (non-detect) indicates a concentration that is below detection limits.



Field Measurements & Laboratory Results For Soil Samples



yalcin.	Holdes	Location:	Vant I-		Bore V: Landowner:	
Soii Bor		E29			GPS: Coord. System UTM 13	671919 E
JU I	Sec. 29	T 1/2 R	35			36213791
N. 11.		·				
Depth	Cl.		PID	,	Calar.	Time
6	205		2.9	 	For solicha with rocks	
11,			24.5		white calicle	
16	366		- 202	1	Ton calisty somy small	
20'	973		- 504	\	//	
.76'	5/2		1049		Tand Calie & Strang & MAP/	10:20
<u> 31.</u>	- 454		38.5	 	Find Calicha a Resell	
36'	374		10,2		1	<u> </u>
<u> 47) </u>	209		7.8	[Radiqued or colich	
46,	284		17.3	 		<u></u>
51,	1/23		5.7	 -	Red Sere	
<u>-56</u>	8.5		6.9	1	7 11	<u> </u>
61	56	<u> </u>	7.4	 	" with Royll "	1:24
	 			 	Dome Noistar P	
	<u> </u>	la isa se		 		3
		حبد المستخر		-		
		Part of the second		<u> </u>	The second of th	Land the state of
					And the second second	A CONTRACT OF SHIP OF THE SHIP SHIP SHIP SHIPS
4-1-1		Sept 1 18 18 18 18 18	<u> </u>	1		g y file 1 m m hay a la mai trat a mai ban part a sa gand y nga mai pika a magkalat. Mai nga magkalat na kata nga magkalat na magkalat na magkalat na magkalat na magkalat na magkalat na magkalat
		Service of the service of	- 1 Jan - 1 1 1 1 1			ter (1998) in the second light of the second control of the second
100		建建建筑		3445,000		
garage Constitution			<u> </u>		The same that we will be a sure of the same and	
	, yes/g		Ì	Ì		
	3 1			5.7		
						:
<u>.</u>			ļ.			.
				<u> </u>		
		<u> </u>		-		<u> </u>
	1	1				



		Soil Bore								
	System:	Hobbs	Location	Vzif I-2	GA.	/: ሬ⊋′ Landow	mer. OXY			
	Soil Bore VL/	3: M, w, ± (Sec. ⊋ (VENT I-29 T18 R	3g		GPS: Coord. S Map Datum, Na		13 - 67/9 1 9 <u>E</u> 362/329 N		
8.13	Depth	CI.		PID		Ga	lor-	Time		
	60 165 67	FER 54	m PlEdi टना	11-4-C	<i>y</i>	FINE SHILL SA	NoA	0918		
								-		
						-				
			[·		-					
	The second secon	And the second s				- 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2				
The second secon	- constant	The second secon					The second secon			
and the second s										
					-		7			
			1.	-						
	DOWN TO @	10 75° c	k water + Sceeen	1010 E	10 3 All	wied to set	15 MIN, G	ld CI TEST Borred We 67:3 ck et Plug Bentenite		
						Signature De	R RASEN	n Date //-/2-04		

COPY

Rice Operating Co. 122 W. Taylor Hobbs NM, 88240


Project: Vent I-29
Project Number: None Given
Project Manager: Roy Rascon

Fax: (505) 397-1471 Reported:

Reported: 11/15/04 16:40

ANALYTICAL REPORT FOR SAMPLES

Sample ID		Laboratory ID	Matrix		Date Sampled	Date Received
SB @ 26'		4K.10008-01	Soil	(agadi sa i	11/04/04 10:20	11/10/04 07:50
SB @ 61'	12 L	4K10008-02	Soil	-7- 5.	11/04/04 11:24	11/10/04 07:50

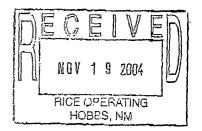



Rice Operating Co. 122 W. Taylor Hobbs NM, 88240 Project: Vent I-29
Project Number: None Given
Project Manager: Roy Rascon


Fax: (505) 397-1471

Reported:
11/15/04 16:40

Organics by GC Environmental Lab of Texas

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
SB @ 26' (4K10008-01) Soil									
Benzeno	0.0531	0.0250	mg/kg dry	25	EK41203	11/11/04	11/12/04	EPA 8021B	
Toluene	0.311	0.0250	и	•	m	n	a a	'n	
Ethylbenzene	0.546	0.0250	n	"	*	Ħ	*	*	
Xylene (p/m)	1.58	0.0250	1)	н	ħ	¥		4	
Xylene (o)	0.245	0.0250	.		17	B	11		
Surrogate: a,a,a-Trifluorotoluene		174 %	80-	120 -	μ	н	•	ħ	S-04
Surrogate: 4-Bromofluorobenzene		112 %	80-,	120	1/	"	**	*	
Gasoline Range Organics C6-C12	277	10.0	mg/kg dry	1	EK40906	11/10/04	11/11/04	EPA 8015M	
Diesel Range Organics >C12-C35	468	10.0	w	4	п	n	H	υ	
Total Hydrocarbon C6-C35	745	10,0	п		11		H .	9	
Surrogate: I-Chlorooctane		76.8 %	70	130	5 T	**	if	"	
Surrogate: 1-Chlorooctadecane		79.8 %		130	, 4	" .	#	m	
SB @ 61' (4K10008-02) Soil			and the second	a sagarangan Sagarangan	e esta a super la La compete a la La compete a la compete				
Benzene	ND		mg/kg dry	25	EK41501		11/12/04	EPA 8021B	Marin Brasilian
Toluene	ND	0.0250			and the state of t	PADE NEW YORK	Gouzede,	Same Made to	Language A
Ethylbenzene	ND	0.0250	mis i sumas sulfine # 1 mg	n No ne de mai 128	The grant of the second of the		10 (p/m)4	n	in the second second
Xylone (p/m)	ND	0.0250	with applying	grade a Maria	1		15 (9) <u>(</u>	and a Marian	
Xylene (o)			under Seige	agenta en ∎a esta Ostantia	nigo			efficient in legan.	2
Surrogate: a,a,a-Difluorotoluene		92.4%	80-	120	71.00			e jeggara <mark>g</mark> orane w	the class of the most term.
Surrogate: 4-Bromofluorobenzene	a Augusti, et est est	103 %	80-	120			and property.		
Gasoline Range Organics C6-C12	ND	10.0	mg/kg dry	1	EK40906	11/10/04	11/7,1/04	EPA 8015M	
Diesel Range Organics >C12-C35	ND	10.0	n	17	ŧ)	п	11	Ħ	
Total Hydrocarbon C6-C35	ND	10.0	11	п	11	#		٧	
Surrogate: I-Chlorooctane		85,2 %	70-	-130	"	п	17	N	
Surrogate: 1-Chlorooctadecane		97.8 H	70-	-130		ır	Ħ	н	



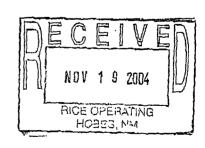

Environmental Lab of Texas

The results in this report apply to the samples analyzed in accordance with the samples received in the laboratory. This analytical report must be reproduced in its entirety, with written approval of Environmental Lab of Texas.

Page 2 of 10

Rice Operating Co. 122 W. Taylor Hobbs NM, 88240


r Project: Vent I-29
Project Number: None Given
Project Manager: Roy Rascon

Fax: (505) 397-1471

Reported:
11/15/04 16:40

General Chemistry Parameters by EPA / Standard Methods Environmental Lab of Texas

		Reporting						٠, ۵,۵	
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
SB @ 26' (4K10008-01) Soil									
Chloride	404	20.0	mg/kg Wet	2	EK41209	11/10/04	11/11/04	SW 846 9253	
% Moisture	6.0		%	1	EK41101	11/10/04	11/11/04	% calculation	
SB @ 61' (4K10008-02) Soll									
Chloride	ND	20.0	mg/kg Wet	2	EK41209	11/10/04	11/11/04	SW 846 9253	
% Moisture	4.0		%	1	EK41101	11/10/04	11/11/04	% calculation	

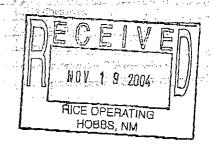




	m: Habbe	Location:	Soi	l Bore	
Snii A				GW:e 62' Landowner.	
UEV 2	lore: Recy coun	1/ L = 1			
-	OHC 199	I/7 R se		GPS: Coord, System U Map Datum Nad83	
Depth	A sales	Will Comment	100	Map Dalum Nad83	TM //3 87/4/27 72
	- Table	EID			3/1/9/19//
16	27	3/0	And the second second	Color	
1	107 1	1 77	the said the said the		Time
1	1171			The state of the s	
3/	277.			- Little Color	
26	1. 5 / Land	113			The state of the state of
\vec{j}					
				Links of the Same and	
				calied hide reck	
W		9.7		Mal Sun California	
51	46	1 37		Bran Carl	The second secon
	?				
67 1		43	Makerin.		
1005					
1				till house and	
P. M. D. G.				Some March	9000
The Park	Association of the second				
700				- Cur	The state of the s
	Letter Time				
S. S. Seller	The state of the s				
			AL WITCH	William States	
		Trans.	and the second s		
المالة المالة					
- IT	Treund we	the area			
		-	Look	cictoric G bors	
n	W		-		
	2.16.800	A CONTRACTOR OF THE PARTY OF TH			70
	10.000				
		and the second s	Simm	me Avallana. Da	m // = / 6 U



Rice Operating Co. 122 W. Taydor Highbs NM, 88240 Project: Background Bore Project Mumber: None Given Project Manager: Kristin Pope Fax: (205) 397-1471 Reported: 11/12/04 16:02

General Chemistry Parameters by EPA / Standard Methods Environmental Lab of Texas

Andre	Freed	lezpeating Limit Units	Dilaton Buch	Property	Analyzed	Melland	Notes
SB @ 61 N (4K10006-01) Sell							on.
Colorido	M	20.0 mg/kg Wes	2 EK41209	11/16/04	11/11/04	SW \$46 9233	

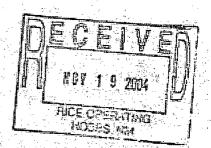




Rice Operating Co. 122 W. Taylor Hobbs NM, 88240

Project: Background Buse Project Number: None Given Project Munager: Kristin Pope Fax: (505) 197-1471 Reported:

11/12/04 15:02

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Data Received
SB @ 61 th	4K10006-01	Soil	11/03/04 00:00	11/10/04 07:50

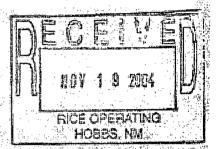



Modeling Input Parameters & Results



R.T. Hicks Consultants, LTD

APPENDIX C

To model the impact of the vadose zone remedy on ground water at the I-29 Vent site, output from HYDRUS-1D is used as input to a ground water mixing model.

HYDRUS-1D modeling simulates water and chloride fluxes through the vadose zone. The HYDRUS-1D output becomes the input to a simple ground water mixing model to predict chloride concentration in a simulated monitoring well immediately down-gradient of the site. Section 3.0 of "Modeling Study of Produced Water Release Scenarios" (Hendrickx, et al., 2005) provides a general description of this modeling approach (see the Works Consulted section at the end of this document).

The observed vadose zone chloride profile was installed in the model. The present chloride load within the soil profile is the result of all previous activities at the site and is based upon field observation and analysis producing the most accurate modeling approach.

INPUT DATA:

Modeling inputs for the 1-29 Vent site are presented in Table C-1.

Table C-1: I-29 HYDRUS-1D and Mixing Model Input Parameters

Source
I-29 field data and professional judgement
I-29 field data
Professional judgement
2004 Hobbs, NM, data and Pearl Weather Station data
HYDRUS-1D initial condition simulation
From ROC field measurements
Field measurement
Chemical analysis
Calculated from published data
Conservative choice



SOIL PROFILE

The I-29 Vent model has a vadose zone soil profile constructed from the lithologic logs of the I-29 Vent boring and five other borings in Section 29. The model's soil profile is representative of a soil profile excavated to a depth of 19 feet bgs. Although the I-29 Vent site was not excavated to this great a depth, this choice is conservative of ground water quality in that the upper 19 feet of the model's soil profile have been replaced with materials featuring equal or greater hydraulic conductivities than the materials at the I-29 Vent site (See Plate 3).

Vadose zone thickness is about 67 feet at the I-29 Vent site. The model uses a thickness of 60 feet. The effect of this difference is to reduce time of transit of infiltrated water through the vadose zone.

DISPERSION LENGTHS

Because of Hicks Consultants' recent experience with similar soils conservative dispersion lengths were employed. Standard practice calls for employing a dispersion length that is 10% of the model length. For each lithologic unit identified in Plate 3, a dispersion length less than 6% of the model thickness was installed (Table C-2 presents the dispersion lengths for each lithology).

I-29 Hydrus-1D Soil Profile Properties Dispersion % of Profile Material Description Length (cm) (cm) Length Sandy loam 30 50 1 2.78 2 Caliche-sand 60 30 1.67 3 Caliche 90 10 0.56 4 Sand-silt 1070 100 5.56 Loamy sand 550 100 5.56

Table C-2: I-29 Dispersion Lengths

CLIMATE

Weather data used in the predictive modeling include Hobbs data from November, 2003, to December, 2004, plus an additional 45 years from the Pearl Weather Station, approximately 11 miles west of the Hobbs Airport. The Pearl Weather Station is the closest station to the I-29 Vent site with sufficiently complete weather data for the HYDRUS-1D input files.

Heralogic b

coodelare koos waxannadigilik

Corrective Action Plan I-29 Vent Site Section 29, T18S, R 38E NMOCD CASE 1-R0428-41

SOIL MOISTURE

An initial soil moisture condition was obtained running a HYDRUS-1D simulation for 45 years using the weather data from the Pearl Weather. Station. Because soils are relatively dry in this climate and vadose zone hydraulic conductivity varies with moisture content, it is important that simulation experiments of different remedial strategies begin with an initial "steady state" soil moisture content. Vegetation was not allowed in order to create a "wetter" initial condition. This choice is conservative of ground water quality in that "wetter" soils have greater hydraulic conductivities.

The calculation of soil moisture content begins with an initial soil moisture input estimated by professional judgment. Then, sufficient years of weather data are run through the model to establish a "steady state" moisture content. Because only minimal changes in the HYDRUS-1D soil moisture content profile occurred after year 30 of the initial condition calculation, a 45 year simulation was considered acceptable to establish the initial moisture condition. Soil profiles hydrated in this manner were used in all simulations of chloride movement.

INITIAL CHLORIDE PROFILE

the letter. It is

From the observed field data generated by ROC personnel, linearly interpolated chloride concentrations were assigned to the model's more finely spaced nodes of the hydrated soil profile.

MIXING MODEL INPUTS:

INFLUENCE DISTANCE

As the vent was oriented vertically, the affected surface area is small. Significant lateral impacts were not observed; therefore, the affected diameter of the site parallel to ground water flow was concluded to be less than or equal to 20 feet.

BACKGROUND CHLORIDE CONCENTRATION

From nearby well data, a value of 100 mg/L chloride for ground water was used for the predictive modeling.

PAGE PAGE

HYDRAULIC CONDUCTIVITY

Hicks Consultants believes that the hydraulic conductivity of the saturated zone at the I-29 Vent site is similar to that observed for the Ogallala Aquifer throughout the general area. McAda (1984) simulated water level declines using a two-dimensional digital model and employed hydraulic conductivity values of 51–75 feet/day (1.9 E-4 to 2.8 E-4 m/s) in the area. According to Freeze and Cherry (1979), these values correspond to clean sand, which agrees with nearby lithologic descriptions of the saturated zone. A value of 45 feet/day was assumed for hydraulic conductivity of the uppermost saturated zone to be conservative of ground water quality.

GROUNDWATER GRADIENT

A hydraulic gradient of 0.0063 was calculated for this site (Intera Report and USGS Topographic Map). Using a hydraulic conductivity of 45 ft/day, ground water flux is calculated as 8.6 cm/day.


AQUIFER THICKNESS

Field data within Section 29 demonstrate that the aquifer is greater than 40 feet thick. A restricted aquifer thickness of 10 feet was employed in the mixing model in accordance with OCD request. This choice is conservative of ground water quality as it results in higher predicted chloride concentrations in a simulated monitoring well.

MODELING RESULTS:

Using the input data described above, HYDRUS-1D and the ground water mixing model predict no exceedance of WQCC ground water standards at the I-29 Vent site (see Figure C-1). For this simulation, it was assumed that no vegetation is present at the site.



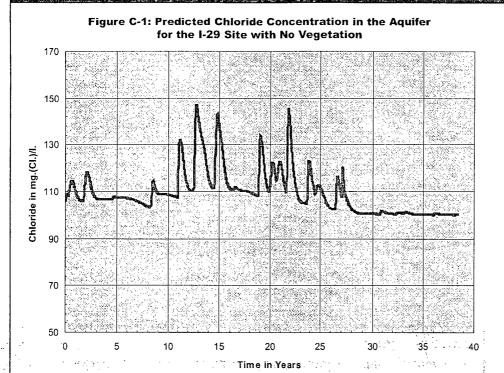

As field chloride data demonstrate, impacts at this site are marginally greater than background; thus, an insignificant impact to ground water quality would be expected. As shown in Figure C-1, chloride concentration in the aquifer attains a maximum of 147 ppm approximately 13 years from now. The effect of the chloride load is no longer distinguishable 29 years from now.

Chloride concentration in ground water varies in response to natural causes. At a nearby background monitoring well, over four years of data show that chloride concentration ranges from 111 mg/L to 301 mg/L with an average concentration of 159 mg/L and a standard deviation of 59 mg/L. Therefore, the predicted chloride concentration increase at the I-29 site (47 mg/L) could not be differentiated from natural variation.

Works Consulted



R.T. Hicks Consultants, LTD

APPENDIX D

Ash, S.R., 1963, Ground water conditions in northern Lea County, U.S. Geological Survey Hydrologic Investigations Atlas HA-62.

Hendrickx, J., Rodriguez, G., Hicks, R. T., and Simunek, January 2005, Modeling Study of Produced Water Release Scenarios, API Publication Number 4734, 11 pp.

Intera Incorporated, July 8, 2003, Windmill Oil Site Ground Water Sampling Results, prepared for the New Mexico Oil Conservation Division, 3 pp.

McAda, D.P., 1985, Projected water-level declines in the Ogallala aquifer in Lea County, New Mexico, US Geological Survey Water-Resources Investigations Report 84-4062, 84 pp.

Musharrafieh, G. and Chudnoff, M., January 1999, Numerical Simulation of Groundwater Flow for Water Rights Administration in the Lea County Underground Water Basin New Mexico, New Mexico Office of the State Engineer Technical Report 99-1, 6 pp.

Nicholson Jr., A. and Clebsch, A., 1961, Geology and Ground Water Conditions of Southern Lea County, New Mexico, Ground Water Report 6, US Geological Survey, New Mexico Bureau of Mines and Mineral Resources.

901 Rio Grande Blvd NW ▲ Suite F-142 ▲ Albuquerque, NM 87104 ▲ 505.266.5004 ▲ Fax: 505.266-0745

October 20, 2004

Mr. Wayne Price New Mexico Oil Conservation Division 1220 South St. Francis Drive Santa Fe, New Mexico 87505

RE: Hobbs SWD System Abandonment

Potential Groundwater-Impacted Junction Box Sites

Case 1R0414

Dear Mr. Price

This letter serves as our notification for conducting field work associated with the above-referenced project. We will commence field work on November 2.

As discussed in our approved workplan, we have identified five sites that are supposed workplan, we have identified five sites that are supposed workplan. representative of the system and we plan to install one boring at each site. These five sites are: The second of the second of the sites are the second of the sites are the second of the second of

- 1: I-29 Vent Produced Water Pipeline Vent 18S.38E.29.I
 2: I-29 EOL Boot End of Line Boot 18S.38E,29.I
 3: O-29 Vent Produced Water Pipeline Vent 18C.207

- 4. F-29-1A Junction Box 18S.38E.29.F
- 5. F-29-1B Produced Water Pipeline Boot 18S.38E.29.F

Below, we outline our approach as described in the workplan and in response to your August 6, 2004 conditional approval.

1. We will locate the vertical definition sampling borehole as close as practical to the suspected release source.

The state of the s

- 2. From each boring, we will obtain a split-spoon soil sample every five or ten feet throughout the entire vadose zone (ground surface to ground water).
- 3. We will evaluate these discrete samples, the borehole drilling characteristics, and drill cuttings to develop a lithologic profile of the vadose zone.
- 4. We will employ standard methods, as described in the Junction Box Replacement Program Plan, to evaluate all soil samples in the field for chloride content, TPH and volatile organic constituent content.
- 5. We will submit at least one soil sample from each boring to a qualified laboratory for evaluation of chloride and BTEXN (benzene, toluene, ethylbenzene, xylene, naphthalene). The field geologist will identify samples for laboratory analysis after review of the field analysis of chloride, TPH and VOCs. For all borings, we will submit the deepest sample for laboratory analysis of these constituents.

- 6. The geologist will select two samples from the first boring and two samples from the fourth boring for laboratory analysis of soil moisture content and bulk density.
- 7. We will obtain a background soil sample at a depth of about 5 feet at a location 300 feet from any visible or suspected surface releases.
- 8. If field analyses of a borehole show chloride concentrations are consistently greater than 3 times background from ground surface to ground water, we will conclude that periodic discharges from the source created saturated conditions in the past. For any borehole that encounters these potential saturated conditions, we will continue drilling through the saturated zone to the top of the Dockum Group red beds, which form the base of the aquifer in this area. If the saturated thickness of the aquifer in this boring is less than 25 feet, we will install a 2-inch monitoring well with five feet of screen above the water table and 15 feet below the water table, in a manner consistent with industry standards (see NMOCD, ASTM or EPA publications).
- 9. If the saturated thickness of the aquifer is greater than 25 feet we will install one well screen as described above and a second 5-foot screen above the top of the Dockum Group red beds.
- 10. We will sample any ground water monitoring wells using micro-purge and "no-purge" techniques to collect two separate samples from this "flow through" monitoring well. We will collect a water sample just below the air water interface; which will be employed for evaluation of any impact from a release of hydrocarbons love to as well as chloride and TDS. At the bottom of the aquifer we will obtain a second ride and TDS sample, which we will test for chloride TDS.
- 11. We expect no material horizontal migration from these potential release sites. If previous excavation work did not provide adequate horizontal characterization, we will provide a protocol for such characterization after our evaluation of these vertical delineation borings.


If you have any questions concerning this field program, please contact Andrew Parker of my staff or me.

Sincerely,

R.T. Hicks Consultants, Ltd.

Randall Hicks Principal

Copy: Rice Operating Company

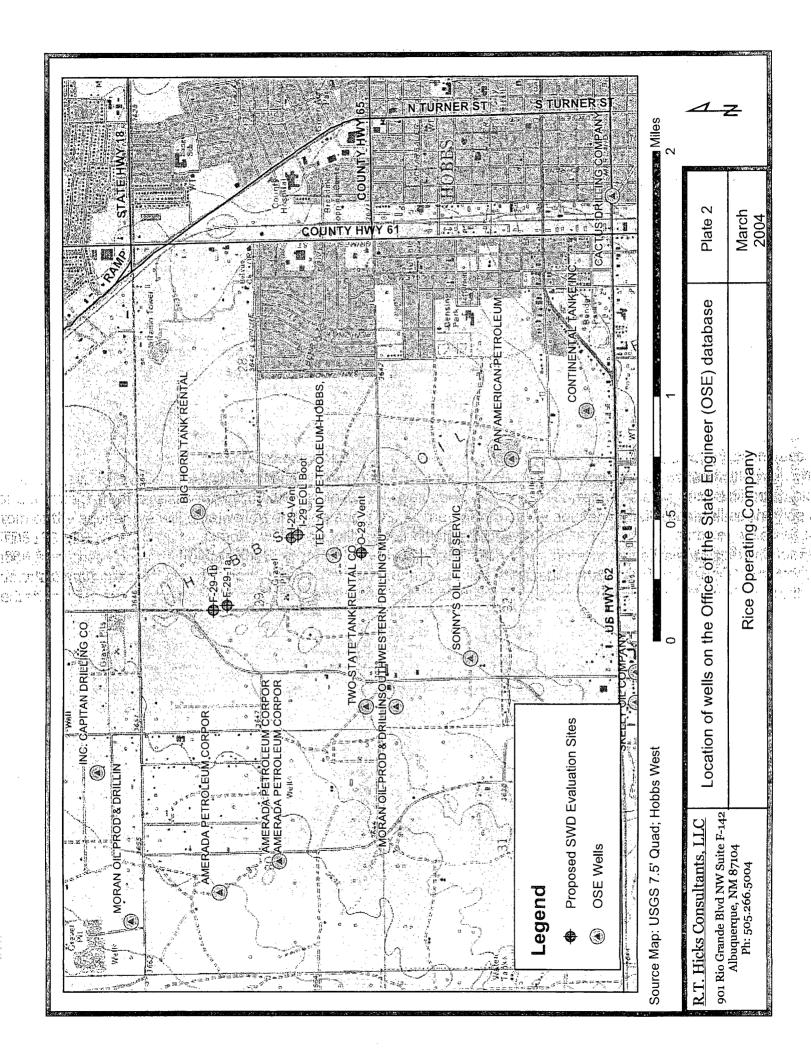

901 Rio Grande Blvd NW ▲ Suite F-142 ▲ Albuquerque, NM 87104 ▲ 505.266.5004 ▲ Fax: 505.266-0745

March 11, 2004

Mr. Wayne Price New Mexico Oil Conservation Division 1220 South St. Francis Drive Santa Fe, New Mexico 87505

RE: Hobbs SWD System Abandonment

Potential Groundwater-Impacted Junction Box Sites

Dear Mr. Price

Rice Operating Company (ROC) retained Hicks Consultants to address potential environmental concerns at the above referenced sites. This submission proposes a scope of work that we believe will best mitigate any threat to human health and the environment and lead to closure of the regulatory file for this site.

Background

Plate 1 shows the location of the area of the Hobbs SWD System that is the subject of this work plan. During the abandonment process, ROC found evidence of produced water leakage at 36 sites (see Table 1 and Plate 1). Our initial field inspection suggests that past releases at some of these sites are very minor and will pose no threat to human health or the environment, including surface soil. Nevertheless, we propose a more thorough examination of these sites and submission of our findings.

The Hobbs SWD System operated at a capacity of about 40,000 barrels/day from the late 1950s to the late 1980s. During the past decade, about 1000 barrels/day flowed through the system. We believe that the soil staining and other evidence of produced water leakage at these 36 sites dates to the time when the system was operating at capacity. We hypothesize that accidental releases to the environment at many of these sites ceased in the 1990s and natural restoration has mitigated the effects of any past releases. At most release sites, we witnessed no vegetation stress that we could attribute to any past releases. Our proposed scope of work is outlined below.

Task 1 Collect Regional Hydrogeologic Data

Within the area shown on Plate 1, we found over 2000 wells in the database of the Office of the State Engineer (OSE). Plate 2 shows the location of selected water wells on the OSE and USGS database. Table 2 identifies the well owners and certain other specifics regarding these selected wells. We understand that the NMOCD is currently obtaining water levels and water quality samples in support of an investigation of the nearby Windmill Oil Company site (Section 30). We understand that the results of the NMOCD study are not presently available. We do not plan to duplicate NMOCD efforts and Table 2 excludes all wells found in Section 30.

Nevertheless, we require some regional data in order to proceed in a timely fashion. We will attempt to sample at least 10 wells identified in Table 2 to provide an understanding of the regional water quality. Where possible, we will obtain static water levels from these wells. For each of these wells, we will obtain available driller's logs to help us define the regional geology.

We will evaluate these data, data available from the NMOCD investigation of the Windmill Oil Company, published data, and available historical data from the USGS database. The purpose of this research is to assist us with the planning of the proposed drilling program (Task 2).

Task 2 Evaluate Chloride and BTEXN Concentrations in Soil at Five Sites, Evaluate Ground Water Quality if Necessary

We have identified five sites that are representative of the system and we plan to install one boring at each site. These five sites (see Plate 1 and Table 1) are:

	1.	I-29 Vent	Produced Water Pipeline Vent	18S.38E.29.I		
	2.	I-29 EOL Boot	End of Line Boot	18S.38E,29.I		
	3.	O-29 Vent	Produced Water Pipeline Vent	18S.38E.29.0		
		F-29-1A	Junction Box A Transfer Transfer		•	
A	5.	F-29-1B	Produced Water Pipeline Boot	18S.38E.29.F		Produció
250 STR 1009 6 1	1 1:1	h problégativé	HILL STATE OF THE		or fey a hispathy	

We will locate the sampling borehole as close as practical to the suspected release source. Due to the presence of caliche in the subsurface, we plan to employ air-rotary drilling techniques.

From each boring, we will obtain split-spoon soil samples every five or ten feet of the vadose zone.

and her laces on one is langed by the high photosic before is 200 found as loss can conclude a last the high warrant

We will evaluate these discrete samples, the borehole drilling characteristics, and drill cuttings to develop a lithologic profile of the vadose zone. We will employ standard methods, as described in the Junction Box Replacement Program Plan, to evaluate all soil samples in the field for chloride content, TPH and volatile organic constituent content. We will submit at least one soil sample from each boring to a qualified laboratory for evaluation of chloride and BTEXN (benzene, toluene, ethylbenzene, xylene, naphthalene). The field geologist will identify samples for laboratory analysis after review of the field analysis of chloride, TPH and VOCs. The geologist will select two samples from the first boring and two samples from the fourth boring for laboratory analysis of soil moisture content and bulk density. We will also obtain a background soil sample at a depth of about 5 feet.

If field analyses of a borehole show chloride concentrations are consistently greater than 3 times background from ground surface to ground water, we will conclude that periodic discharges from the source created saturated conditions in the past. For any borehole that encounters potential saturated conditions, we will continue drilling through the saturated zone to the top of the Dockum Group red beds, which form the base of the aquifer in this area. If the saturated thickness of the aquifer in this boring is less than 25 feet, we will install a 2-inch monitoring well with five feet of screen above the water table and 15 feet below the water

table, in a manner consistent with industry standards (see NMOCD, ASTM or EPA publications). If the saturated thickness of the aquifer is greater than 25 feet we will install one well screen as described above and a second 5-foot screen above the top of the Dockum Group red beds. We will use micro-purge and "no-purge" techniques to collect two separate samples from this "flow-through" monitoring well. We will collect a sample the air water interface, which will be employed for evaluation of any impact from a release of hydrocarbons as well as chloride and TDS. At the bottom of the aquifer we will obtain a second sample, which we will test for chloride TDS. Appendix A describes the "no-purge" sampling technique we plan to employ at this site after initial sampling using micro-purge techniques.

Task 3 Evaluate Chloride, Benzene and Naphthalene Flux from the Vadose Zone to Ground Water

We anticipate that one or all of the five sites selected for borehole investigation will show evidence of seepage from the source to a depth of more than 10-feet. For these sites, excavation and disposal of released material can cause more environmental damage than it cures. For such sites, we propose to employ HYDRUS-1D and a simple ground water mixing model to evaluate the potential of any residual chloride and hydrocarbon mass in the vadose zone to materially impair ground water quality at the site. We will employ predictions of the migration of chloride ion, benzene and naphthalene from the vadose zone to ground water in our selection of an appropriate remedy for the land surface and underlying vadose zone. This simulation is the "no action" alternative, which predicts chloride flux to ground water in the absence of any action by ROC. We have selected these three constituents for simulation modeling because each of these constituents exists in the fluids stored in the tanks and each is specifically regulated by New Mexico ground water regulations (WQCC):

We will employ the input parameters to HYDRUS and the mixing model outlined in Table 3. In

Table	e 3: Input Parameters for HYDRUS-1D
Input Parameter	Source
Vadose Zone Thickness	Proposed borings and/or well logs on file with the OSE
Vadose Zone Texture	Proposed borings and well logs on file with the OSE
Dispersion Length	Professional judgment, typically 10% of the model length
Soil Moisture	Field Measurements from borings and/or HYDRUS-1D simulations
Vadose Zone Chloride Load	Sampling data from proposed borings
Length of release	Field Measurements, these sites are generally less than 30 feet in
perpendicular to ground	diameter
Climate	Pearl, NM station (Hobbs)
Background Chloride in Ground Water	Samples from water supply wells
Ground Water Flux	Calculated from regional hydraulic data, data from nearby wells, and published data
Aquifer Thickness	Nicholson and Clebsch (1960), and well logs on file with the OSE

the no action simulation, we will assume that vegetation is present over the release site. This assumption is consistent with our site observations. We anticipate that any release of chloride to ground water will disperse throughout the entire thickness of the aquifer after a short travel distance. Unless the hydrogeology of the site suggests differently (see Task 1), we plan to use the entire aquifer thickness as the input to the mixing model equation. For hydrocarbons, such as benzener and naphthalene, assuming a chemical stratification within the aquifer is appropriate. For these constituents, we plan to use only the uppermost 10 feet of the aquifer in the mixing model equation

Task 4 Design Corrective Action Plan

After ROC completes the abandonment of the Hobbs SWD System, there can be no additional releases of produced water. Our modeling of the "no action alternative" at these five sites may show that the residual chloride and hydrocarbon mass in the vadose zone poses a threat to ground water quality. If such a threat does exist, we will expand upon the HYDRUS-1D model predictions described above to develop a remedy for the vadose zone. If necessary, we will simulate:

1. excavation, disposal and replacement of clean soil to remove the chloride and hydrocarbon mass,

and walface to the contraction of the enterior action of the tent to the tent that the contract and contract the contract and the contract and

- 2. installation of a low permeability barrier to minimize natural infiltration.
 - 3. surface grading and seeding to eliminate any ponding of precipitation and promote evapotranspiration, thereby minimizing natural infiltration, and
 - 4. a combination of the above potential remedies.

We will select the vadose zone remedy that offers the greatest environmental benefit while causing the least environmental damage. We will provide a Net Environmental Benefit Analysis to support our selection of the remedy.

We will use the ground water mixing model or a suitable alternative to assist in the design of any required ground water remedy. It is possible, however, that the background chloride and /or hydrocarbon concentrations in ground water measured in the nearby wells are equal to or higher than the concentration in any monitoring well installed under this work plan. Such data would strongly suggest that the site in question has not caused any material impairment of ground water quality. If we find no evidence of impairment of water quality due to past activities, we will not prepare a ground water remedy. If data suggest that the site has contributed chloride or hydrocarbons to ground water and caused ground water impairment, we will examine the following alternatives:

- 1. Natural restoration due to dilution and dispersion,
- 2. Pump and dispose to remove the chloride and hydrocarbon mass in the saturated zone,

- 3. Pump and treat to remove the chloride and hydrocarbon mass in the saturated zone,
- 4. Because of the location of the site, institutional controls negotiated with the landowner may provide an effective remedy. Such controls may be restriction of water use to livestock until natural restoration returns the water quality to state standards, a provision for alternative supply well design, or a provision for well head treatment to mitigate any damage to the water resource.

We will select the ground water remedy that offers the greatest environmental benefit while causing the least environmental damage. We will provide a Net Environmental Benefit Analysis to support our selection of the remedy. We may propose additional ground water monitoring wells to support the evaluation and selection of a remedy.

We plan to deliver a Corrective Action Plan that is similar to the Junction Box Replacement Program Plan. This type of submittal will allow ROC to evaluate each site, prioritize the restoration of each site based upon a risk profile, and then begin restoration of those sites that pose the highest risks. Depending upon the results of the work described herein, ROC may elect to move forward with an area-wide plan rather than proposing 36 individual remedies.

We propose to complete the work of described in Tasks 1-3, begin the work outlined in Task 4 and then meet with NMOCD to discuss the scope of the final submittal.

We plan to commence data collection for the HYDRUS-1D simulations described above in lateral l

, reporte compare con secono de la participa de la proposición de la proposición de la proposición de la propo


Sincerely,


R.T. Hicks Consultants, Ltd.

Randall T. Hicks Principal

Copy:

Rice Operating Company

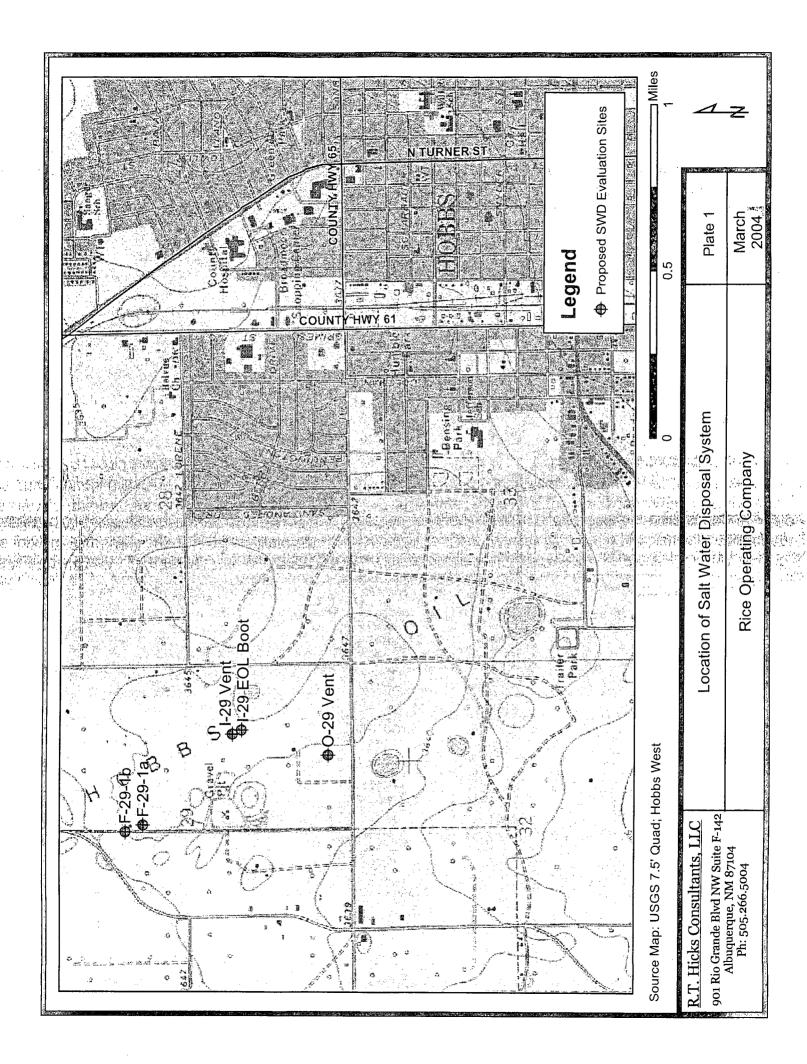

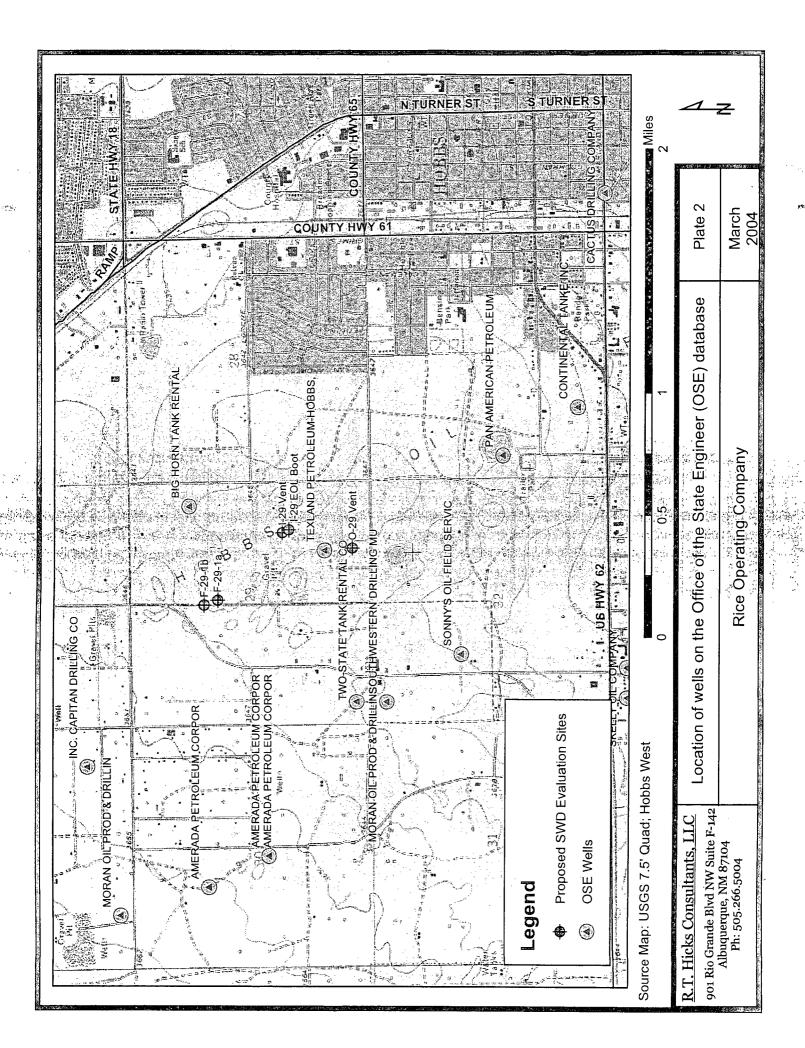

1 0 0

HOBBS Junction Box Disclosures: Potential Groundwater Impact

These junction box sites have become "disclosure" rather than "closure" sites because significant TPH or salt impact has deemed the site remediation to be delineaton results. As noted, some of the sites are confirmed to have groundwater impact and have been officially reported to the NMOCD and are being outside the scope of the Rice Operating Company Generic Junction Box-Plant Each of these sites has the potential for groundwater impact, based on monitored for groundwater quality. These sites are being evaluated for risk-based corrective action and plans will be submitted to the NMOCD.

F-24-3 Vent	Hobbs	ഥ	Sec 24, T18S, R37E	<50		MM	Initial evaluation only	1/31/2003
F-25 EOL	Hobbs	Н	Sec 25, T18S, R37E	<50		MN	Initial evaluation only	1/31/2003
M-20 Vent	Hobbs	M	Sec 20, T18S, R38E	<50%	Application of the second	Samuel Bruton	Initial evaluation only	1/31/2003
E-29 Vent	Hobbs	日	Sec 29, T18S, R38E	<50	Orang M	Oxy Permian	Initial evaluation only	1/31/2003
I-29 EOL	Hobbs	I	Sec 29, T18S, R38E	<50-		Oxy Permian	Initial evaluation only	1/31/2003
K-29 EOL Boot	Hobbs	K	Sec 29, T18S, R38E	<50;		Oxy Permian	Initial evaluation only	1/31/2003
0-29 EOL	sqqoH	0	Sec 29, T18S, R38E	<50		Oxy Permian	Initial evaluation only	1/31/2003
O-29 Vent	Hobbs	0	Sec 29, T18S, R38E	<50	第二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十	Oxy Permian	Initial evaluation only	1/31/2003
O-29-1 Vent	Hobbs	0	Sec 29, T18S, R38E	<50	於 建武器	Oxy Permian	Initial evaluation only	1/31/2003
P-29 Vent	Hobbs	Д	Sec 29, T18S, R38E	<50		Oxy Permian	Initial evaluation only	1/31/2003
C-30 Vent	Hobbs	Э	Sec 30, T18S, R38E	<50		James Hanson	Initial evaluation only	1/31/2003
Jct. F-31-1	Hobbs	F	Sec 31, T18S, R38E	<20	· 1000 1000 1000 1000 1000 1000 1000 10	V. R. Jones	Initial evaluation only	1/31/2003
Jct. F-31-2	Hobbs	H	Sec 31, T18S, R38E	<20		V. R. Jones	Initial evaluation only	1/31/2003
B-32 Boot	Hobbs	В	Sec 32, T18S, R38E	<20		Oxy Permian	Initial evaluation only	1/31/2003
F-33 Vent	Hobbs	F	Sec 33, T18S, R38E	<50		NM	Initial evaluation only	1/31/2003
A-6 Vent	Hobbs	Y	Sec 6, T19S, R38E	<20	And Sandy by Sandy	MN - Francisco	Initial evaluation only	1/31/2003
Jct. A-25	Hobbs	Y	Sec 25, T18S, R37E	< 20 =	最高级	NM S	Initial evaluation only	1/31/2003
Jct. P-31	Hobbs	ď	Sec 31, T18S, R38E	<50		Kress Jones	Initial evaluation only	1/31/2003
Jct. F-24-1	Hobbs	F	Sec 24, T18S, R37E	<50°±		MN SEE SEE	Primary Delineation only	1/31/2003
Jct. F-29-1A	Hobbs	Ł	Sec 29, T18S, R38E	<20	The same with	Oxy Permian	Primary Delineation only	1/31/2003
Jct. F-29-1B (G-29)	Hobbs	F	Sec 29, T18S, R38E	<20;		Oxy Permian	Primary Delineation only	2/4/2004
I-29 Vent	Hobbs	I	Sec 29, T18S, R38E	<20;	नाहर्षेत्र अंदेश	**Oxy Permian	Primary Delineation only	1/31/2003
F-30 Vent	Hobbs	Я	Sec 30, T18S, R38E	<20 :	Partonian	James Hanson etux	Primary Delineation only	1/31/2003
Jct. L-30	Hobbs	Т	Sec 30, T18S, R38E	< 20 %	181 SA 685	MNExessor	Primary Delineation only	1/31/2003
Jct. E-32-1	Hobbs	Œ	Sec 32, T18S, R38E	<20	A STATE OF THE STATE OF	····Oxy Permian	Primary Delineation only	1/31/2003
Jct. E-32-2	Hobbs	囯	Sec 32, T18S, R38E	<20		Oxy-Permian	Primary Delineation only	1/31/2003
					15 × ×			

Page 1 of 2


NMPrimary Delineation only1/31/2003NMPrimary Delineation only1/31/2003Charles & CottrellPrimary Delineation only1/31/2003NMPrimary Delineation only1/31/2003Primary Delineation only1/31/2003Charles Seed TrstPrimary Delineation only1/31/2003NMPrimary Delineation only1/31/2003NMPrimary Delineation only1/31/2003Primary Delineation only1/31/2003T.A. DesotoInitial evaluation only9/11/2003				Control of the second					
Primary Delineation only	9/11/2003	Initial evaluation only	J. A. Desoto		<50	Sec. 4, T19S, R38E	M	Hobbs	vent M-4
Primary Delineation only	1/31/2003	Primary Delineation only	NM See See See See See See See See See Se	经过算报 线	<50-	Sec 33, T18S, R38E	田	Hobbs	Ict. E-33-2
Primary Delineation only	1/31/2003	Primary Delineation only	. v NM		<50	Sec 6, T19S, R38E	Α	Hobbs	Jct. A-6
Primary Delineation only	1/31/2003	Primary Delineation only	NM		<50	Sec 9, T19S, R38E	G	Hobbs	G-9 Vent
Primary Delineation only	1/31/2003	Primary Delineation only	Charles Seed Trst	Street was a result	<50	Sec 13, T18S, R37E	0	Hobbs	Jct. O-13 (N)
Primary Delineation only Primary Delineation only Primary Delineation only Primary Delineation only	1/31/2003	Primary Delineation only	NM S		<50	Sec 4, T19S, R38E	Ε	Hobbs	Jct. E-4
Primary Delineation only Primary Delineation only Primary Delineation only	1/31/2003	Primary Delineation only	Sage & Cottrell		<u>~20</u>	Sec 29, T18S, R38E	Н	Hobbs	Jct. H-29
Primary Delineation only Primary Delineation only	1/31/2003	Primary Delineation only	Dee Cochran	And the second s	<-20	Sec 5, T19S, R38E	0	Hobbs	O-5 Vent
Primary Delineation only	1/31/2003	Primary Delineation only	NM		<50.	Sec 4, T19S, R38E	N	Hopps	Jct. N-4
	1/31/2003	Primary Delineation only	WN X	A second constraint	0 5 >	Sec 33, T18S, R38E	E	Hobbs	Jct. E-33-1

NMOCD score, landowner, surface use, etc. in order to coordinate the most effective and timely use of resources. The Hobbs SWD System Environmental Operating Company Generic Junction Box Plan. As sites are prioritized, work plans will be developed and submitted to the NMOCD for review, feedback be a long-term endeavor, possibly 7-10 years. Each of these sites have significant TPH and salt impact and are deemed to be outside the scope of the Rice These Hobbs SWD System junction boxes, which have potential for groundwater impact, are not yet at a work-status to report as a disclosure. The Hobbs SWD System Environmental Committee has directed Rice Operating Company to prioritize the sites according to vadose zone and groundwater receptors, Committee is committed to completing the abandonment of the Hobbs SWD Gathering System, and projects the remediation of these junction box sites to and approval.

Page 2 of 2

a	
៳	
ä	
ã	
a	
_	
~~	
۳	
ш	
S	
ä	
~	
Φ	
모	
_	
Ε	
5	
_=	
4-	
S	
ਠ	
≍	
×	
Š	
Sec	
Rec	
II Rec	
/ell Rec	
Well Rec	
Well Rec	
er Well Rec	
iter Well Rec	
/ater Well Red	
Water Well Rec	
l Water Well Rec	
ed Water Well Rec	
ted Water Well Records from the OSE Database	
cted Water Well Rec	
ected Water Well Rec	
elected Water Well Rec	
elected	
elected	
Selected	
elected	

ב ייווא יונט ממ	בוב ע.	TABLE Z. GERECIEU WATER WEIL NECOLUS HOTH GRECOLE DATE WEIL WEILS			ć		i	Ċ	4
	nse Div	Owlei	well Debili	waler Depth well In	Source	ws King Sec	5	Dale	Date
- 06660 (E)	PRO	MORAN OIL PROD & DRILLIN	120	Ō	Shallow	18S 38E 19	3	3/23/1970	3/23/1970
	PRO	INC. CAPITAN DRILLING CO	110	40 7 MPANY L 06337	Shallow	18S 38E 19	4	6/10/1968	6/10/1968
	SAN	OIL FIELD RENTAL SERVICE	130	49 CO. L 08716	Shallow	18S 38E 20	2	3/23/1982	3/24/1982
	SAN	MACK TRUCK DEALERSHIP	120		Shallow	18S 38E 20	2 2	11/25/1977	11/27/1977
	SAN	STOEHR WIRE ROPE OF TEXA	120	60 SINC. L 09475	Shallow	18S 38E 20	2 2	5/7/1984	5/7/1984
	SAN	A.A. OILFIELD	120	源 北	Shallow	18S 38E 20	2 3	7/1/1982	7/2/1982
60080	SAN	INC. HOBBS DIESEL	167	60 F - 1 08009	Shallow	18S 38E 28	-	1/16/1979	1/20/1979
08867	SAN	BIG HORN TANK RENTAL	120	. 52	Shallow	18S 38E 29	2 2	7/9/1982	7/10/1982
	OBS	CROWN CHEMICAL COMPANY	207	50 L 07754	Shallow	18S 38E 29	2 4	9/8/1977	9/14/1977
06570 (E)	PRO	MORAN OIL PROD & DRILLIN	110	0	Shallow	18S 38E 29	3	8/5/1969	8/5/1969
07570	DOM	SOUTHWESTERN DRILLING MU	122		Shallow	18S 38E 29	3	6/21/1976	6/22/1976
07005	SAN	TWO-STATE TANK RENTAL CO	150	200.0° T	Shallow	18S 38E 29	3	10/14/1972	10/18/1972
11176		TEXLAND PETROLEUM-HOBBS,	220	65 FAID LLC L-11176	Shallow	18S 38E 29	4	7/31/2001	8/3/2001
02395	PRO	AMERADA PETROLEUM CORPOR	87	30 ATION L 02395	Shallow	18S 38E 30	1	8/31/1953	8/31/1953
05849	PRO	AMERADA PETROLEUM CORPOR	38	34 ATION L 05849	Shallow	18S 38E 30	4	2/10/1966	2/12/1966
05818	PRO	AMERADA PETROLEUM CORPOR	32	32 ATION 1 05818	Shallow	18S 38E 30	1	12/15/1965	12/17/1965
10093	PRO	WINDMILL OIL COMPANY	52	42 L 10093	Shallow	18S 38E 30	4	10/2/1989	10/2/1989
10094	PRO	WINDMILL OIL COMPANY	52	42 L 10094	Shallow	18S 38E 30	4	10/3/1989	10/3/1989
10095	PRO	WINDMILL OIL COMPANY	52	1 42 42 4 4 4 C 10095	Shallow	18S 38E 30	4	10/4/1989	10/4/1989
96001	PRO	WINDMILL OIL COMPANY	52	427 10096	Shallow	18S 38E 30	4	10/6/1989	10/6/1989
98660	PRO	WINDMILL OIL COMPANY	20	41- 41- 64- 64- 64- 64- 64- 64- 64- 64- 64- 64	Shallow	18S 38E 30	4	7/28/1987	8/1/1987
10097	PRO	WINDMILL OIL COMPANY	52	741 3 5 5 5 C 10097	Shallow	18S 38E 30	4	10/3/1989	10/4/1989
05874	SAN	STAR TOOL COMPANY	125	45 CE 05874	Shallow	18S 38E 32	-	3/2/1966	3/3/1966
10620	SAN	BULL DOG TOOL	158	43 E 10620	Shallow	18S 38E 32	1 3	12/17/1996	12/17/1996
10558	SAN	BULL DOG TOOL INC	120		Shallow	18S 38E 32	1	5/5/1996	5/15/1996
10035	SAN	BALER SERVICE TOOLS	150	65 5 5 5 5 10035	Shallow	18S 38E 32	<u>-</u>	10/20/1988	10/20/1988
	SAN	SONNY'S OIL FIELD SERVIC	150	34 EINC. L 06245	Shallow	18S 38E 32	···	12/29/1967	12/30/1967
02964	DOM	INC. BAKER OIL TOOLS	100	30 Per L 02964	Shallow	18S 38E 32	<u>ო</u>	9/10/1955	9/11/1955
02555	DOM	SKELLY OIL COMPANY	116	34 L 02555	Shallow	18S 38E 32	с С	6/25/1954	6/25/1954
	PRO	PAN AMERICAN PETROLEUM	120	, 517 52 554 (E)	Shallow	18S 38E 33	13	8/18/1969	8/19/1969
02232	DOM	CONTINENTAL TANKE INC.	112		Shallow	18S 38E 33	က	6/23/1953	6/23/1953
03516	PRO	CACTUS DRILLING COMPANY	106	45 C C C 03516 APPR	Shallow	18S 38E 34	с С	8/21/1956	8/22/1956

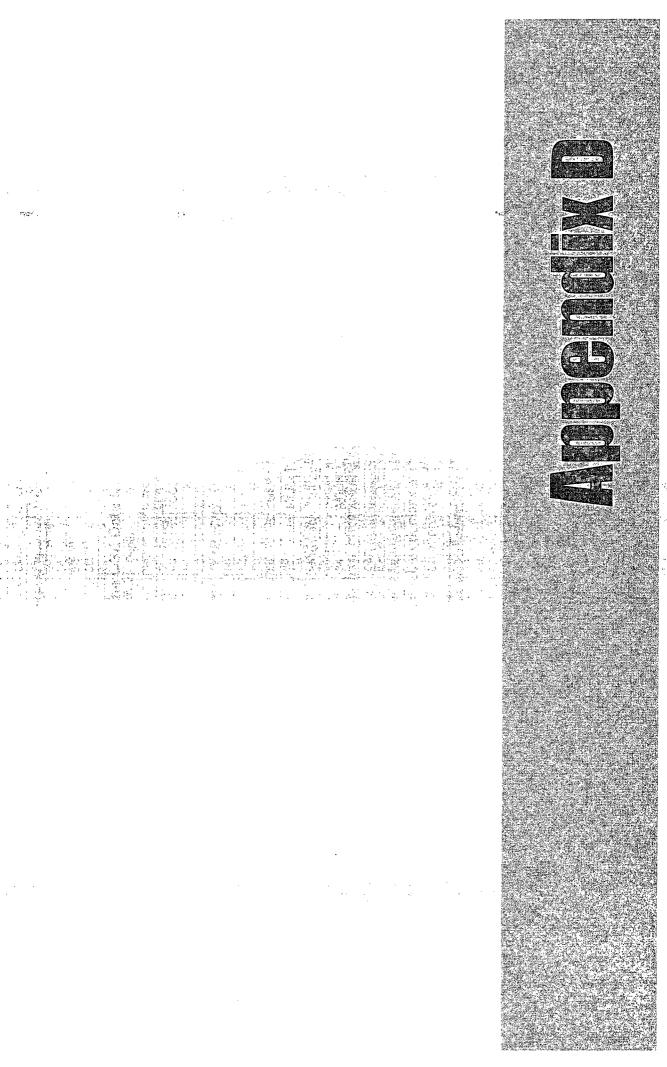

(* _{7 - 7}

mari.

