

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

RECEIVED

FEB 13 2009

HOBBSCO

Form C-141  
Revised October 10, 2003

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company	Occidental Permian Limited Partnership	Contact	Dusty Wilson
Address	1017 W. Stanolind Road, Hobbs, NM 88240	Telephone No.	575-441-7189
Facility Name	EC Hill B #2	Facility Type	Producing Well

Surface Owner	DK Boyd	Mineral Owner		Lease No.	
---------------	---------	---------------	--	-----------	--

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
N	27	23S	37E					

Latitude \_\_\_\_\_ Longitude \_\_\_\_\_

NATURE OF RELEASE

Type of Release	Produced Water	Volume of Release	100 bbls	Volume Recovered	90 bbls
Source of Release	Braden Head leak	Date and Hour of Occurrence	4-28-2008 6 a.m.	Date and Hour of Discovery	4-28-2008 8 a.m.
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Chris Williams		
By Whom?	Tony Summers	Date and Hour	4-28-2008 10 a.m. left message		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.\*

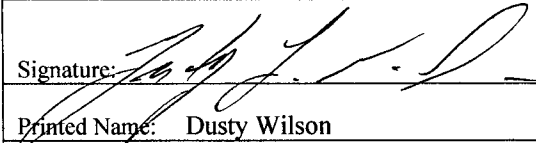
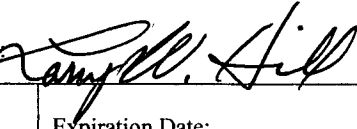
Describe Cause of Problem and Remedial Action Taken.\*

At approximately 8 am lease operator discovered wellhead leak coming from pinch nipple out of Braden head. On the end of the nipple was a closed gate valve. There was a split in nipple from exterior corrosion. Vacuum trucks were called and picked up free standing water. Backhoe was brought in ASAP and small 5' x 5' x 5' hole was dug to flow water into for containment. Another pit was dug next to it and Akome pit liners were called and arrived a few hours later. Pit was lined and flow was then diverted to that pit with vacuum trucks continuing to haul.

Describe Area Affected and Cleanup Action Taken.\*

Water ran across location, into pasture, and down Carter Foundation road for approx. 3/4 mile. BBC International was called in to assist. Samples were taken and a remediation plan was developed and submitted to Chris Williams. Chris Williams approved it on 8/18/08. Remediation activities were commenced and completed on 9/19/08.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Dusty Wilson	Approved by District Supervisor: 	
Title: HES Specialist	Approval Date: FEB 13 2009	Expiration Date:
E-mail Address: dusty-wilson@OXP.Com	Conditions of Approval:	Attached <input type="checkbox"/> IRP-1867
Date: 2/9/09	Phone: 575-441-7189	

\* Attach Additional Sheets If Necessary