Form 3160-5 (April 2004)

UNITED STATES DEPARTMENT OF THE INTERIOR BURGALLOELAND MANAGEMENT

1	FORM APPROVED		
&E - CFO	OMB No 1004-0135		
	Expires March 31, 200		

<u> </u>	REAU OF LAND MANAGE		1&E - (CFO :	expires March 31, 2007
SUNDRY NO	OTICES AND REPORT	S ON WELLS	•	5. Lease Serial N	No
Do not use this form for proposals to drill or re enter an		NM O	64023		
abandoned wel	1. Use Form 3160 3 (APD) fo	or such proposals.		6. If Indian, Allott	ee or Tribe Name
SUBMIT IN TRIPL	ICATE - Other instr	uctions on reverse sid	e	7. If Unit or CA/A	greement, Name and/or No.
1 Type of Well Oil Well Ga	s Well Other			8. Well Name an	
2. Name of Operator NWOC-O HV	C+D K	Mars ament		9. API Well No.	
3a. Address		Nanasemen + 3b. Phorid No. (include area code	e) .	30-	015-22348
4. Location of Well (Footage, Sec., T., R., M.	, OR Survey Description)				ol, or Exploratory Area
		330 FSL 22	SG FEL	EDDY CO, NM	
		NDICATE NATURE OF		EPORT, OR O	THER DATA
TYPE OF SUBMISSION		TYPE OF ACTION			
X Notice of Intent Subsequent Report Final Abandonment Notice	Acidize Alter Casing Casing Repair Change Plans Convert to Injection	Deepen Fracture Treat New Construction X Plug and Abandon Plug Back	Production Reclamation Recomplete Temporarily Water Dispe	; y Abandon	Water Shut-Off Well Integrity Other
If the proposal is to deepen directionally or reconstraint the Bond under which the work will be following completion of the involved operations testing has been completed Final Abandoning determined that the site is ready for final inspection of the involved operations. Set CIB 1 Set CIB 2 Signature 3 Install X2) Fertora For Suita Cut off Steel Pi	performed or provide the Bond No. If the operation results in a muent Notices shall be filed only affection) PO 1486 SSX from Dry hale M Le S1/2" C	o on file with BLM/BIA. Required sultiple completion or recompletion in a ner all requirements, including reclamation of the surface of the s	obsequent reports shinew interval, a Form on, have been comported by the component of the c	all be filed within 30 3160-4 shall be filed bleted, and the operato EE ATTAC ONDITION Cation	HED FOR S OF APPROVAL
14. I hereby certify that the foregoing is true	and correct				
Name (Prigled/Typed)		Title agent	for 1	MOCD APPI	
Signature ML Mo	<u></u>	Date 3/30	109	APPI	ROVED
	THIS SPACE FO	OR FEDERAL OR STATE OF	FICE USE	1.70	0 2252
				CILI	· ()()() (

Title

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willbully to make

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

Case 14055 De Novo


Date

JAMES A. AMOS SUPERVISOR-EPS Operator: C & D Management Company Surface Lease: LC064023


Horz Linked Lse No(s): N.A. Unit or CA No: N.A. Well: Saunders #12 API: 3001522348

@ Srfce: T17S-R27E, Sec 13, 330FSL & 2286FEL

@ M TD: N.A.

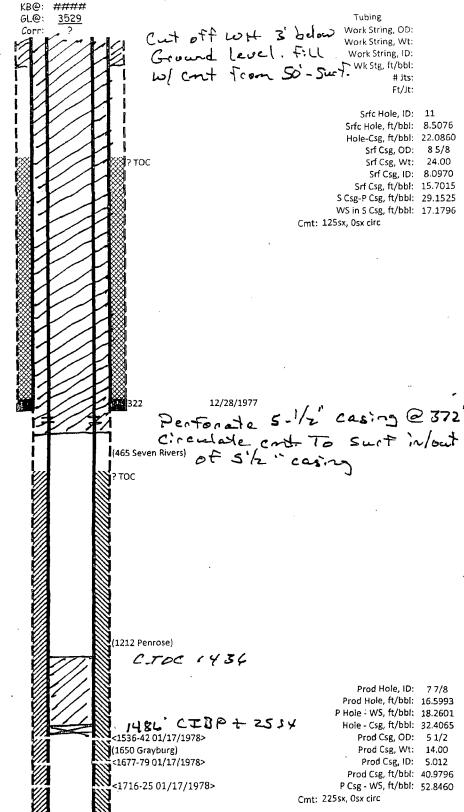

1/3/1977

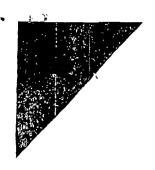

3UREAU OF LAND MANAGEMENT Carlsbad Field Office 320 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.