Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

REC'D NMOCD 10/21/2020

FORM APPROVED

Operator Copy


OMB NO. 1004-0137 Expires: January 31, 2018


SUNDRY NOTICES AND REPORTS ON WELLS

5. Lease Serial No. NMNM0533177A

Do not use thi					
abandoned wel	6. If Indian, Allottee	6. If Indian, Allottee or Tribe Name			
SUBMIT IN 1	7. If Unit or CA/Ago	reement, Name and/or No.			
Type of Well		8. Well Name and No. TODD 24A FED 1			
Name of Operator DEVON ENERGY PRODUCT	9. API Well No. 30-015-28649	9. API Well No. 30-015-28649-00-S1			
3a. Address 333 WEST SHERIDAN AVENUE OKLAHOMA CITY, OK 73102		3b. Phone No. (include area code Ph: 405-552-5014			
4. Location of Well (Footage, Sec., T	1)	11. County or Parish, State			
Sec 24 T23S R31E NENE 660		EDDY COUNTY, NM			
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICATE NATURE O	OF NOTICE, REPORT, OR OT	THER DATA	
TYPE OF SUBMISSION		ТҮРЕ О	F ACTION		
Notice of Intent	☐ Acidize	□ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off	
_	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity	
☐ Subsequent Report	☐ Casing Repair	■ New Construction	□ Recomplete	☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	Plug and Abandon	□ Temporarily Abandon	Temporarily Abandon	
	Convert to Injection	☐ Plug Back	■ Water Disposal	☐ Water Disposal	
following completion of the involved testing has been completed. Final Al determined that the site is ready for final Algorithms of the first state of the first stat	d operations. If the operation rebandonment Notices must be filtinal inspection. s and tubing string from rec 10# salt gel. Spot 25 specially. WOC & tag. (DV to 2550). WOC & tag. (T. 14 28 0	esults in a multiple completion or recled only after all requirements, inclusives a second of the se	A. Required subsequent reports must tompletion in a new interval, a Form 3 ding reclamation, have been completed. Secretary In perfs @ 7084') A. D. Salt @ DOE @ 890'; Solid- SEE ATTACHED FOR CONDITIONS OF AF	160-4 must be filed once d and the operator has	
	Electronic Submission # For DEVON ENERG itted to AFMSS for process	522634 verified by the BLM Work of PRODUCTION COM LP, ser sing by DEBORAH MCKINNEY	t to the Carlsbad on 07/22/2020 (20DLM0582SE)		
Name (Printed/Typed) ARMON F	Title PROD	UCTION ENGINEER			
Signature (Electronic S	Submission)	Date 07/21/2	Date 07/21/2020		
ed for record – NMOCD gc 10/27/2	THIS SPACE FO	OR FEDERAL OR STATE	OFFICE USE		
Approved By Conditions of approval, if any, are attache	d. Approval of this notice does	Title Signature or some variant or	ET	7. 22-20 Date	
certify that the applicant holds legal or equ which would entitle the applicant to condu		e subject lease Office	2		

Accept

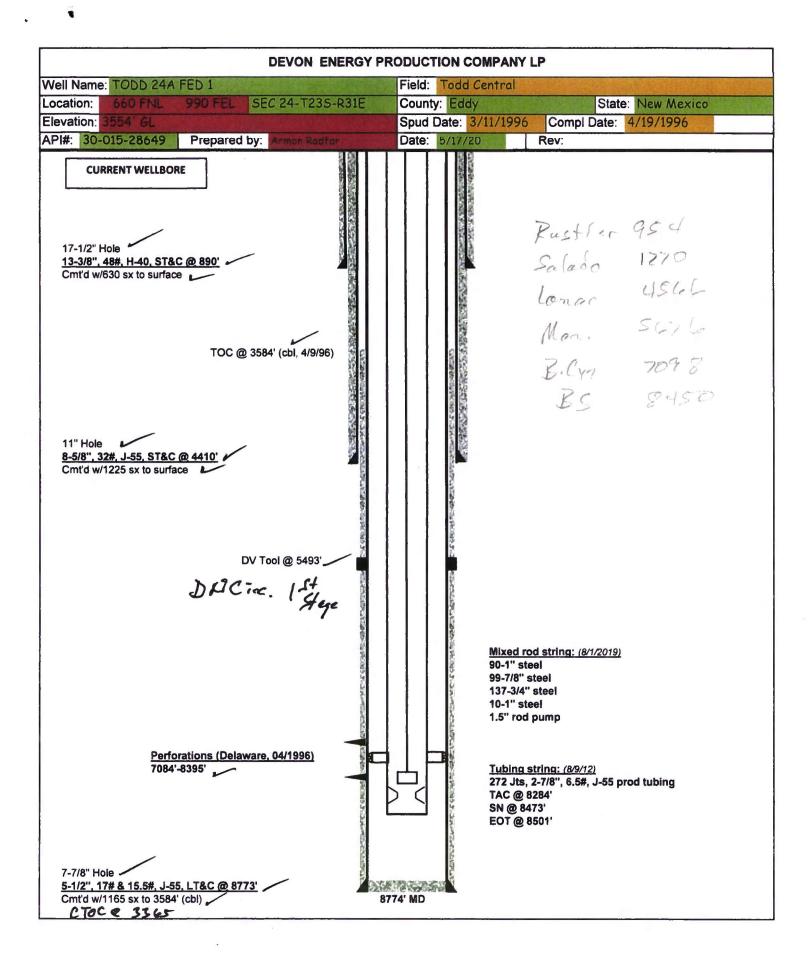

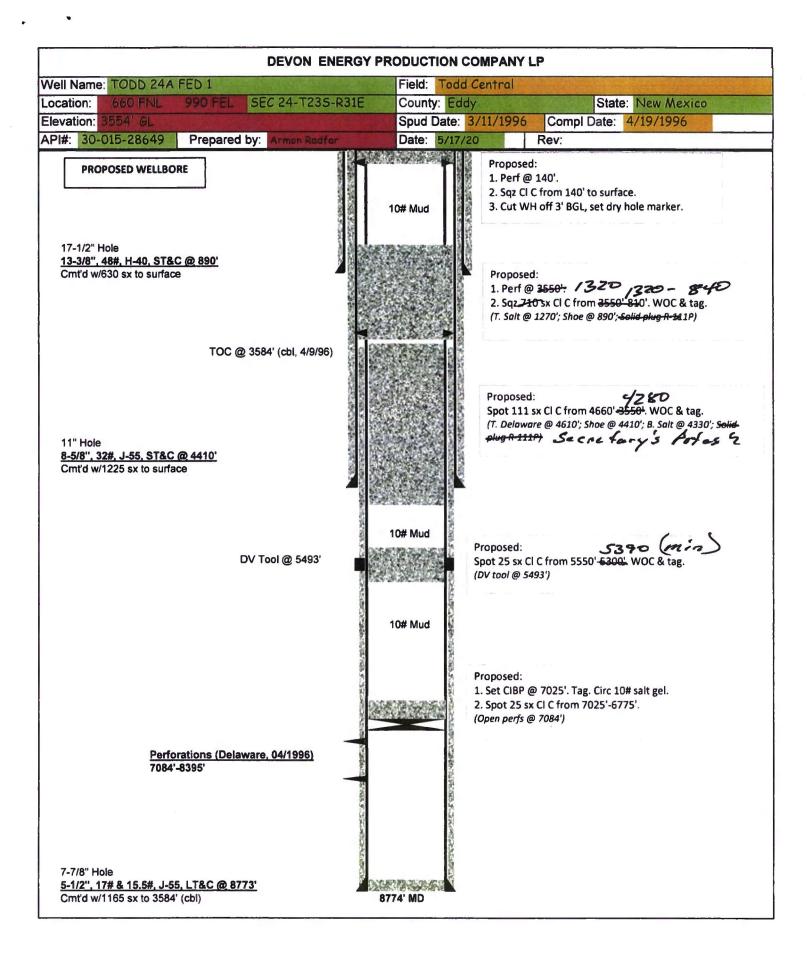

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted