Form 3160-5 (August 2007) OCD Artesia

**UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT


FORM APPROVED
OMB NO. 1004-0135
Expires: July 31, 2010

5. Lease Serial No. NMNM13237

## SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

If Indian Allottee or Tribe Name

abandoned well. Use form 3160-3 (APD) for such proposals.					o. If fidial, Anottee of Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on reverse side.					7. If Unit or CA/Agreer	nent, Name and/or No.
1. Type of Well  Gas Well Other					8. Well Name and No. RUGER 31 MP FED 1H	
2: Name of Operator Contact: JACKIE LATHAN  MEWBOURNE OIL COMPANY E-Mail: jlathan@mewbourne.com					9. API Well No. 30-015-40242-00-X1	
3a. Address	(include area code)		10. Field and Pool, or E	xploratory		
Ph: 575-393-5905 HOBBS, NM 88241 Fx: 575-397-6252					WINCHESTER	
4. Location of Well (Footage, Sec., T	<u> </u>	· · · · · · · · · · · · · · · · · · ·	11. County or Parish, a	nd State		
Sec 31 T19S R29E Lot 4 715FSL 50FWL					EDDY COUNTY,	NM
12. CHECK APPI	ROPRIATE BOX(ES) TO I	NDICATE	NATURE OF N	IOTICE, RI	EPORT, OR OTHER	DATA
TYPE OF SUBMISSION		TYPE OF ACTION				
□ Notice of Intent	☐ Acidize	☐ Deep	en	Product	ion (Start/Resume)	☐ Water Shut-Off
_	☐ Alter Casing	☐ Frac	ture Treat	☐ Reclama	ation	■ Well Integrity
Subsequent Report	□ Casing Repair	□ New	Construction	☐ Recomp	lete	☑ Other
☐ Final Abandonment Notice	□ Change Plans	Plug	and Abandon	□ Tempor	arily Abandon	Drilling Operations
	☐ Convert to Injection	Plug	Back	☐ Water D	Disposal	
following completion of the involved testing has been completed. Final Al determined that the site is ready for f 03/04/13 TD 17 1/2" hole @ 1 Thixad Class H w/addivites. If (35:65:4) w/additives. Mixed w/1.34 yd. Plug down @ 5:30 3000# & Annular to 1500#. A Drilled out with 8 3/4" bit.	pandonment Notices shall be filed inal inspection.)  176' Ran 1176' of 13 3/8" 3' Mixed @ 14.6 #/g w/1.51 yd @ 12.5 #/g w/2.12 yd. Tail of A.M. 03/09/13. Circulated t 6:15 A.M. 03/10/13, tested	only after all r 6# J55 LT& . Followed v w/200 sks 0 125 sks cm I csg to 150	equirements, includi C csg. Cemente w/800 sks BJ Lite	ng reclamation d with 180 s e Class C xed @ 14.8 red BOPErte s, held OK.	n, have been completed, a	nd the operator has
Accepted for record  NMOCD RObble 4/3/15  IN TO 2 2013  NMOCD ARTES:A						
Cor	Electronic Submission #20 For MEWBOURN nmitted to AFMSS for proces	2203 verifie IE OIL COM	d by the BLM Wel PANY, sent to the RT SIMMONS on C	l Information e Carlsbad 93/25/2013 (1	3KMS5671SE)	
Name (Printed/Typed) JACKIE L	ATHAN		Title AUTHO	RIZED REF	PRESENTATIVE	
Signature (Electronic	Submission)		Date 03/21/20	013		
	THIS SPACE FOR	RFEDERA	L OR STATE	OFFICE U	SE	
Approved By ACCEPTED			JAMES A A TitleSUPERVIS			Date 03/30/2013
Conditions of approval, if any, are attached tertify that the applicant holds legal or equivalent to condition would entitle the applicant to conditions.	uitable title to those rights in the si		Office Carlsbac	i		

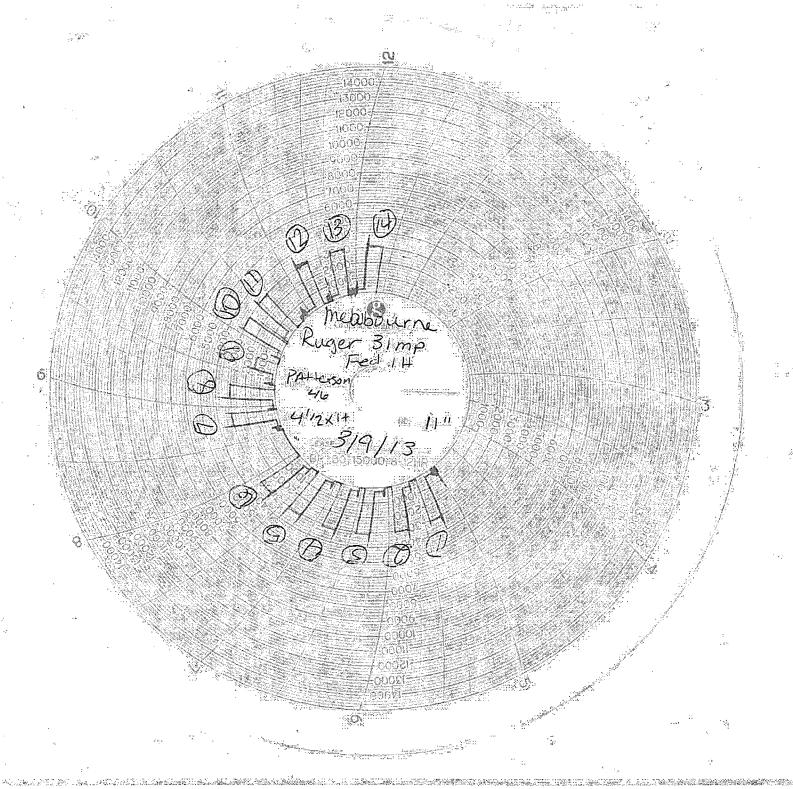



PO Box 7 Loyington, NM 88260 (575) 224-2345 (575) 942-9472

Company Meubourne Date 3/9/	13
Lease Ruger 31mp Fed/14 County Edic	TO THE STATE OF TH
Drilling Contractor PAHCSON Plug & Drill Pipe	U .
Diming Contractor 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	C SIZE the part of the control of th

## Accumulator Function Test - OO&GO#2

To Check - USABLE FLUID IN THE NITROGEN BOTTLES (III A.2.c.i. or ii or iii)

- Make sure all rams and annular are open and if applicable HCR is closed.
- Ensure accumulator is pumped up to working pressure! (Shut off all pumps)
  - 1. Open HCR Valve. (If applicable)
  - 2. Close annular.
  - 3. Close all pipe rams.
  - 4. Open one set of the pipe rams to simulate closing the blind ram.
  - 5. For 3 ram stacks, open the annular to achieve the 50+ % safety factor. (5M and greater systems).
  - 6. Record remaining pressure 1400 psi. Test Fails if pressure is lower than required.
    - **a.** {**950** psi for a 1500 psi system} **b.** {**1200** psi for a 2000 & 3000 psi system}
  - 7. If annular is closed, open it at this time and close HCR.

## To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.)

- Start with manifold pressure at, or above, maximum acceptable pre-charge pressure:

  a. [800 psi for a 1500 psi system] b. [1100 psi for 2000 and 3000 psi system]
  - 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure)
  - 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to.
  - 3. Record pressure drop 1050 psi. Test fails if pressure drops below minimum.
- Minimum: a. {700 psi for a 1500 psi system} b. {900 psi for a 2000 & 3000 psi system}

## To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)

- Isolate the accumulator bottles or spherical from the pumps & manifold.
- Open the bleed off valve to the tank, {manifold psi should go to 0 psi} close bleed valve.
  - 1. Open the HCR valve, (if applicable)
  - 2. Close annular
  - 3. With pumps only, time how long it takes to regain the required manifold pressure.
  - 4. Record elapsed time 1:06. Test fails if it takes over 2 minutes.
- **a.** {950 psi for a 4500 psi system} **b.** {1200 psi for a 2000 & 3000 psi system}