

•	ر در از ا						
Submit 1 Copy To Appropriate District	State of New Mexico	Form C-103					
Office <u>District 1</u> (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013					
1625 Nº French Dr., Hobbs, NM 88240		WELL API NO.					
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-015-32527					
<u>District III</u> – (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease STATE X FEE					
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	6. State Oil & Gas Lease No.					
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM		V-1673					
87505							
SUNDRY NOT	7. Lease Name or Unit Agreement Name Lost Tank AIS State						
DIFFERENT RESERVOIR. USE "APPL	8. Well Number						
PROPOSALS.)	8. well Number 7						
1. Type of Well: Oil Well	9. OGRID Number						
2. Name of Operator Yates Petroleum Corporation	025575						
3. Address of Operator	10. Pool name or Wildcat						
105 South Fourth Street, Artesia,	NM 88210	Lost Tank; Delaware					
4. Well Location	·						
Unit Letter F :	2310 feet from the North line and	2310 feet from the West line					
Section 36	Township 21S Range 31E	NMPM Eddy County					
	3578'GR						
12. Check	Appropriate Box to Indicate Nature of Notic	ce. Report or Other Data					
NOTICE OF I		JBSEQUENT REPORT OF:					
TEMPORARILY ABANDON							
		ENTJOB L					
CLOSED-LOOP SYSTEM		Ύ Π					
	pleted operations. (Clearly state all pertinent details,	and give pertinent dates, including estimated date					
	work). SEE RULE 19.15.7.14 NMAC. For Multiple						
proposed completion or re	ecompletion.						
	4 1 · 1 1 · 1 · 1 · 1 · · · · · · · · ·	Approved for plugging of well bore only. Liability under bond is retained pending receipt					
Yates Petroleum Corporation plans	s to plug and abandon this well as follows:	of C-103 (Subsequent Report of Well Plugging)					
1. MIRU all safety equipment as n	which may be found at OCD Web Page under						
	to surface for future anti-collision purposes.	Forms, www.cmnrd.state.nm.us/ocd.					
3. Set a 5-1/2" CIBP at 6784' and dump 35' Class "H" cement on top.							
	gin spotting 3671' (375 sx) Class "C" cement plug fro						
	uous cement plug across top of Delaware, intermediate	e casing shoe, DV tool and the salt section. WOC					
and tag.							
5. Spot a 15 sx, 60' surface plug.	and weld dry hole marker as per regulations.						
o. Remove un sarrace equipment e	and word dry note marker as per regulations.						
Wellbore schematics attached	L M-1-2011-	NM OIL CONSERVATION					
well Bore	must be physical by 7-1-2016	ARTESIA DISTRICT					
Spud Date:	Rig Release Date:	JUN 2 9 2015					
		RECEIVED					
I hereby certify that the informatio	n above is true and complete to the best of my knowle	edge and belief.					
SIGNATURE (TITLE Regulatory Reporting	g Supervisor DATE June 24, 2015					
		<u>Souperviser</u> 51115 <u>- June 51, 2015</u>					
Type or print name Tina He	uerta E-mail address: <u>tinah@yatespetrol</u>	leum.com PHONE: <u>575-748-4168</u>					
For State Use Only	•						
ADDRAWER DY ATIL	10 North Some	(11) D. 100 2-1-15					
APPROVED BY:	22 TITLE DIST OF DEPCHUR	لل DATE 7-1-15					
Conditions of Approval (if any):	Ser Attached COA's						
×	Jep HTTAChed CUITS						

•

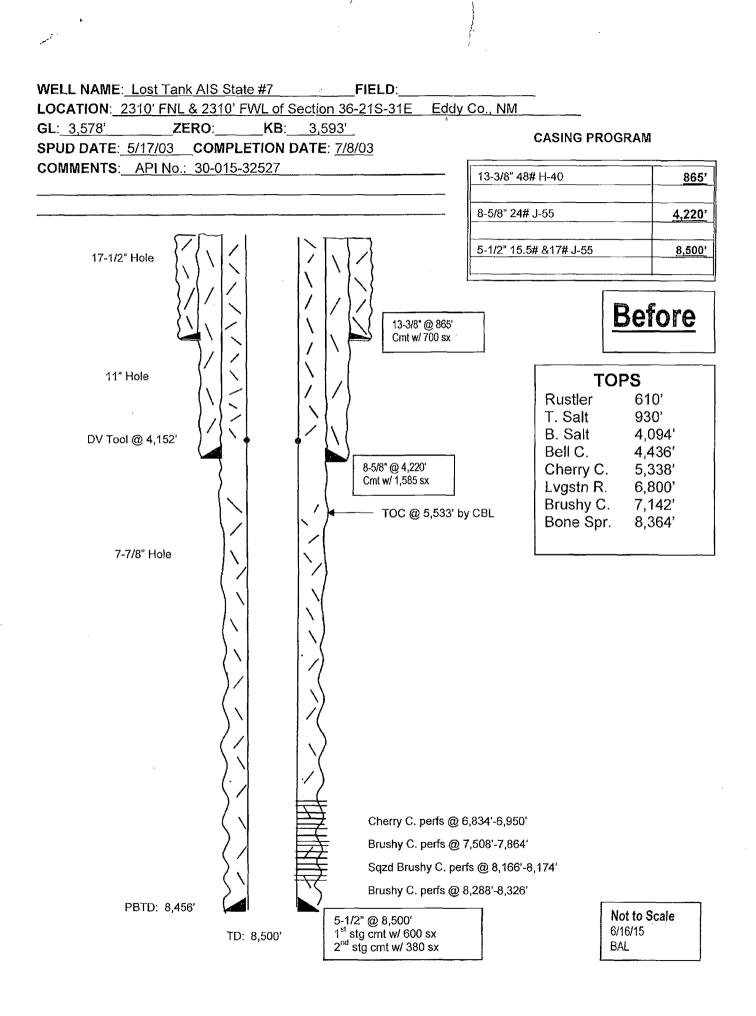

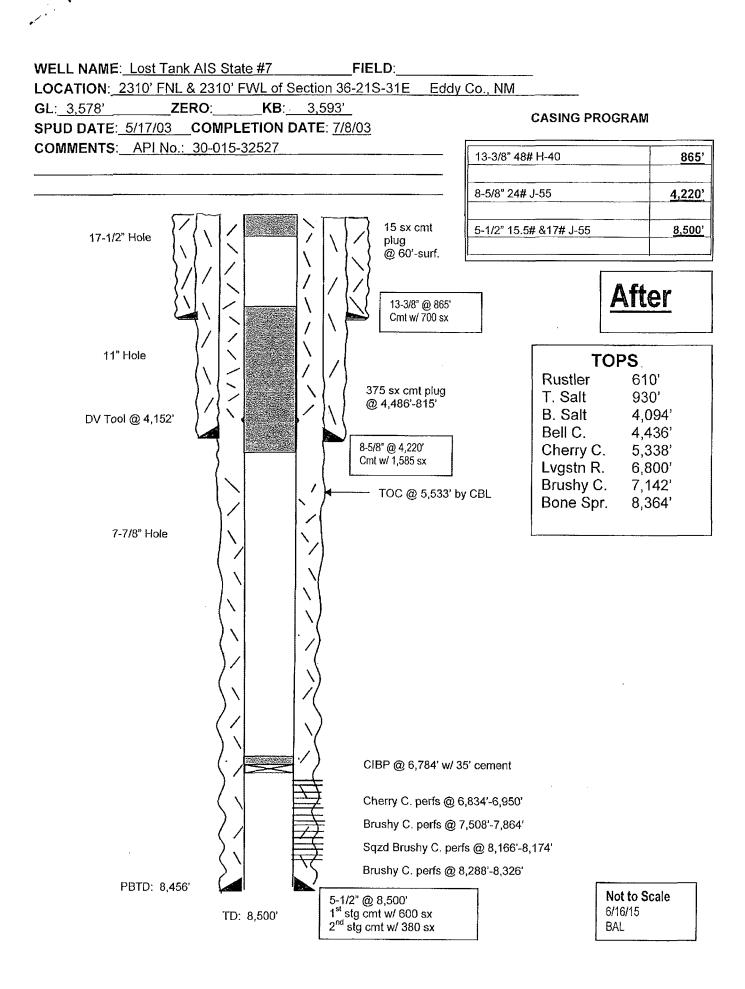

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator:	yates Act.	······································	-904-BC - 228-2	100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100 - 100	14 Y 18 19 1
	& Number: <u>657</u>				
API #:	30-015	- 32527	1		

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.

11. Minimum WOC time for tag plugs will be 4 Hrs.

and the second se

7-1-15

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50 below and 50 above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000; is to be allowed between cement plugs in open hole and no more than 3000; in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section.
 Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).