

Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM88139 6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well					8. Well Name and No. WOOD DRAW 35 FEDERAL 3	
2. Name of Operator Contact: DAVID STEWART OXY USA INCORPORATED E-Mail: david_stewart@oxy.com					9. API Well No. 30-015-35568-00-S1	
3a. Address 5 GREENWAY PLAZA SUITE HOUSTON, TX 77046-0521	36. Phone No. Ph: 432.68	RTESIA DISTI		10. Field and Pool or Exploratory Area CORRAL CANYON		
4. Location of Well (Footage, Sec., 7 Sec 2 T25S R29E NENW 250	DEC 11 ZUIO			11. County or Parish, State EDDY COUNTY, NM		
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	RECEIVE		REPORT, OR OTH	ER DATA
TYPE OF SUBMISSION TYPE OF ACTION						
Notice of Intent Subsequent Report	Alter Casing		 Deepen Hydraulic Fracturing New Construction 		tion (Start/Resume) ation plete	 Water Shut-Off Well Integrity Other
Final Abandonment Notice	 Change Plans Convert to Injection 	🔀 Plug 🗖 Plug	and Abandon Back	Temporarily Abandon Water Disposal		
totowing completion of the involved testing has been completed. Final Alder determined that the site is ready for f TD-7000'M 5291'V PBTD-6 9-5/8" 36# csg @ 805' w/ 440 5-1/2" 17# csg @ 6255' DVT 1. RiH & set CiBP @ 5397' w 2. M&P 25sx cmt @ 3890-374 4. M&P 35sx cmt @ 3220-293 5. M&P 110sx cmt @ 480-233 5. M&P 110sx cmt @ 4865' to 10# MLF between plugs - Abb	203'M 5313'V Perfs-57 sx, 12-1/4" hole, TOC-Su @ 3839' w/ 2300sx, 8-3/4 / 25sx cmt to 5247' 40' WOC-Tag #0' WOC-Tag 30' WOC-Tag	710-6150' rf-Circ " hole, TOC-S - z 970	iurf-Circ (T/Del -1.sa/4, SI	(🗶 B (८०८) EE ATT	NM	OCD 49 12-11-18
14. I bereby certify that the foregoing in Control Control Name (Printed/Typed) DAVID S	d by the BLM Well Information System TED, sent to the Carisbad SCILLA PEREZ on 09/13/2018 (18PP2663SE) Title REGULATORY ADVISOR					
Signature (Electronic	Date 09/13/2018					
	THIS SPACE F				JSE	
Approved By James & Romas			Title Suger AET 9-22-18 Date			
Conditions of approval, if any, are attach certify that the approxant holds legal or co which would entitle the applicant to cond	Office Cartabad Field Office					
This 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent						
States any false, fictitious or fraudulent (Instructions on page 2) BLM REV Mehler Alcente	vised ** BLM REVISE ed from A	D ↔ BLM RI L: BLM	evised # Bla n . Re Ce	n revise we d	D ** BLM REVISE	erator 1211-18

•

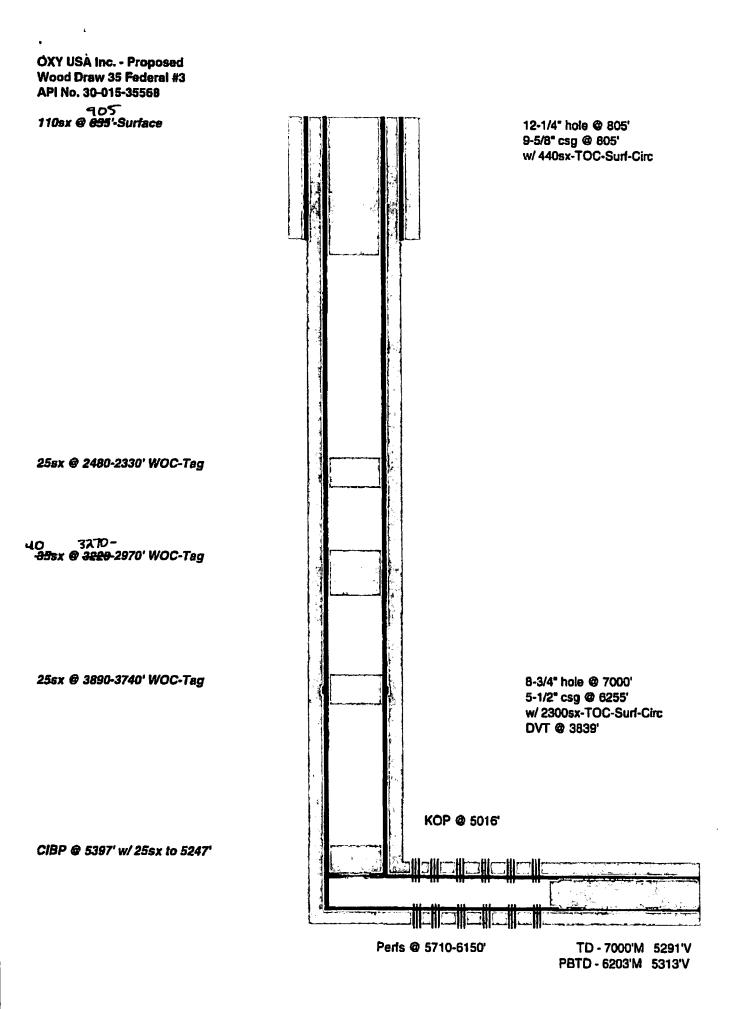

ÓXY USÀ Inc. - Current Wood Draw 35 Federal #3 API No. 30-015-35568

٢

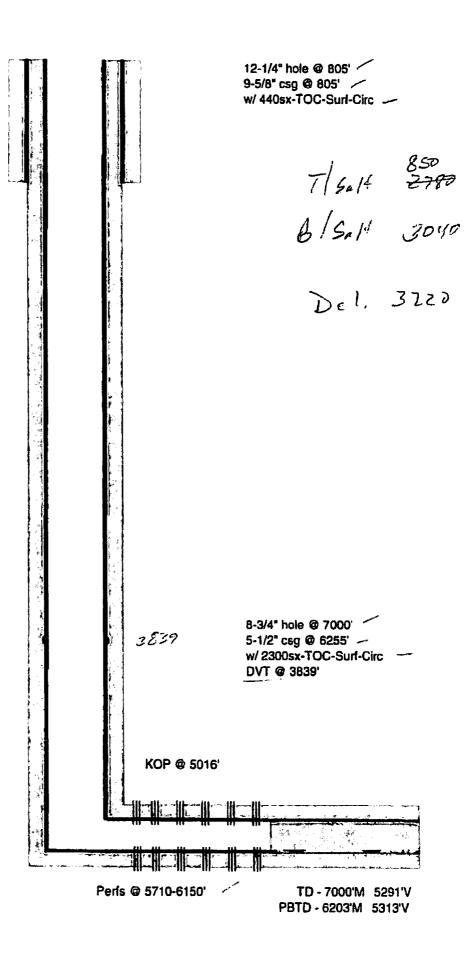

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.