Form 3160-5 (June 2015)

### UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB NO. 1004-0137

11. County or Parish, State

EDDY COUNTY, NM

BUREAU OF LAND MANAGEMENT		II JI Artocid	Expires. January 31, 2018		
BUREAU OF LAND MANAGEMENT		אונפאוע מסי	5. Lease Serial No.		
SUNDRY NOTICES AND REPO Do not use this form for proposals to		NMNM41645			
abandoned well. Use form 3160-3 (API	6. If Indian, Allottee or Tribe Name				
SUBMIT IN TRIPLICATE - Other inst	7. If Unit or CA/Agreement, Name and/or No. SCR330				
1. Type of Well			8. Well Name and No.		
☐ Oil Well   Gas Well   Other			FEDERAL 13 COM 6		
2. Name of Operator Contact: DAVID A EYLER		9. API Well No.			
CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@	MILAGRO-RES.COM		30-015-36571-00-C1		
3a. Address	3b. Phone No. (include area co	ode)	10. Field and Pool or Exploratory Area		
600 N MARIENFELD STE 600 MIDLAND, TX 79701	Ph: 432-687-3033	ŧ.	UNKNOWN		

#### 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

			, , , , , , , , , , , , , , , , , , ,			
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	□ Water Shut-Off		
☐ Subsequent Report	<ul><li>☐ Alter Casing</li><li>☐ Casing Repair</li></ul>	<ul><li>☐ Hydraulic Fracturing</li><li>☐ New Construction</li></ul>	☐ Reclamation ☐ Recomplete	<ul><li>□ Well Integrity</li><li>□ Other</li></ul>		
☐ Final Abandonment Notice	☐ Change Plans ☐ Convert to Injection	☑ Plug and Abandon ☐ Plug Back	☐ Temporarily Abandon ☐ Water Disposal			

- 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 13 T25S R26E SENW 1310FNL 1980FWL

32.133610 N Lat, 104.248568 W Lon

- 1) SET 5-1/2" CIBP @ 10,100'; DUMP BAIL 4 SXS.CMT. @ 10,100'.
  2) SET 5-1/2" CIBP @ 9,150'; PUMP 25 SXS.CMT.@ 9,150'-8,960'(T/WCMP.); CIRC. WELL.
  3) PUMP 90 SXS.CMT. @ 6,059'-5,341'(5-1/2"DV TOOL, T/BNSG.); WOC X TAG CMT. PLUG.
  4) PUMP 25 SXS.CMT. @ 4,140'-4,000'(SPACER PLUG).
  5) PUMP 25 SXS.CMT. @ 1,966'-1,820'(T/DLWR, 9-5/8"CSG.SHOE); WOC X TAG CMT. PLUG.
  6) MIX X CIRC. 140 SXS.CMT. @ 1,121'-3'.
  7) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD ON STEEL PLATE TO CSGS. X INSTALL DRY HOLE MARKER.
  DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM W/ A STEEL TANK AND HAUL CONTENTS TO THE REQUIRED DISPOSAL PER OCD BUIL E 19 17 15


THE REQUIRED DISPOSAL, PER OCD RULE 19.17.15.

# SEE ATTACHED FOR CONDITIONS OF APPROVAL

				RE	CENED			
• •	ne foregoing is true and correct.  Electronic Submission #468619 verifie For CIMAREX ENERGY COMPA Committed to AFMSS for processing by PRI	NY OF C SCILLA	CO, sent to the Carlsbad PEREZ on 06/11/2019 (19PP2391	ise) JUN	<b>2.5</b> 2019			
Name (Printed/Typed)	DAVID A EYLER	Title	AGENT	DISTRICTI	ARTESIAO.C.D.			
Signature	(Electronic Submission)	Date	06/11/2019					
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved By	smer a. One	Title	SPET		6-16-19 Date			
certify that the applicant hol	ny, are attached. Approval of this notice does not warrant or ds legal or equitable title to those rights in the subject lease licant to conduct operations thereon.	Office	140					
Title 19 TC Coction 1001 and Title 42 U.S.C. Coction 1212 make it a grippe for any person browning by and will fully to make to any department or account of the United								

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Cimarex Energy Co. of Colorado CIMARE) KB: 18' above GL Federal 13 Com #6 1310' FNL & 1980' FWL Sec. 13, T-25-S. R-26-E, Eddy Co., NM H. Hubbard /D Pearcy 30-015-36571 17/2" hole 13-3/8", 48# H-40 csg @ 466' 🗸 cmtd w/ 400 sx, cmt circ . Salt 1071 TOC surf per CBL. SG/DP. 121/4" hole 9-5/8", 40# J-55 csg @ 1870' cmtd w/ 650 sx, cmt circ Del 1916 279 jts 2-3/8" 4.7# L-80 Tbg 5391 DV Tool @ 6009' Circ both Stages cmtd wi 760 sx T-2 On-off tool w/ 1.875" X Profile nipple @ 9113" Arrowset 1-X pkr @ 9120' 1.875" XN Profile nipple @ 9125" WC 9029 (CZ) 2-3/8" WLEG @ 9126" Wolfcamp perfs (9228' - 9788') C:so 10/01 (C1)
Cisco Canyon perfs (10131' - 10345') DHC PBTD @ 10429' 7 1/8" hold 5-1/2" 17# P-110 @ 10564' cmtd w/ 500 sx. cmt circ razz 8

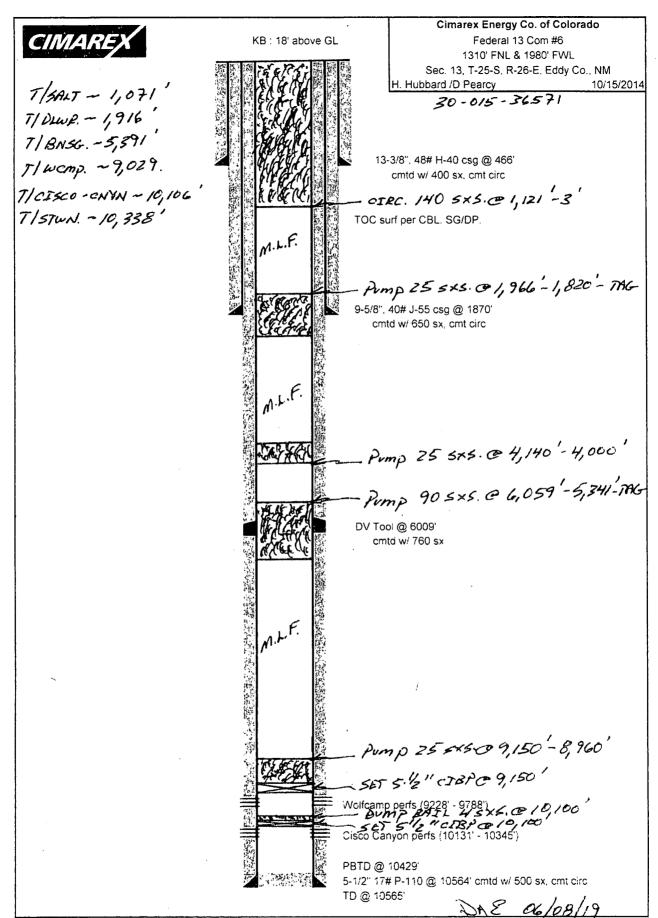

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

  The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.