

Submit 3 Copies To Appropriate District
 Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Ave., Artesia, NM 88210
 District III
 1909 Rio Arriba Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM
 87505

State of New Mexico
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-041-10043
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Thompson, J. Cleo		6. State Oil & Gas Lease No. LC-060978
3. Address of Operator P. O. Box 12577, Odessa, TX 79768-2577 (432) 550-8887		7. Lease Name or Unit Agreement Name MSU
4. Well Location Unit Letter G : 1980 feet from the North line and 1980 feet from the East line Section 7 Township 8S Range 35E NMPM County Roosevelt		8. Well No. 133
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Milnesand (San Andres)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data. NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER ☐		SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER ☐
--	--	--

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions, Attach wellbore diagram of proposed completion or recompilation.

Proposed Plug and Abandon

Plug #1 Set CICB set @ 4550 w/ 2 sx of cement

Plug #2 Pump 20 sx cement plug @ 4127 to 4027 (Tag)

Plug #3 Perf and Squeeze 80 sx cement plug @ 2750 to 2650 (Tag)

Plug #4 Set packer @ 2150. Perf and Squeeze 80 sx cement plug @ 2150 to 2250 (Tag)

Plug #5 Set packer @ 347. Perf and Squeeze w/ 150 sx cement @ 447. Circulate cement on Backside. (Tag) plug @ 327.

Plug #5 Pump 10 sx plug @ surface. Install dry hole marker.

**THE OIL CONSERVATION DIVISION MUST
 BE NOTIFIED 24 HOURS PRIOR TO THE
 BEGINNING OF PLUGGING OPERATIONS.**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Roger D. Brooks TITLE Agent DATE 9/11/06

Type or print name Roger Brooks Telephone No. 505-631-0573
 (This space for State use)

APPROVED BY Chris Williams OIL DISTRICT SUPERVISOR/GENERAL MANAGER DATE 9/11/06

Conditions of approval, if any:

SEP 11 2006

J. Cleo Thompson James Cleo Thompson Jr., L.P.

Proposed P&A - Milnesand Unit #133


Milnesand (San Andres)

1980' FNL. & 1980' PFL, Sec 7, Township 8S, Range 35E, Roosevelt County, NM

Spud 03/12/1964

API # 30-041-10043

Drilling Floor Elevation: 4259'

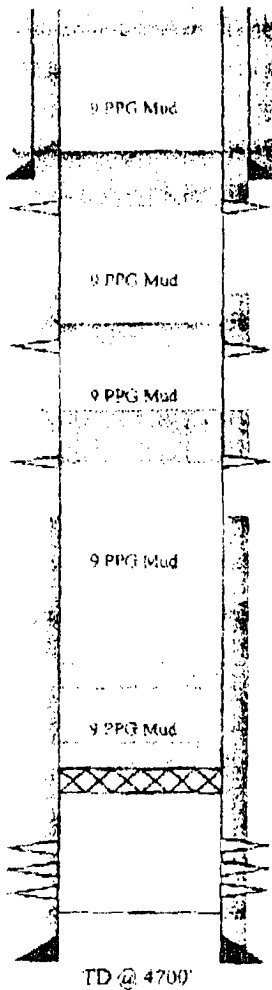

Plug #5: 10 sxs @ surface

Surface String

8-5/8", 24#, J-55 set @ 427'

Cement w/ 130 sxs, TOC @ surface (Circ.)

Plug #5: Set pkr @ 327'. Perf & pump 150 sxs @ 477'. Circ. emt on the backside (Tag)
Perforate @ 477'

Plug #4: Set pkr @ 2159'. Perf & squeeze 80 sxs emt plug from 2250' to 2150' (Tag)
Perforate @ 2250'

Plug #3: Perf & squeeze 80 sxs emt plug @ 2750' to 2650' (Tag)
Perforate @ 2750'

Production String

4-1/2", 9.5#, J-55, set @ 4688'

7 7/8" bit to 4700'

Cement w/ 150 sxs neat emt

TOC: +/- 3730' (Temperature Survey)

Plug #2: Pump 20 sxs plug @ 4127' to 4027' (Tag)

Plug #1: Set CIBP @ 4550' w/ 2 sacks of cement on top

San Andres

Peris: 4597' - 4665'

"BTD @ 4672'

DKD

H:\data\001\data\excel\wellborediagram\Milnesand unit #133_P&A

9/5/2006

580-8554

Ben C. Montgomery

Sep 08 06 06:30a