

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87400

District IV

1220 S. St. Francis Dr., Santa Fe, NM


87505

State of New Mexico

Energy, Minerals and Natural Resources

Form C-103

Revised June 10, 2003

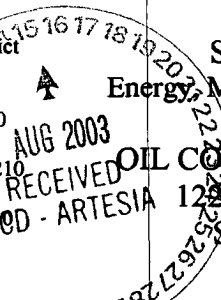

WELL API NO.

30.015.21535

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Empire Abo Unit "E"

8. Well Number

371

9. OGRID Number

000778

10. Pool name or Wildcat

Empire Abo

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

BP America Production Company

3. Address of Operator

P.O. Box 1089, Eunice, NM 88231

4. Well Location

Unit Letter D : 1195 feet from the N line and 10 feet from the W line

Section 35

Township 17S

Range 28E

NMPM

Eddy

County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

11' KB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD: 6390' PBD: 6135' PERFS: 5882-6018'

07.02.03: MIRUPU. NDWH. NUBOP. POH w/tbg.

07.03.03: RIH w/bit & scraper. Tag plug @ 6137'.

07.07.03: RUWL. RIH & dump 25' cmt on top of CIBP. Perf 5882-6018'. RDWL. RIH w/pkr, SN, testing tbg in hole.

07.08.03: Swab well

07.09.03: RU acid trucks & spot 3-1/2 bbls acid @ 6028'. Flush w/14 bbls KCL. PUH 8 jts & set pkr @ 5777'. Pmp 54 bbls 15% HCL acid running 140 ball sealers. Flush w/23 bbls 2% KCL. RD acid trucks. Unset pkr & POH w/tbg, SN, & pkr. RIH, tag @ 6110' & co ball sealers. POH.

07.10.03: RIH w/prod assy. NDBOP. Set TAC. NUWH. Waiting on flowline & pumping unit.

08.14.03: Will return well to production 08.15.03.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Sr. Admin. Asst. DATE 08.14.03

Type or print name Kellie D. Murrish E-mail address: murrikd@bp.com Telephone No. 505.394.1649

(This space for State use)

APPROVED BY FOR RECORDS ONLY DATE AUG 18 2003

Conditions of approval, if any: