

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

Oil Cons.  
N.M. DIV-Dist. 2  
1301 W. Grand Avenue  
Artesia, NM 88210

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Pogo Producing Company

3. Address and Telephone No.

P. O. Box 10340, Midland, TX 79702-7340 432-685-8100

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FNL & 2112' FWL, Section 24, T23S, R31E

5. Lease Designation and Serial No.

NM-40655

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Amax 24 Federal #5

9. API Well No.


30-015-27657

10. Field and Pool, or Exploratory Area

Ingle Wells Delaware

11. County or Parish, State

Eddy County, NM

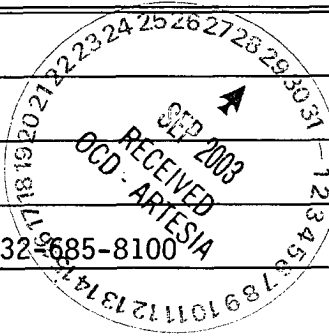

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice


TYPE OF ACTION

- ☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☒ Other Add Perfs  
☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

09/03/03 POOH w/ rods, pump & tbq.  
09/04/03 CO sd to RBP @ 6930. Reset RBP @ 6736. Test to 3000# ok.  
09/05/03 Perf Delaware 6612-24 & 6666-70 w/ 1 spf. Acdz w/ 1000 gals 7-1/2% acid. Swab.  
09/09/03 Rel RBP @ 6736 & reset @ 4611. Test to 3000# ok.  
09/10/03 Perf Delaware 4524-36 w/ 2 spf. Acdz w/ 1000 gals 7-1/2% acid. Swab.  
09/15/03 Set pkr @ 4131.  
09/17/03 Sqz Delaware perfs 4524-36 w/ 100 sks "C" Neat.  
09/18/03 Rel pkr @ 4131 & POH. DO cmt 4278-4536. Test sqz perfs to 1000#.  
09/19/03 RIH & rel RBP @ 4611.  
09/20/03 RIH w/ production equipment & turn well on.

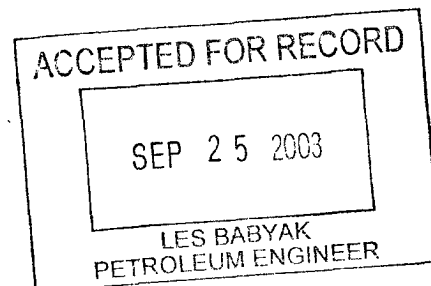

14. I hereby certify that the foregoing is true and correct

Signed

*Les Babyak*

Title

Sr. Operation Tech

Date

09/24/03

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date