

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised May 08, 2003


SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30.015.22766
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator BP America Production Company		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 1089 Eunice NM 88231		7. Lease Name or Unit Agreement Name: EMPIRE ABO UNIT 'E'
4. Well Location Unit Letter C : 660 feet from the 1 line and 1400 feet from the W line Section 35 Township 17S Range 28E NMPM County EDDY		8. Well No. 384
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3681' GR		9. OGRID Number 000778
10. Pool name or Wildcat EMPIRE ABO		

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD: 6300' PED: 6194' CIBP W/CMT PERFS: 5820-5934' (NEW) 6222-6236' (OLD)

10.06.04: MIRUPU. NDWH. NUBOP. RIH W/BIT, SCRAPER, & TEG. TAG BOTTOM @ 6196'
10.08.04: LOAD & TEST TO 500# PSI FOR 15 MINS. HELD GOOD. FL AT SURFACE. SWAB IN TO 3800'. 10.11.04: SWAB FL TO 5500'. POH.
10.12.04: RUWL. RUN TDT LOGS. DUMP 35' CMT ON CIBP @ 6196'. PREP TO PERF.
10.13.04: RIH W/PERF GUN & PERF 5820-22', 5842-46', 5862-66', 5892-5900', 5904-06', 5918-22', 5934-44'. 75 HOLES, 2 JSPF.
10.14.04: BLED OFF PRESS. RU & FMP 2500 GALS 15% HCL W/ADDITIVES DROPPING 115 1.1 BALLSEALERS. SWAB BACK WELL STARTED FLOWING. TURN PROD INTO BATTERY.
10.20.04: TIH W/PROD TEG. NDBOP. NUWH.
11.15.04: RIH W/PROD ASSY. 2-3/8" TEG SET @ 5975' SN @ 5985'. IN 24 HRS PRODUCED 83 BO 78 MCF, 111 BW. RTP.

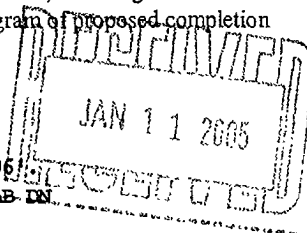

2019:01
Xc:annales
Km.111

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kellie D. Murrish TITLE Scheduler DATE 12.06.04

Type or print name Kellie D. Murrish

Telephone No. 505.394.1649

(This space for State use)

DEC 08 2004

APPROVED BY FOR RECORDS ONLY TITLE DATE

Conditions of approval, if any: