
Submit 3 Copies To Appropriate District Office District I	State of New Mexico Energy, Minerals and Natural Resources	Form C-103 May 27, 2004
1625 N. French Dr., Hobbs, NM 88240 District II		WELL API NO. 30-005-63070
1301 W. Grand Ave., Artesia, NM 88210 District III	OIL CONSERVATION DIVISION	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr. Santa Fe, NM 87505	STATE FEE
<u>District IV</u> 1220 S. St. Francis Dr., Santa Fe, NM 87505	Salita Fe, INIVI 87303	6: State Oil & Gas Lease No. V-2982
(DO NOT USE THIS FORM FOR PROPOSAL	CES AND REPORTS ON WELLS S TO DRILL OR TO DEEPEN OR PLUG BACK TO A ION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name
	s Well Other	Quincy AMQ State  8. Well Number
		#13
2. Name of Operator	SEP 26 2008	9. OGRID Number
Hanson Operating Company, Inc.  3. Address of Operator	OCD-ARTESIA	009974 10. Pool name or Wildcat
P. O. Box 1515, Roswell, NM 8820		Acme San Andres Southeast
Unit Letter N: 990 feet from the South line and 1550 feet from the West line		
Section 12	Township 8 South Range 27 East	NMPM Chaves County
	11. Elevation (Show whether DR, RKB, RT, GR, etc. 3938' GR	
Pit or Below-grade Tank Application 🖾 or Closure 🗌		
Pit type Workover Depth to Groundwater >100' Distance from nearest fresh water well >2 miles Distance from nearest surface water >10 miles  Pit Liner Thickness: 12 mil Below-Grade Tank: Volume bbls; Construction Material		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
NOTICE OF INT		UBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK   TEMPORARILY ABANDON	PLUG AND ABANDON ☐ REMEDIAL WO CHANGE PLANS ☐ COMMENCE D	DRK ☐ ALTERING CASING ☐  DRILLING OPNS.☐ P AND A ☐
PULL OR ALTER CASING	MULTIPLE COMPL  CASING/CEME	<del>_</del>
OTHER:	☐ OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.		
Durages to alug and shands	n wall as fallows:	Motify OCD 24 hrs. prio
Purpose to plug and abando	n well as follows.	To any work done.
1. Set CIBP at 2050' with 35' cement cap.		
2. Circulate hole with 10# brine with 12.5# per barrel salt water gel.		
3. Perforate 4 squeeze holes at 450'.		
<ul> <li>3. Perforate 4 squeeze holes at 450'.</li> <li>4. Pump 100 sacks cement for solid plug from 450' to surface. / 15ide 1 ours ide of CSG.</li> </ul>		
5. Clean and remediate	location.	Approval Granted proyiding work
6. Set Dry Hole Marker.		is complete by 12/30/08
in Asserval for	P/A only	
* HPP	/	
* Approval for P/A only Workover P:7 Rogins Submission of C-144		
I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan.		
SIGNATURE Carol d. Smith TITLE Production Analyst DATE 09/22/2008		
Type or print name Carol J. Snorth For State Use Only	E-mail address: hanson@dfn.co	m Telephone No. 505-622-7330
APPROVED BY:	Me TITLE Fild Reg.	DATE 9/30/08
Conditions of Approval (if any):		•
X		ж.,

## WELLBORE DIAGRAM



## WELLBORE DIAGRAM

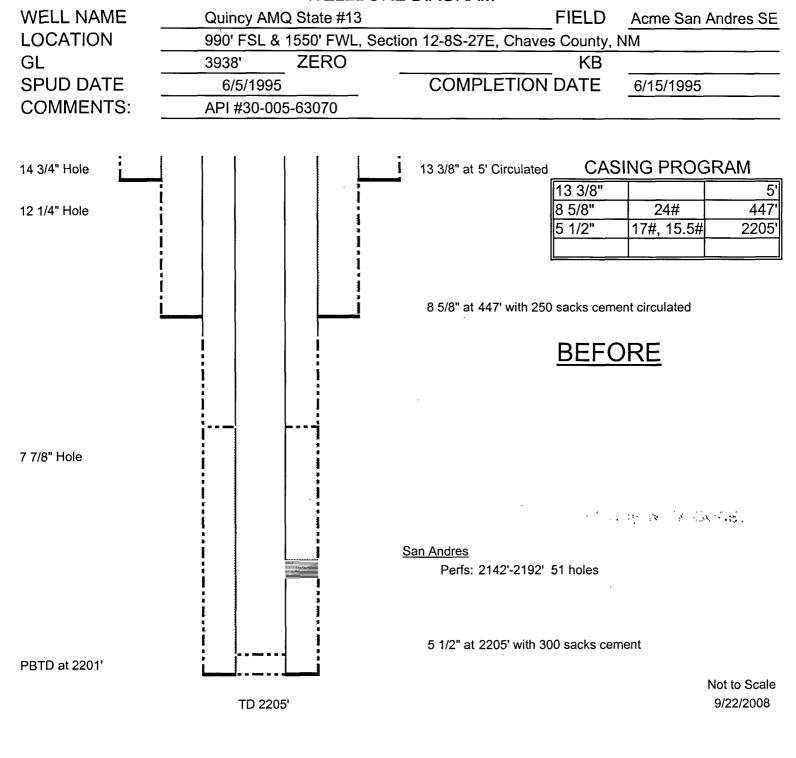