

Form 3160-5  
(April 2004)UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

NOV - 1 2008

FORM APPROVED  
OMB No 1004-0137  
Expires: March 31, 2007

OCD-ARTESIA

## SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

Lease Serial No  
NM54865

6 If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No  
PDU #7039. API Well No.  
30-015-3002710. Field and Pool, or Exploratory Area  
Parkway; Delaware11. County or Parish, State  
Eddy Co., N.M.

## SUBMIT IN TRIPLICATE- Other instructions on reverse side.

1. Type of Well  
☐ Oil Well ☐ Gas Well ☒ Other2. Name of Operator  
St. Mary Land & Exploration Company3a Address  
3300 N. A St., Bldg 7, Ste. 200, Midland, TX 797053b. Phone No. (include area code)  
432-688-1789

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

(I) Sec. 35 - T19S-R29E  
2610' FSL & 430' FEL

## 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Proposed P&A Procedure  
Parkway Delaware Unit #703

\* Submit Subsequent Reports from Previous workover efforts that have us at this point. Red Well No Reports submitted. Back to 3/12/98.

- 1) RIH w/tbg to 1950' (if possible) and spot 25 sx plug. If you cannot get to 1950' notify Mike Bratcher @ OCD of deepest depth reached for approval to cmt from that depth. The OCD would like the stub plug to reach at least 50' above the csg stub. - Tag & Notify OCD. 50' m/out stub
- 2) POH w/tbg. RIH w/CIBP on tbg to 1550'. Set CIBP and test to 500#.
- 3) Pump cmt plug from the CIBP to at least 1400' (52' above DVT tool). Tag if necessary to confirm TOC.
- 4) PUH to 302' and pump cmt sufficient to have a 100' plug. Min. 25 sx or 100'
- 5) PUH and Mix/pump surface plug from 60' to surface.

ACCEPTED FOR RECORD

SEE ATTACHED FOR  
CONDITIONS OF APPROVAL

NOV 3 - 2008

14. I hereby certify that the foregoing is true and correct  
Name (Printed/Typed)

Donna Huddleston

Gerry Guye, Deputy Field Inspector  
NMOCD-District II ARTESIA

Signature

Donna Huddleston

Date

10/27/2008

## THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Office

Date

OCT 28 2008

APPROVED

JAMES A. AMOS  
SUPERVISOR-EPS

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

(Instructions on page 2)

HOLE SIZE 17 1/2

TD 352

CASING SIZE 13 3/8

HOLE SIZE 12 1/4

CASING SIZE 9 5/8

TD 1500

HOLE SIZE 8 3/4

2 stage NO Returns

1st stage, Returns

2nd stage, TOC  
2114


CASING SIZE 7"

TD 3000

HOLE SIZE 6 1/4

CASING SIZE 4 1/2

TD 4400

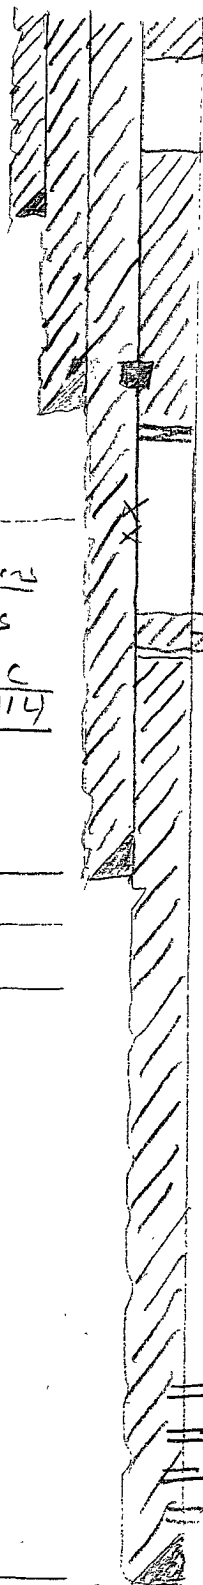

60-Surf.

302 WOC Tag

DVT @ 1452

1550 CTRP

CS Leak 1824-1919

WOC Tag.

4 1/2" stub

50' in/out

SALT SECTIONS TOP 503

BASE 1155

RIMP Sect

CAVE / KARST ✓

SPEC WATER Capitan ✓

TOC

SURF

X

INT

X X

PROD

2114

FORMATIONS Rustler 930

TDS 503

BDS 1155

Vatrs 1320

Del. 3505

DVT 7" @ 1452

PERFORATIONS

4194-4201

4208-4215

4218-4319

**BUREAU OF LAND MANAGEMENT**  
**Carlsbad Field Office**  
**620 East Greene Street**  
**Carlsbad, New Mexico 88220**  
**575-234-5972**

**Permanent Abandonment of Federal Wells**  
**Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

**If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.**

\* 2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612. *Called in 10/27/08.*

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. **Dry Hole Marker:** All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. **Subsequent Plugging Reporting:** Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.

8. **Trash:** All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.