

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

RECEIVED CONSERVATION DIVISION

NOV 24 2003
2040 South Pacheco
Santa Fe, NM 87505

OCD-ARTESIA

WELL API NO. 30-015-30446
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B8318-128
7. Lease Name or Unit Agreement Name: OXY Chopsticks State
8. Well No. 1
9. Pool name or Wildcat Undesignated Wolfcamp

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other	
2. Name of Operator OXY USA WTP Limited Partnership 192463	
3. Address of Operator P.O. Box 50250 Midland, TX 79710-0250	
4. Well Location Unit Letter <u>F</u> : <u>1750</u> feet from the <u>north</u> line and <u>1980</u> feet from the <u>west</u> line Section <u>28</u> Township <u>17S</u> Range <u>27E</u> NMPM County <u>Eddy</u>	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3483'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

TD-9750' PBTD-9140' Perfs-6826-6859' P&A-9230-9244' CIBP-9175'
8-5/8" 32# csg @ 1500' w/ 1030sx, 12-1/4" hole, TOC-Circ
4-1/2" 11.6# csg @ 9750' w/ 975sx, 7-7/8" hole, TOC-4630'-CBL

1. RIH & Set CIBP @ 6780', dump 3sx cmt to 6745' 6242' Plug (25sx)
2. Cut & Pull 4-1/2" csg @ +/- 4600' 5792' Plug (25sx)
3. M&P 35sx cmt @ 4650-4550'-WOC-TAG
4. M&P 45sx cmt @ 3200-3100' 3000' Plug
5. M&P 45sx cmt @ 2300-2200'
6. M&P 45sx cmt @ 1550-1450'-WOC-TAG
7. M&P 40sx cmt @ 500-400'
8. M&P 20sx cmt surface plug 0-60 surface plug - WOC 24 hrs - TAG/Top Off cmt
10# MLF between plugs

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David Stewart TITLE Sr. Regulatory Analyst DATE 11/24/03

Type or print name David Stewart

Telephone No. 432-685-5717

(This space for State use)


APPROVED BY Mike Beale TITLE Compliance Officer DATE 11/26/03

Conditions of approval, if any: Additional plugs as indicated

Operator Oxy USA WTP LP
 Well Oxy Chopsticks St. #1
 Unit F Section 28 Township 17s Range 27E
 API # 30-015-30446

TOPS

Yates _____
 T. Salt _____
 B. Salt _____
 Glorieta 3000'
 Bone Sp. _____
 Abo 5192'
 Wolfcamp 6242'
 Morrow 9206'
 Devonian _____
 Fusselman _____
 Other _____

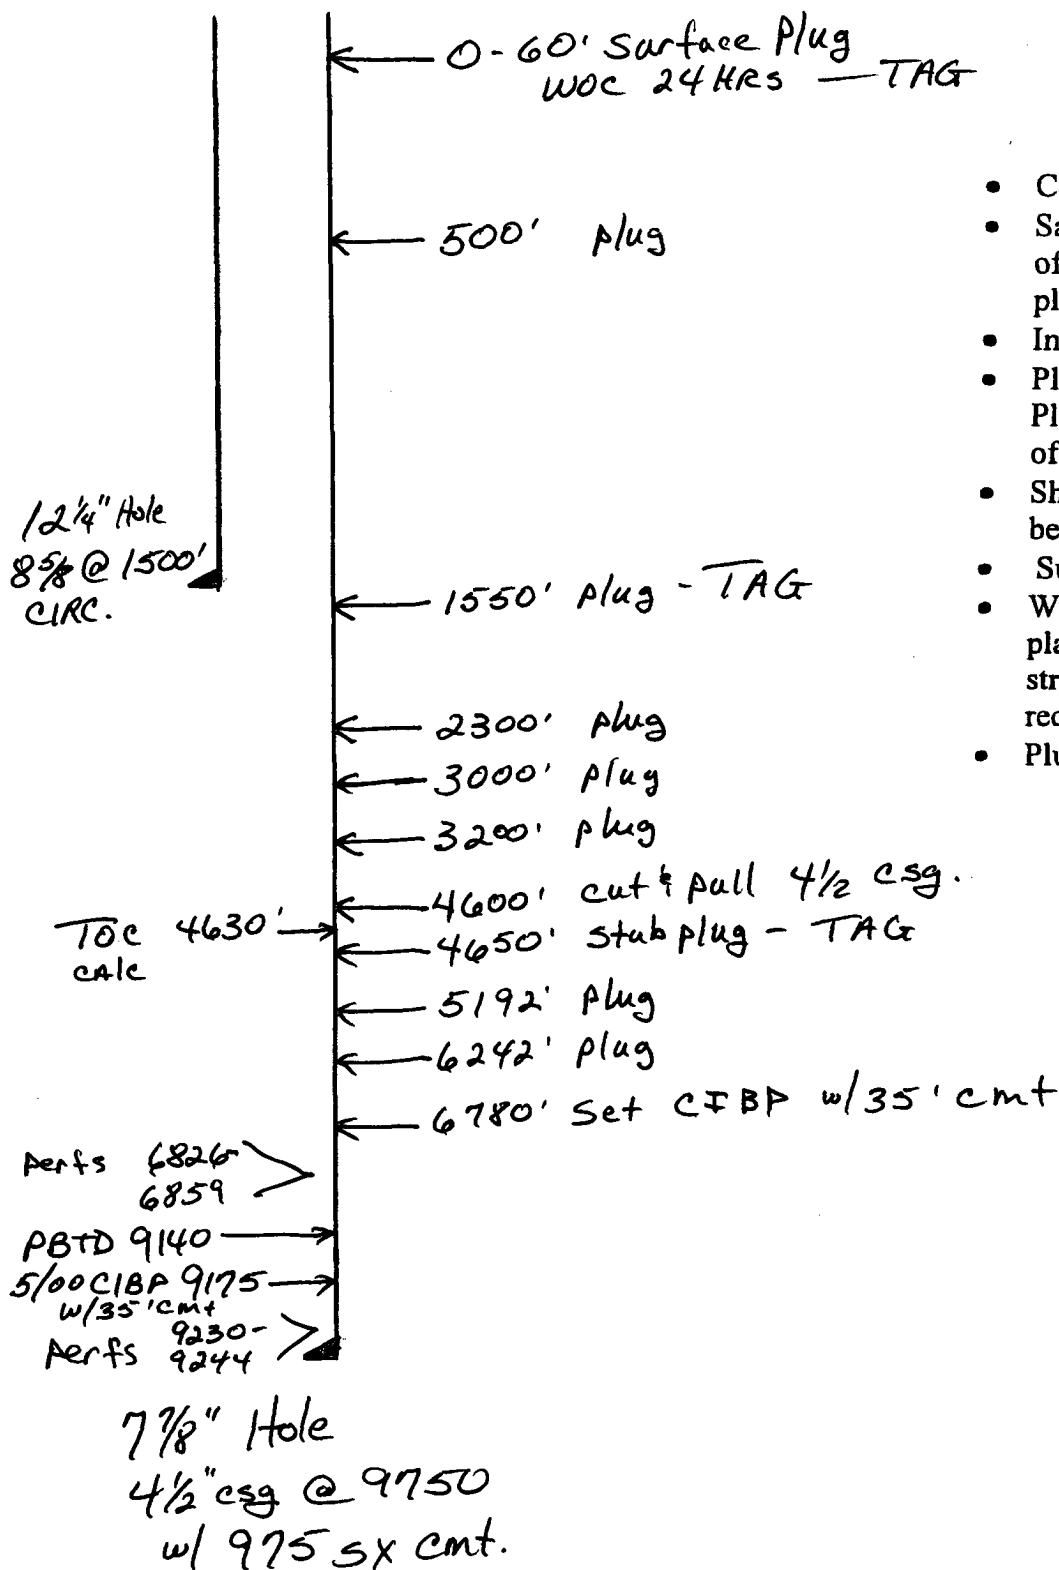

- Contact OCD 24 hrs. prior to any work don
- Salt gel mud consisting of 10# brine with 2 of gel per barrel must be placed between ea plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sack of cement, whichever is greater.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0'- 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.

OXY USA WTP LP - Proposed
OXY Chopsticks State #1
API No. 30-015-30446

20sx Surface 0-60' Surface Plug - WOC 24 Hrs - TAG/Top Off cmt

40sx @ 500-400'

12-1/4" hole @ 1500'
8-5/8" csg @ 1500'
w/1030sx-TOC-Surf-Circ

45sx @ 1550-1450' — TAG

45sx @ 2300-2200'

3000' plug →

45sx @ 3200-3100'

35sx @ 4650-4550' — TAG
Cut & Pull 4-1/2" csg @ +/- 4600'

5190' plug →

6240' plug →

CIBP @ 6780', dump 3sx cmt

Wolfcamp Perfs @ 6826-6859'

PBTD-9140'

5/00-CIBP @ 9175' w/ 35' cmt


7-7/8" hole @ 9750'
4-1/2" csg @ 9750'
w/975sx-TOC-4630'-CBL

Morrow Perfs @ 9230-9244'

TD-9750'

OXY USA WTP LP - Current
OXY Chopsticks State #1
API No. 30-015-30446

12-1/4" hole @ 1500'
8-5/8" csg @ 1500'
w/1030sx-TOC-Surf-Circ

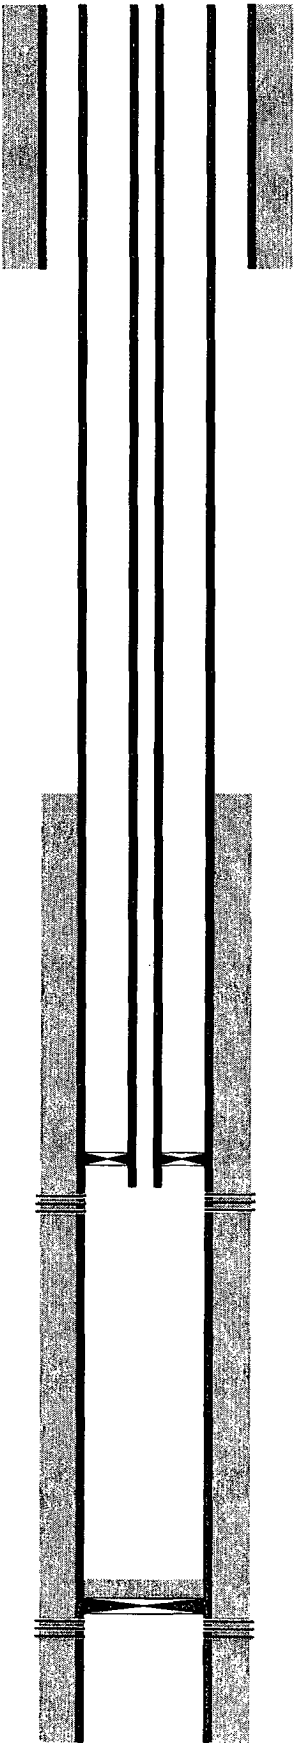

Wolfcamp Perfs @ 6826-6859'

7-7/8" hole @ 9750'
4-1/2" csg @ 9750'
w/975sx-TOC-4630'-CBL

Morrow Perfs @ 9230-9244'

5/00-CIBP @ 9175' w/ 35' cmt
PBTD-9140'

TD-9750'