

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Ho-hs, NM 88240  
District II  
811 South First, Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
2040 South Pacheco  
Santa Fe, NM 87505

Form C-103  
Revised March 25, 1999

WELL API NO.  
30005-60468

5. Indicate Type of Lease  
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:  
Twin Lakes San Andres Unit

7. Well No.  
66

8. Pool name or Wildcat  
Twin Lakes; San Andres (Assoc)

10. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3966.6 GR

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
Oil Well ☐ Gas Well ☐ Other ☒ Injection

2. Name of Operator  
Concho Oil & Gas Corp.

3. Address of Operator  
110 W. Louisiana Ste 410; Midland, Tx 79701

4. Well Location

Unit Letter G : 1650 Feet from the North line and 2310 feet from the East line

Section 1 Township 9S Range 28E NMPM Chaves County

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Concho Oil & Gas Corp. respectfully request approval to plug and abandon the above well according to the following procedure:

1. Notify NMOCD- Artesia. 24 HRS prior
2. Pump 35 sx @ 2000'. WOC & tag. 100' plug 2525-2625 - Tag
3. Circ hole with mud.
4. Perf csg @ 1900' & squeeze w/ 40 sx.
5. Perf csg @ 1500' & squeeze w/ 40 sx.
6. Perf csg @ 850' & squeeze w/ 40 sx.
7. Perf csg @ 200'. Squeeze & circ cmt to surface.
8. Cut off wellhead & install dry hole marker.

RECEIVED  
OCD - ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terri Stathem TITLE Production Analyst DATE 1-9-02

Type or print name Terri Stathem

Telephone No. 915/683-7443

(This space for State use)

APPROVED BY [Signature] TITLE [Signature] DATE JAN 22 2002

Conditions of approval, if any:


# TLSAU #66

Formerly - O'Brien E #1

Lease No.: 24988 Dist. No. : County: Chaves Field: Twin Lakes San Andres  
 Section: 1 Twsp: 9S Range: 28E Unit Ltr: G Location: 1650' FNL & 2310' FEL

API No. 30-005-60468

Spud Date: 02/08/78  
 TD Date: 05/08/78  
 Comp Date: 05/23/78

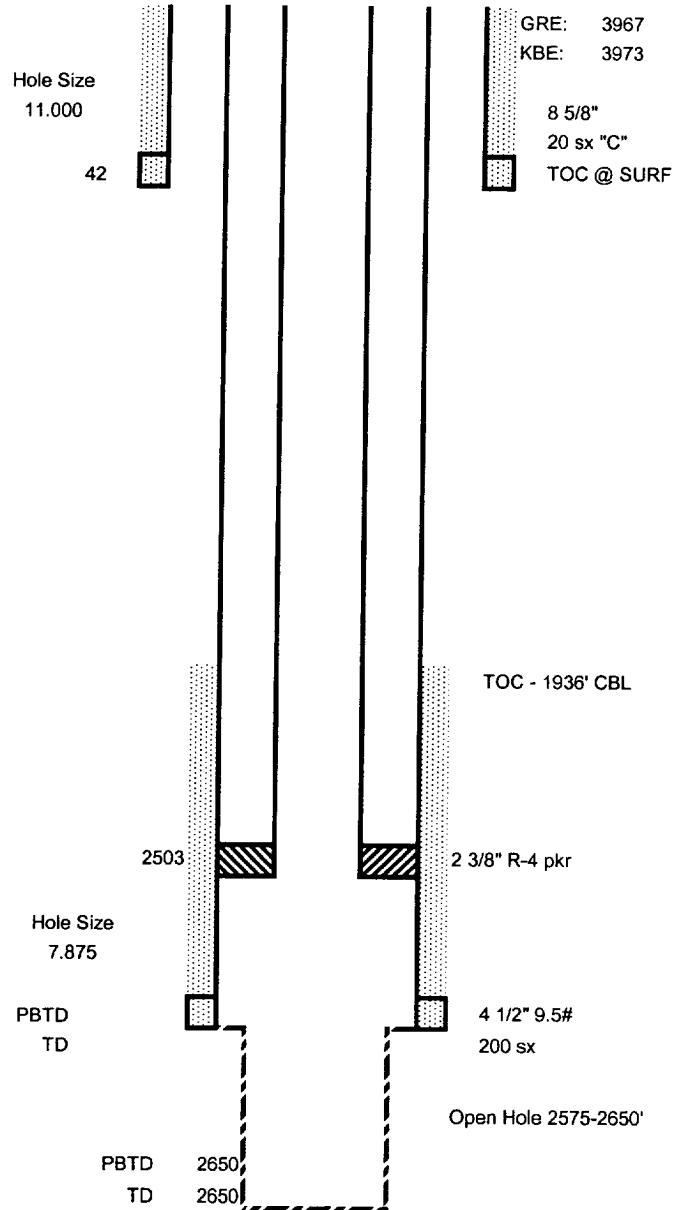

Original Perf Details: Open Hole 2575-2615'  
 5000 gals 20% acid in 3 stages

Apr-88 Drilled out open hole to 2650'  
 No treatment

May-01 Has very small casing leak