
			C	131			
	State of New Mexico Energy, Minerals and Natural Resources			of	Form C-1 Revised March 25, 19		
District I 1625 N. French Dr., Hobbs, NM 88240			WELL API				
District II 811 South First, Artesia, NM 88210 OIL CONSERVA	ATION I	DIVISION	30005-6056 5. Indicate		Lease		
District III 2040 Sout	2040 South Pacheco			STATE FEE			
1000 Rio Brazos Rd., Aztec, NM 87410 District IV 2040 South Pacheco, Santa Fe, NM 87505	Santa Fe, NM 87505			il & Gas	s Lease No.		
SUNDRY NOTICES AND REPORTS ON	WELLS		7. Lease N	ame or U	Unit Agreement Nan	ne:	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPE DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM	N OR PLUC C-101) FOR	G BACK TO A R SUCH	Twin Lake	s San Ar	ndres Unit		
PROPOSALS.) 1. Type of Well:	—)					
Oil Well Gas Well Other In	njection)	7. Well N	lo.			
2. Name of Operator Concho Oil & Gas Corp.					11		
3. Address of Operator 110 W. Louisiana Ste 410; Midland, Tx 79701				ame or W s; San Aı	Wildcat ndres (Assoc)		
4. Well Location							
Unit Letter O: 330 Feet from the South	line and _	1650 feet from th	e <u>East</u>	line			
Section 25 Township 8S	Range	e 28E	NMPM	Chave	es County	ST 1808-248	
10. Elevation (Show wh							
11. Check Appropriate Box to Ind	icate Na	ture of Notice,	Report or (Other D	ont of		
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON	\times	SUB REMEDIAL WOR			PORT OF: ALTERING CASING	g □	
TEMPORARILY ABANDON		COMMENCE DR	ILLING OPN	3. 🔲	PLUG AND ABANDONMENT		
PULL OR ALTER CASING MULTIPLE COMPLETION		CASING TEST A	ND				
OTHER:		OTHER:					
12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.							
Concho Oil & Gas Corp. respectfully request approval to plus	g and abar	ndon the above we	ll according	to the fol	llowing procedure:		
 Notify the NMOCD Artesia District 24 hours prior t Set 150' cmt plug @ 2525-2675'. WOC & tag. 	,o comme	accinent.		1 3 vã			
3. Circ hole w/ mud.					•		
4.25 Set 12" cmt plug @ 120-2000'. 5. Perf csg @ 1550' & set 100' cmt plug @ 1500-160	0'.		İ	R			
6 Perf csg @ 810' & set 100' cmt plug @ 760-860'.					ugo e O:		
7. Perf csg @ 121'. Circ cmt from 171' to surface. 8. Cut off wellhead & install P&A marker.				KECK	RIESIN .		
				OCD '			
I hereby certify that the information above is true and comple	ete to the	best of my knowle	dge and belie	я.			
SIGNATURE THE	_TITLE_	Production And	alystI	DATE	1-11-02	-	
Type or print name Terri Stathern		Telephone No. 91	5/683-7443		JAN 1		
(This space for State use)		1:01		D	1	70.12	
APPPROVED BY	_TITLE	- July	170		DATE		

TLSAU #11

Formerly - O'Brien Fee #25

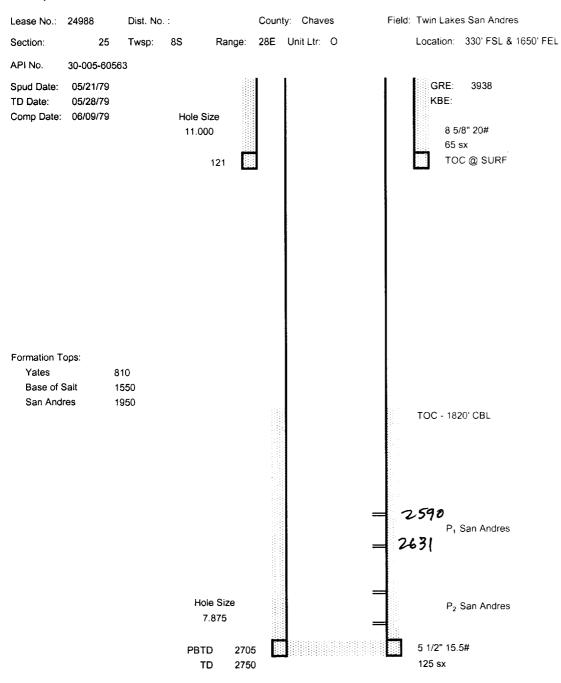

Original Perf Details: P1: 2592, 93, 95, 96, 97, 2600, 01, 08, 09, 12, 13, 14, 15, 16, 17, 18, 20, 21, 26, 27, 28, 29, 30

6000 gals 20% acid

Apr-88 Add P1: 2590, 91, 98, 99, 2606, 07, 10, 11, 19, 22, 23, 24, 25, 31

Place on injection