

Suom t 3 Copies To Appropriate District Office District I 1625 N. French Dr., Hobbs, NM 88240 District II 811 South First, Artesia, NM 88210 District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV 2040 South Pacheco, Santa Fe, NM 87505 SUNDRY NOTICES AND REPORTS ON WELLS	WELL API NO. 30005-60648 5. Indicate Type of Lease STATE FEE 6. State Oil & Gas Lease No. 7. Lease Name or Unit Agreement Name:	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well:	Twin Lakes San Andres Unit	
Oil Well Gas Well Other Injection		
2. Name of Operator	7. Well No.	
Concho Oil & Gas Corp.	8. Pool name or Wildcat	
3. Address of Operator 110 W. Louisiana Ste 410; Midland, Tx 79701	Twin Lakes; San Andres (Assoc)	
4. Well Location	, , , , , , , , , , , , , , , , , , , ,	
Unit Letter K: 1650 Feet from the South line and 2310) feet from the West line	
Section 25 Township 8S Range 28E	NMPM Chaves County	
Section 25 Township 8S Range 28E 10. Elevation (Show whether DR, RKB, RT,	The second secon	
3920.3 GR		
11. Check Appropriate Box to Indicate Nature of Notice OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON REMEDIAL	SUBSEQUENT REPORT OF:	
TEMPORARILY ABANDON	CE DRILLING OPNS. PLUG AND	
PULL OR ALTER CASING		
OTHER:		
12 Describe proposed or completed operations. (Clearly state all pertinent detail	ls, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions or recompilation. Concho Oil & Gas Corp. respectfully requests approval to plug an the following procedure: 1. Notify NMOCD Artesia 24 hrs prior to commencement of procedure: 2. Set 150° cmt plug from 2546-2666°. WOC. Tag. 3. Circ hole w/ mud. 4. Cut csg @ 1935' & POOH. 5. Set 100° cmt plug @ 1885-1985°. WOC. Tag. 6. Set 100° cmt plug @ 1475-1575°. / 400 to / \$00°. 7. Set 100° cmt plug @ 810-910°. 8. Circ cmt from 170° to surface. 9. Cut off wellhead & install dry hole marker.	d abandon the TLSAU #2 well according to	
1		
I hereby certify that the information above is true and complete to the best of my	knowledge and belief.	
SIGNATURE TITLE <u>Production Analyst</u> DATE 9-28-01		
Type or print name Terri Stather (1) Telephone I	No. 915/681-7443	
(This space for State use) APPPROVED BY TITLE	DATE 10-10-01	

TLSAU #2

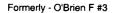

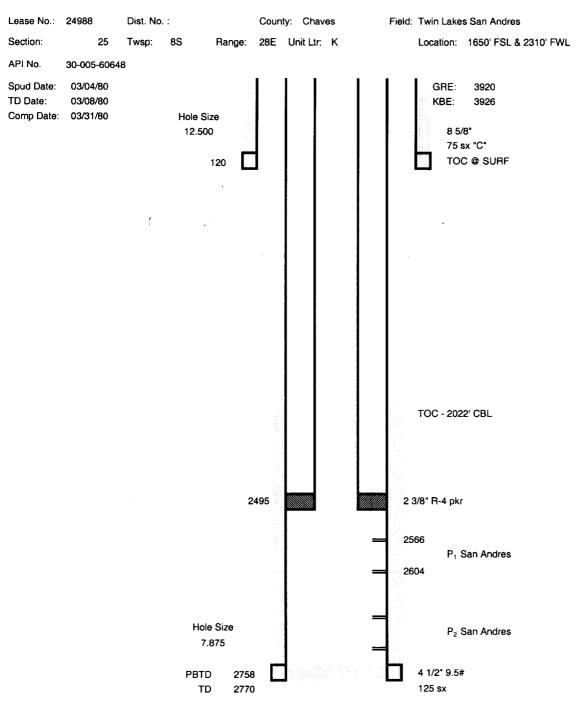

Original Perf Details: P1: 2566, 66.5, 68.5, 69, 69.5, 70, 71.5, 72, 78, 78.5, 79, 79.5, 81, 81.5, 82.5, 83, 94, 94.5, 96, 96.5, 97, 97.5

6000 gals 28% acid

Jan-88 Add P1: 2585, 86, 87, 89, 90, 92, 93, 2601, 02, 03, 04

No treatment

Well	Concho U.1. 1123 Twin Lakes SA Uni 7 A Section 35 Township 8 Range 38 30 -005-100648	
		 Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug Install Dry Hole Marker
		Notify OCD 24 hrs. prior to any work done
851 120'	L 170' Plug 170' to surface	
-	- 100' Plug 810'+0 910'	
	~ 100' Plug 810'to 910' ~ 100' Plug 1400'to 1500'	; ;
1935'— 2022'-	cut: Pull osg -100' Plug 1885' to	1985' T41
2564 2604 4/12 2770'	Perfs 200' Plug 2466 to 2666	749