


|                        |   |
|------------------------|---|
| NO. OF COPIES RECEIVED |   |
| DISTRIBUTION           |   |
| SANTA FE               | 1 |
| FILE                   | 1 |
| U.S.G.S.               |   |
| LAND OFFICE            |   |
| OPERATOR               | 1 |

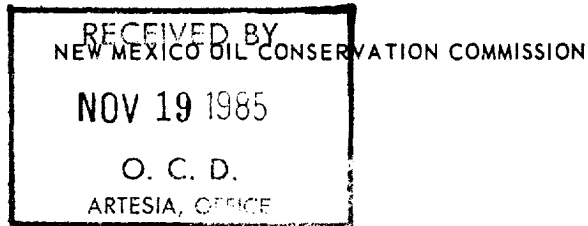

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

|  |  |
|--|--|
| 1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>   | 7. Unit Agreement Name   |
| 2. Name of Operator<br>Rault Petroleum Corporation ✓   | 8. Farm or Lease Name<br>R.C. Graves                               |
| 3. Address of Operator<br>200 West First, Suite 510 Petroleum Bldg Roswell, NM 88201   | 9. Well No.<br>1   |
| 4. Location of Well<br>UNIT LETTER <u>K</u> 1980 FEET FROM THE <u>South</u> LINE AND 1980 FEET FROM<br>THE <u>West</u> LINE, SECTION <u>15</u> TOWNSHIP <u>85</u> RANGE <u>28E</u> NMPM. | 10. Field and Pool, or Wildcat<br>Twin Lake-San Andres <i>l.s.</i> |
| 15. Elevation (Show whether DF, RT, GR, etc.)<br>4062' GR  | 12. County<br>Chaves   |

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

|  |  |  |   |
|--|--|--|---|
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input checked="" type="checkbox"/> | REMEDIAL WORK <input type="checkbox"/>               | ALTERING CASING <input type="checkbox"/>      |
| TEMPORARILY ABANDON <input type="checkbox"/>   | CHANGE PLANS <input type="checkbox"/>                | COMMENCE DRILLING OPNS. <input type="checkbox"/>     | PLUG AND ABANDONMENT <input type="checkbox"/> |
| PULL OR ALTER CASING <input type="checkbox"/>  | OTHER <input type="checkbox"/>                       | CASING TEST AND CEMENT JOBS <input type="checkbox"/> | OTHER <input type="checkbox"/>                |

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

13 3/8" @ 348' w/370 sx cement, circulate 20 sx.

8 5/8" @ 2698' w/380 sx cement, caculated top of cement @ 1611'.

Perforated 2606' - 2625' w/22 holes.

1. Spot 30 sx cement from 2630' to 2530' \* + tag - then load hole w/mud

2. Spot 30 cement plug from 1611' to 1511'.

3. Perforate 4 holes @ 400'. Circulate 60 sx cement plug to balance 400' to 300' \* + tag

4. Spot 10 sx plug at surface.

5. Install dry hole marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J.C. Johnson

TITLE Agent

DATE 11-15-85

APPROVED BY M.H. Williams

TITLE

OIL AND GAS INSPECTOR

DATE

NOV 22 1985

CONDITIONS OF APPROVAL, IF ANY: \* As Noted Above