

*C157
JL*

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

2040 Pacheco St
Santa Fe, NM 87505

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-005-62160-62160
Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
State Oil & Gas Lease No.
Lease Name or Unit Agreement Name Lynx
Well No. 1
Pool name or Wildcat Udes. Fussleman

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

Type of Well:
OIL WELL GAS WELL OTHER

Name of Operator
N. Dale Nichols

Address of Operator
P.O. Box 1972, Midland, Texas 79702

Well Location
Unit Letter **G** : **1815** Feet From The **North** Line and **1980** Feet From The **East** Line
Section **19** Township **8S** Range **29E** NMPM **Chaves** County

Elevation (Show whether DF, RKB, RT, GR, etc.)
3949 gr


11 Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ANBANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Existing Conditions
TD 7491'. 13 3/8" casing @ 412' w/470 sx, circ 70 sx. 8 5/8" casing @ 2125' w/ 300 sx. 5 1/2" casing cemented @ 7448' with 2 stage tool @ 5277' 1st stage cemented with 450 sx, 2nd stage cemented with 1200 sx, circ 30 sx. Fish in hole consisting of Packer and 13 jts.
tubing. Top of fish 6402'. Perforations in 5 1/2" casing 6852' to 6864' and 6872' to 6894'.
7 100' plug 6700' to 6800' TAG

- 1) ~~Install bottom cement plug and push to fish @ 6402' with 2 2/8" tubing w/ 3" perforated sub on bottom.~~
- 2) Mix and spot 100' cement (11 sacks) from *6124-6224'* ~~6402' to 6502'~~ *100' plug 5227-5327'*
- 3) Pull 40 jts tubing & WOC 10 hrs. Tag cement plug. *Perf csq @ 3346' - Squeeze 100' cmt outside casing 3246' - 3346' - Place 100' cmt inside pipe 3246 - 3346'*
- 4) Pull tubing to 2640' & spot 200' cement (22 sacks) plug opposite San Andres porosity 2640 to 2640. *Perf csq @ 2175' - Squeeze 50' cmt 3246 - 3346'*
Outside pipe - Place 100' cmt inside 2075 - 2175' - TAG
- 5) Pull tubing & spot 50' cement plug (5 1/2 sacks) from 50' to surface *Perf both csq. strings - squeeze 100' cmt 800' - 900'*
in 8 5/8" and 5 1/2" Annulus leave 100' cmt inside 512 800-900'
- 7) Install permanent Marker *Perf. csq. @ 60' Circ cmt up 8 5/8" & 5 1/2" Annulus 0-60'*
Place 100' cmt inside 5 1/2" 300' - 400' TAG

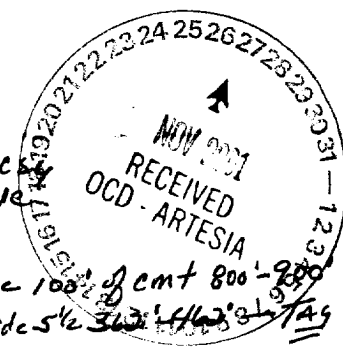

I hereby certify that the information above is true and complete to the best of my knowledge and belief. *Perf. csq. @ 60' Circ cmt up 8 5/8" & 5 1/2" Annulus 0-60'*

SIGNATURE *[Signature]* TITLE Bookkeeper DATE 11-15-2001

TYPE OR PRINT NAME John E. Nichols TELEPHONE NO. (915) 697-1576

(This space for State Use)

APPROVED BY *[Signature]* TITLE *Field Rep ID* DATE 11-28-01

CONDITIONS OF APPROVAL, IF ANY:

Salt gel mud consisting of 10#
Bags of 25# of gel per bbl
must be placed between each plug

Notify OCD 24 hrs. prior to any work done