

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.  
Santa Fe, New Mexico 87505

WELL API NO.

30-005-62340

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

O'Brien

8. Well No.

#1

9. Pool Name or Wildcat

Miller Lake Abo

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL WELL ☐ GAS WELL ☒ OTHER

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address of Operator

P.O. BOX 1030, ROSWELL, NEW MEXICO 88202-1030

4. Well Location

Unit Letter C : 660' Feet From The North Line and 1900' Feet From The West Line

Section 25 Township 7S Range 29E NMPM Chaves County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4104'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

SEE RULE 1103

4/29/02: Notify OCD. MIRU. Dig & Line working pit.

4/30/02: NUBOP & Flange. POOH w/tbg. RIH & set CIBP @ 6425'. Dump 35' cement on top. RIH w/tbg & cir 10# @ mud @ 6380'. POOH & spot 25 sxs @ 2780'-2540'. POOH w/47 stands. Close in well.

5/01/02: POOH w/tbg. ND wellhead. Weld on pull nipple. Cut csg @ freepoint @ 3800'. Lay down 2 jts. Close in well.

5/02/02: POOH w/csg. RIH & spot 35 sxs @ 3850'. POOH. WOC. RIH & tag @ 3743'.

POOH & spot 35 sxs @ 3550'. POOH w/25 stands. Close in well.

5/03/02: RIH & tag @ 3444'. POOH & spot 35 sxs @ 2378'. POOH. WOC. RIH & tag @ 2268'. POOH & spot 35 sxs @ 1283'. POOH. WOC. RIH & tag @ 1151'. POOH & spot 35 sxs @ 977'. POOH. Close in well.

5/06/02: RIH @ tag @ 851'. POOH & spot 35 sxs @ 388'. POOH. WOC. RIH & tag @ 260'. POOH & spot 15 sxs @ 60' to surface. RD. Move out. Install dry hole marker. Level pit & cellar.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Kelly M. Britt TITLE PRODUCTION RECORDS DATE May 14, 2002

TYPE OR PRINT NAME Kelly M. Britt TELEPHONE NO. 505-622-1127

(This space for State Use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

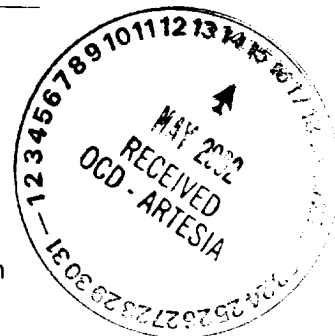

MAYO MARRS CASING PULLING INC.  
BOX 863  
KERMIT, TEXAS 79745

STRATA PRODUCTION COMPANY

Lease: O'BRIEN # 1

Project: P & A – CEMENTING REPORT

---

04-30-2002 - SET CIBP @ 6425' – DUMP 35' CEMENT ON TOP  
04-30-2002 – SPOT 25 SXS @ 2780'-2540'  
05-02-2002 – SPOT 35 SXS @ 3850'- 3743' TAGGED – PULLED 3800' OF 5 ½"  
05-02-2002 - SPOT 35 SXS @ 3550'-3444' TAGGED  
05-03-2002 - SPOT 35 SXS @ 2378'-2268' TAGGED  
05-03-2002 - SPOT 35 SXS @ 1283'-1151' TAGGED  
05-03-2002 - SPOT 35 SXS @ 977'-851' TAGGED  
05-06-2002 - SPOT 35 SXS @ 388'- 260' TAGGED  
05-06-2002 - SPOT 15 SXS @ 60' –SURFACE

INSTALL DRY HOLE MARKER  
CIRCULATE 10# MUD