

~~CONFIDENTIAL INFORMATION~~
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Drawer DD

Artesian

210

PERMIT

(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

NM-54400

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Shell 15 Fed. Com.

9. WELL NO.

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 15-T15S-R29E

12. COUNTY OR PARISH 13. STATE

Chaves

NM

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

McClellan Oil Corporation

3. ADDRESS OF OPERATOR

P.O. Drawer 730, Roswell, NM 88202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)

At surface

660' FNL & 660' FWL

JAN 26 '88

O. C. D.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, CR, or other)

3907' G.L.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

Plug back

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

XX

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

12/10/87: Set CIBP at 8300'. Shot 5½" casing off at 6900'. Casing would not pull loose. Ran free point. Casing stuck at 5430'.

12/12/87: Shot casing off at 5398'. Pulled all 5½" casing to surface.

12/13/87: Ran tubing in hole. Set 35 sx cement plug from 5300'-5500'. Waited 4 hours and tagged plug at 5260'. Set 75 sx cement plug from 4023'-4123'. WOC - 2 hours. Tagged plug at 3995'. Shut down due to bad weather.

18. I hereby certify that the foregoing is true and correct

SIGNED

Paul Kaysdale

TITLE Operations Manager


DATE 12/22/87

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

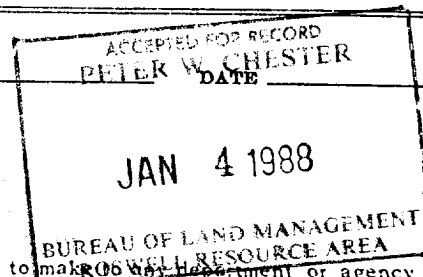

*See Instructions on Reverse Side