

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501
RECEIVED
JAN 27 1984
O. C. D.
ARTESIA

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	State ☒ Fee ☐
5. State Oil & Gas Lease No.	B-1069

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - I" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator J.B. Adamson	8. From or Lease Name Gulf St.
3. Address of Operator Rt.1, Box 202-J, Artesia, New Mex. 88210	9. Well No. #3
4. Location of Well UNIT LETTER C 1018 FEET FROM THE North LINE AND 1642 FEET FROM West LINE, SECTION 22 TOWNSHIP 17 RANGE 28 NMPM.	10. Field and Pool, or Whdout Red Lake, QGSA
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER Perforate Casing ☐	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-27-83

Run tubing to 1980 ft. and pump 12 sacks class C. cement.

10-31-83

Log well Gamma Ray-Neutron. Top of cement at 1804.

11-2-83

Pressure up on casing to 800#. Set D.B.P. at 1540, with 10 ft. cement on top.

11-3-83

Tag cement at 1530. Perforate casing at 1485 to 1465 with 18 holes. Spot 250 gallons acid and breakdown.

Swabed tubing to test Penrose Formation. No show of oil or gas.

11-29-83

Run tubing to 1490 and pump 12 sacks class C. cement, pull tubing.

11-30-83

Tag plug at 1388.

Perforate casing at 747-734 with 18 holes to test Seven Rivers Formation.

Run tubing and packer, spot 250 gals.acid. Swab back. Had show of oil & gas.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J.B. Adamson TITLE Owner-Operator DATE 1-23-84

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.B.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION RECEIVED BY
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

JAN 27 1984

O. C. D.
ARTESIA, OFFICE

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
B-1069

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMITS (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator J.B. Adamson	8. Farm or Lease Name Gulf St.
3. Address of Operator Rt. 1, Box 202-J, Artesia, New Mex. 88210	9. Well No. #3
4. Location of Well UNIT LETTER C 1018 FEET FROM THE North LINE AND 1642 FEET FROM THE West LINE, SECTION 22 TOWNSHIP 17 RANGE 28 N.M.P.M.	10. Field and Pool, or Wellcat Red Lake, QGSA
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	
OTHER ☐	Perforate Casing		

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-27-83
Run tubing to 1980 ft. and pump 12 sacks class C. cement.

10-31-83
Log well Gamma Ray-Neutron. Top of cement at 1804.

11-2-83
Pressure up on casing to 800#. Set D.B.P. at 1540, with 10 ft. cement on top.

11-3-83
Tag cement at 1530. Perforate casing at 1485 to 1465 with 18 holes. Spot 250 gallons acid and breakdown.
Swabed tubing to test Penrose Formation. No show of oil or gas.

11-29-83
Run tubing to 1490 and pump 12 sacks class C. cement, pull tubing.

11-30-83
Tag plug at 1388.
Perforate casing at 747-734 with 18 holes to test Seven Rivers Formation.
Run tubing and packer, spot 250 gals. acid. Swab back. Had show of oil & gas.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J.B. Adamson TITLE Owner-Operator DATE 1-23-84


APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

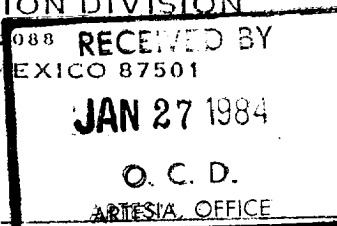

5a. Indicate Type of Lease
State ☒ For ☐
5. State Oil & Gas Lease No.
B-1069

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR
USE APPLICATION FOR PERMIT - 22 (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator J.B. Adamson	8. Farm or Lease Name Gulf St.
3. Address of Operator Rt.1, Box 202-J, Artesia, New Mex. 88210	9. Well No. #3
4. Location of Well UNIT LETTER C 1018 FEET FROM THE North LINE AND 1642 FEET FROM West LINE, SECTION 22 TOWNSHIP 17 RANGE 28 NMPM.	10. Field and Pool, or Wildcat Red Lake, QGSA
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER Perforate Casing ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-27-83
Run tubing to 1980 ft. and pump 12 sacks class C. cement.

10-31-83
Log well Gamma Ray-Neutron. Top of cement at 1804.

11-2-83
Pressure up on casing to 800#. Set D.E.P. at 1540, with 10 ft. cement on top.

11-3-83
Tag cement at 1530. Perforate casing at 1485 to 1465 with 18 holes. Spot 250 gallons acid and breakdown.
Swabed tubing to test Penrose Formation. No show of oil or gas.

11-29-83
Run tubing to 1490 and pump 12 sacks class C. cement ,pull tubing.

11-30-83
Tag plug at 1388.
Perforate casing at 747-734 with 18 holes to test Seven Rivers Formation.
Run tubing and packer, spot 250 gals.acid. Swab back. Had show of oil & gas.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED _____ TITLE Owner-Operator DATE 1-23-84

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State ☒ Fee ☐
5. State Oil & Gas Lease No. B-1069
7. Unit Agreement Name
8. Farm or Lease Name Gulf St.
9. Well No. #3
10. Field and Pool, or Wildcat Red Lake, QGSA
12. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - 1 (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
J.B. Adamson

3. Address of Operator
Rt.1, Box 202-J, Artesia, New Mex. 88210

4. Location of Well
UNIT LAYER C 1018 FEET FROM THE North LINE AND 1642 FEET FROM West THE LINE, SECTION 22 TOWNSHIP 17 RANGE 28 NMPM.

15. Elevation (Show whether DE, RT, GR, etc.)

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	
OTHER <u>Perforate Casing</u> ☐		OTHER ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-27-83
Run tubing to 1980 ft. and pump 12 sacks class C. cement.

10-31-83
Log well Gamma Ray-Neutron. Top of cement at 1804.

11-2-83
Pressure up on casing to 800#. Set D.E.P. at 1540, with 10 ft. cement on top.

11-3-83
Tag cement at 1530. Perforate casing at 1485 to 1465 with 18 holes. Spot 250 gallons acid and breakdown.
Swabed tubing to test Penrose Formation. No show of oil or gas.

11-29-83
Run tubing to 1490 and pump 12 sacks class C. cement ,pull tubing.

11-30-83
Tag plug at 1388.
Perforate casing at 747-734 with 18 holes to test Seven Rivers Formation.
Run tubing and packer, spot 250 gals.acid. Swab back. Had show of oil & gas.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J.B. Adamson TITLE Owner-Operator DATE 1-23-84

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: