

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-10
Revised March 25, 1994

WELL API NO.
30-015-01752

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

Empire Abo Unit "F"

8. Well No.

F-37

9. Pool name or Wildcat
ABO

JUL 2002
RECEIVED
OCD - ARTESIA

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator BP America (ARCO)

9. Address of Operator P.O. Box 1089 Eunice, NM 88231

10. Well Location

Unit Letter _____: 1850' _____ feet from the _____ North _____ line and 710 _____ feet from the _____ West _____ line

Section 35 Township 17S Range 28E NMPM County Eddy

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

KB 11' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Work will commence as soon as a plugging crew is available.

1. NU BOP
2. T.I.H. Tag 5 1/2" CIBP @ 6207'. Spot 25 sxs. cmt. @ 6207'.
3. Circulate hole w/9.5# salt gel mud.
4. PUH & spot 25 sxs. cmt. plug from 3710' to 3610'. Top of Glorieta.
5. PUH to 814' & spot 35 sxs. cmt. plug to 714' across the 8 5/8 casing shoe. WOC & TAG.
6. PUH & spot 25 sxs. cmt. plug @ 600' to 500' over the Yates.
7. PUH & spot 10 sxs. cmt. surface plug.
8. Cut off wellhead & anchors 3' BGL. Clean up location.
9. Set dry hole marker.

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE M. Kent Whitmire TITLE Operations Specialist DATE 7-7-2002

Type or print name M. Kent Whitmire Telephone No. 505-677-3642

(This space for State use)


APPROVED BY [Signature] TITLE Field Rep ID DATE JUL 15 2002

Conditions of approval, if any:

Empire Abo Unit 'F' 37

Potential
Perforation
Zones

200'

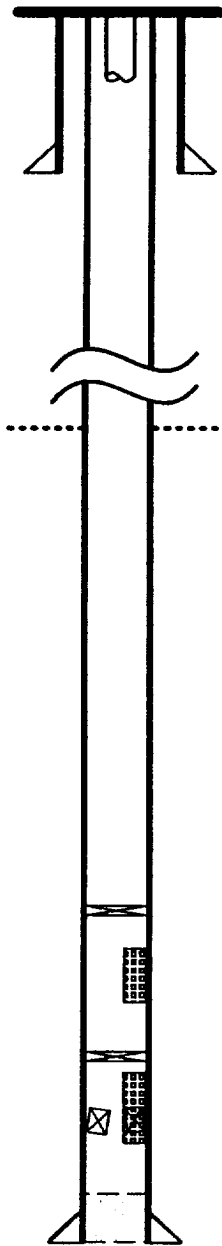

- KB at 3687' above sea level (Used as the Datum)
Well is currently shut in
- 1jt 2 3/8", 4.7#, EUE 8rd, J-55 tubing left in hole
- Top of Cement at surface
- 8-5/8" - 24# casing set at 764' (12 1/4" hole)
- Top of Abo at 6020'
- CIBP set at 6207'
- Perforations 6220' - 6240' Closed off w/ CIBP
- CIBP set at 6260'
- Perforations 6266' - 6294' Closed off w/ CIBP
- Junk pk' pushed to 6286'
- PBTD at 6312'
- 5-1/2" - 14# / 15.5# casing set at 6351 (7 7/8" hole)

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR BP-America (ARCO)
LEASENAME Empire Ab Unit

WELL # 37
SECT 35 TWN 17S RNG 28E
FROM 1850 N/O L 710 E/W L
TD: 6351 FORMATION @ TD
PBD: 6312 FORMATION @ PBD

10 SX cm + plug
to surface
25 SX cm + plug @
600' 8 5/8
@ 764'
TOC 40' of Surf.
35 SX cm + plug
814' to 714'
25 SX cm + plug @
3710 - Top Blorietta
CIR. hole w/ 9.5"
6" el mud
CIBP 6207 cap w/
25 SX cm +
CIBP set @ 6260
5 1/2
@ 6351
TOC surface

Perfs
6220
6240
6266
6294

Yates

Note - 8 5/8 surface
cm + to 40' of surface.
+ filled up w/ pea gravel

TD 6351

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE	8 5/8	764	surface		
INTMED 1					
INTMED 2					
PROD	5 1/2	6351	surface		
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					
	CUT & PULL @			TOP - BOTTOM	
INTMED 1			PERFS		-
INTMED 2			OPENHOLE		-
PROD					

*REQUIRED PLUGS DISTRICT # 2

RUSTLER (ANYID)	
YATES	600'
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPTAIN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
GLORIETA	3710
BLINEBRY	
TUBB	
DRINKARD	
ADO	
WC	
FENN	
STRAWN	
ATOKA	
MORROW	
MISS	
DEVONIAN	

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	35 SXS	6400'
PLUG #2	SHOE	50 SXS	5350'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #3	CIBP	25 SXS	4800'
PLUG #4	STUB	50 SXS	3600'-3700'
PLUG #5	RETNR SQZ	200 SXS	400'
PLUG #6	SURF	10 SXS	0-10'
PLUG #1	CIBP	25 SX	6207
PLUG #2	Glorieta	25 SX	3710-3610
PLUG #3	Shoe	35 SX	814-714
PLUG #4	Yates	25 SX	600-500'
PLUG #5	Surface	10 SX	12-60
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			