NM OIL CONS. COMMISSION Drawer DD

Artesia, NM 88210

Form 3160-5

UNITED STATES

FORM APPROVED

orm 3160-5 June 1990)	UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT		Budget Bureau No. 1004-0135 Expires: March 31, 1993 5. Lease Designation and Serial No.
			T.C. 037777
Do not use this form for	DRY NOTICES AND REPO proposals to drill or to deep PPLICATION FOR PERMIT—	pen or reentry to a different reservoir	6. If Indian, Allottee or Tribe Name
	7. If Unit or CA, Agreement Designation		
C Well C State	ther		3. Well Name and No. Levers Federal#1
2. Name of Operator Arapaho Cil 3	Gas Company		9. API Well No. 30-015-02782
3. Address and Telephone No. P.O. Box 1517	, Roswell, New Mexic	o 88202 - 1517	10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec. 33, T-16S, R-29E			11. County or Parish. State
1980'FSL & 1980' FWL Unit K			Eddy County New Mexico
12. CHECK APPE	OPRIATE BOX(s) TO INDI	CATE NATURE OF NOTICE, REP	
TYPE OF SUBM	ISSION	TYPE OF ACTIO	DN
Notice of Intent		Abandonment Recompletion	Change of Plans New Construction Non-Routine Fracturing
Subsequent Repo		Plugging Back Casing Repair Altering Casing	Water Shut-Off Conversion to Injection
Final Abandonm		Other	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
13. Describe Proposed or Completed give subsurface locations an	Operations (Clearly state ail pertinent details d measured and true vertical depths for ail	, and give pertinent dates, including estimated date of stamarkers and zones pertinent to this work.)*	irting any proposed work. If well is directionally drilled

See Attached Procedure



4. I hereby certify that the foregoing is true and correct	Title Consultant	Date <u>6/30/93</u>
(This space for Federal or State office use) Approved by (ORIG. SGO.) IDE in LOVA	Patrolaum Englaver	JIJL 0 8 1993
Approved by Conditions of approval, if any:		

Tide 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

ARAPAHO OIL & GAS LEVERS FEDERAL #1 SEC.33,T-16S,R-29E 1980'FSL & 1980'FWL EDDY COUNTY, NEW MEXICO P&A PROCEDURE

WELL DATA:

Casing: 8 5/8" @ 315 50 sx cmt.

7" @ 1,800′

No cmt information reported on 7"

BPTD: 2,931 ...


TD: 3,000′

Logs: No logs available

- 1. RUPU and install 3,000# manual BOP 7" X 2 3/8"
- 2. POOH W/ Tbg and tallied out to inspect and determine total Tbg.
- 3. Replace any bad tbg, and TIH \(\Psi / OE tbg and tag PBTD\)
- 4. Circulate hole W/ 10PPG salt gel
- 5. Spot 35sx cmt plug at 2,500' and up (TAG Plug)
- 6. Spot 35sx cmt plug at 1,950′ 50′ above and below shoe.
- 7. Free point 7" Csg and cut off 50' above free point and POOH and lay down.
- 8. Spot 35sx cmt plug 50' above and below stub. (Tag Plug)
- 9. Spot 35sx cmt plug at 8 5/8" Csg Shoe 50' above and below.
- 10. Dig out well head below GL set 10' surface cmt plug.
- 11. Weld on P&A marker 4' above GL, with all well information welded on marker.

Hrabano Cil & Gas Lavar Federal *1 Sac. Z3. TH168, RH29E 19601FSL & 19801 FWL Essy County, N.M.

73.A

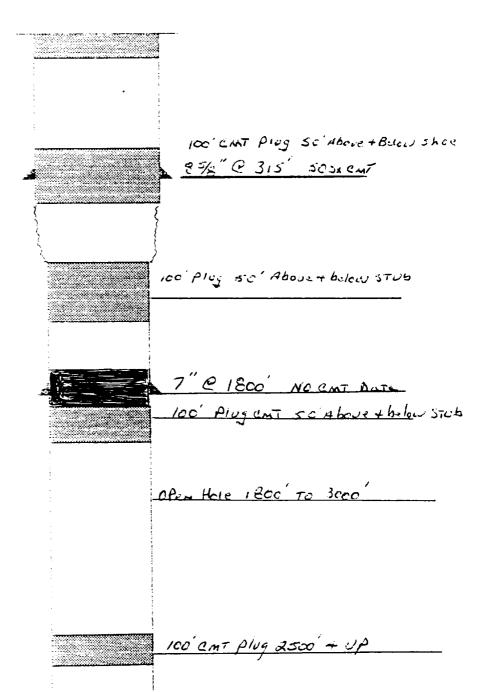

Arabano 011 & Gas Lever Federal #1 Sec. 33, T-158.R-29E 1980'FSL & 1980' FWL Eddy County, M.M.

P& A

85/8 @ 315 SC SX CMT 7" @ 1800' NO EMT date Open hale 1800' TO TO PBTA 2931 TA 3,000'