

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPPLICATE
(Other instructions on
reverse side)


Form approved
Budget Bureau No. 1004-0135
Expires August 31, 1985

c/SF

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. 08773
2. NAME OF OPERATOR Mobil Producing TX & NM Inc.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR 9 Greenway Plaza, Suite 2700, Houston, TX 77046		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FEL & 660' FSL		8. FARM OR LEASE NAME West Henshaw Premier Unit TR 10
14. PERMIT NO.		9. WELL NO. 1
15. ELEVATIONS (Show whether by, BT, GN, etc.) O. C. D.		10. FIELD AND POOL, OR WILDCAT Henshaw/Grayburg, West
		11. SEC., T., R., W., OR BLK. AND SURVEY OR AREA Sec. 5, T-16S, R30E
		12. COUNTY OR PARISH Eddy
		13. STATE New Mexico

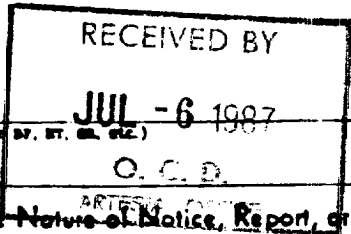

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF	☐	WATER SHUT-OFF	☐
FRAC TREAT	☐	FRAC TREATMENT	☐
SHOOT OR ACIDIZE	☐	SHOOTING OR ACIDIZING	☐
REPAIR WELL	☐	(Other)	☐
(Other)	☐	(Note: Report results of multiple completion on Well Completion or Re-completion Report and Log form.)	
PULL OR ALTER CASING	☐	REPAIRING WELL	☐
MULTIPLE COMPLETE	☐	ALTERING CASING	☐
ABANDON*	☐	ABANDONMENT*	☒
CHANGE PLANE	☐		

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 6-2-87 Notified Tom Hare - BLM. MI RU Marrs Plugging Serv. POH W/rods & pump. POH W/2 3/8" tbg (2730') & SN. WIH W/2 3/8" tbg - 2700' - Press test 750#/OK. POH. WIH W/5 1/2" go Retainer on 2 3/8" tbg - 2700'.
- 6-3-87 Displace 5 1/2" csg to 9.5# mud laden fluid - (30 vis). Sq JH 2735'-2800' W/35 sxs Class C; final sq press - 600# & capped ret W/15 sxs Class C - TOC-2600' - POH. Perf 5 1/2 csg W/4 js - 2100'. WIH W/5 1/2 AD-1 pkr - 1800' & sq W/40 sxs Class C - Final sq press - 450#. WOC. POH W/pkr. WIH W/1" bar on slickline - tag cmt 1968' - OK. Perf 5 1/2" csg - 4 js - @ 1120'. WIH W/AD-1 pkr - sq W/35 sxs Class C. Displace cmt 1000'. Final sq press - 550#. WOC.
- 6-4-87 Re-sq sq holes - 1120' W/35 sxs Class C cmt. Displace cmt to 1000'. Final sq press - 450#. WOC - Tom Hare on location - checking - 10:30 am. WIH W/1" bar - tag cmt - 931'/OK. Nitro-cut 5 1/2" csg - 607'. Worked csg 8' stuck again. Notified Danny Cortez - BLM - Carlsbad gave us verbal appro to re-cut csg - 540± & fill stub W/60 sxs cmt. Nitro cut csg - 545' - POH - 5 1/2 csg. WIH W/tbg - 590'. Pump 60 sxs Class C cmt - 590'; 50' in 50' out 5 1/2" csg stub - 545'. Cal top of cmt - 450'. POH. Tom Hare witness job - BLM. WOC. WIH W/1" bar - 400' - cmt still green. WOC.
- 6-5-87 WIH W/1" bar - tag cmt - 40'. Witnessed by Tom Hare - BLM. Dug out cellar 10' found 2 csg holes; welded on 8 5/8" plate on csg. & 2" value. Sq 8 5/8" csg (See Reverse Side)

18. I hereby certify that the foregoing is true and correct

SIGNED Dura J. Barlow TITLE Mobil Exploration & Producing U.S. Inc. as Agent for Mobil Producing TX & NM Inc. DATE 7-2-87

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Post ID-2
7-10-87
P & A

6-5-87
(Cont'd.)

stub - 545' & waterflow W/100 sxs Class C W/2% Cal Chl - Displ cmt - 250'.
Final sq press - 600#. WOC.

6-6-87

Sq wtr flow W/100 sxs Class C W/2% Cal Chl - displ cmt to 20'. Final
press - 600#. WOC. Ran 2" tbg to 25' - pumped 12 sxs Class C W/2%
Cal Chl to surface. Welded on 8 5/8" plate W/1" valve & P&A marker.
RD & Rel Marrs Plugging Serv PU. Well P&A. All work witness by
Tom Hare - BLM on location all day.