

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other instructions
reverse side)

Form approved
Budget Bureau No. 1004-0135
Expires August 31, 1985

clsp

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		MAR 28 1985		5. LEASE DESIGNATION AND SERIAL NO. LC-067610 NM-06407-C	
2. NAME OF OPERATOR Mobil Producing TX & NM Inc. ✓		O. C. D.		7. UNIT AGREEMENT NAME West Henshaw	
3. ADDRESS OF OPERATOR 9 Greenway Plaza - Suite 2700 - Houston, TX 77046		ARTESIA OFFICE		8. NAME OF LEASE NAME Premier Unit TR. 10	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980 FSL & FEL				9. WELL NO. 4	
14. PERMIT NO.		15. ELEVATIONS (Show whether DV, ST, OR, etc.)		10. FIELD AND POOL, OR WILDCAT Henshaw Grayburg, West	
				11. SEC., T., R., M., OR BLK. AND SUBST. OR AREA Sec. 5, T-16S, R-30E	
				12. COUNTY OR PARISH Eddy	
				13. STATE NM	

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

☐
☐
☐
☐
☐

PULL OR ALTER CASING
MULTIPLE COMPLETION
ABANDON*
CHANGE PLANE

☐
☐
☒
☐
☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

☐
☐
☐
☐
☐

REPAIRING WELL
ALTERING CASING
ABANDONMENT*

☐
☐
☐
☐
☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. Notify BLM (505-887-6544) 24 hrs prior to rigging up.
2. MIRU, POH w/tbg.
3. RIH w/CIBP & set @ 2725, cap w/35' Cl C Neat (+45x).
4. Free point csg, cut & pull all free 5-1/2" csg.
5. Circ hole w/9.5#/gal MLF.
6. Spot plug 50' above & 50' below csg stub w/15x Cl C Neat, tag plug (per NMOCDD request).
7. Spot plug 1900-2000 w/20x Cl C Neat.
8. Spot plug 1160-1260 w/20x Cl C Neat.
9. Spot plug 440-540 w/20x Cl C Neat, tag plug (per NMOCDD request).
10. Spot plug 0-50 w/12x Cl C Neat. (Both sides csg)
11. Erect P&A marker, clean & level location.

18. I hereby certify that the foregoing is true and correct

SIGNED Nancy Lewis TITLE Authorized Agent DATE 3-18-86

(This space for Federal or State office use)

APPROVED BY James H. Lewis TITLE AREA MANAGER DATE 3-27-86

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

RECOMMENDED WORK PROCEDURE

ASE West Henshaw Premier Unit WELL NO. 10-4
INULAR FLUID PRIOR TO WORKOVER Wellbore Fluids W/O FLUID TO BE USED 9.5 16/32 MLF
WT. (LBS/GAL.) 9.5 ZONE San Andres HYD. PRESS 1400 RES. PRESS —
ZONE HYD. PRESS RES. PRESS
ZONE HYD. PRESS RES. PRESS

1. Notify the BLM at 505-237-6544 24hrs prior to rigging up on well
2. MIBU PU, release TA, POH w/ tbg and stand.
3. RIH w/ CIBP on wireline (5 1/2" 14 1/6" csg) and set at 2725' cap w/ 35' class C neat cmt ± 4 SXS.
4. RIH w/ wireline, free point csg, cut and pull all free 5 1/2" csg
5. GIH w/ tbg and circulate hole w/ 9.5 16/32 MLF
6. PU and spot a 100' class C neat cmt plug 50' above and below csg stub ± 15 SXS. Tag plug (requested by NMOCB)
7. PU and spot a 100' class C neat cmt plug across the Queen top from 2000 to 1900 ± 20 SXS
8. PU and spot a 100' class C neat cmt plug across the Bowers top from 1260 to 1160 ± 20 SXS
9. PU and spot a 100' class C neat cmt plug 50' above and below the surface csg shoe from 540 to 440 ± 20 SXS. Tag plug (requested by NMOCB)
10. PU and spot a 50' cmt plug from 50' to surface w/ ± 12 SXS class C neat cmt
11. Erect P&A marker
12. Clean and level location.

Procedure approved by Les Clements NMOCB, Artesia 505-748-1283

K. E. McCready 4/10/85

DATE 4/9/85 WELL NO. 10-4 LEASE W. Henshaw Premier FIELD Henshaw Grayburg
Unit

LOCATION Sec 5, T16S, R30E SIGNED K.E. McCready

G.L. 3815
D.F. _____
K.B. _____
ZERO _____

Present

8 5/8 csg set at 490' w/ 75 SXS

Perfs 2742-2752 4JSPP

5 1/2" 2416/FT csg set at 2778' w/ 100 SXS Est cm top 12200'

PBTD 2783

TD 2783

DATE 4/10/85 WELL NO. 10-4 LEASE W. Henshaw Premise FIELD Henshaw Grayburg, W

LOCATION Sec 5, T16S, R30E


SIGNED K.E. McCready

G.L. 3214

D.F. _____

K.B. _____

ZERO _____

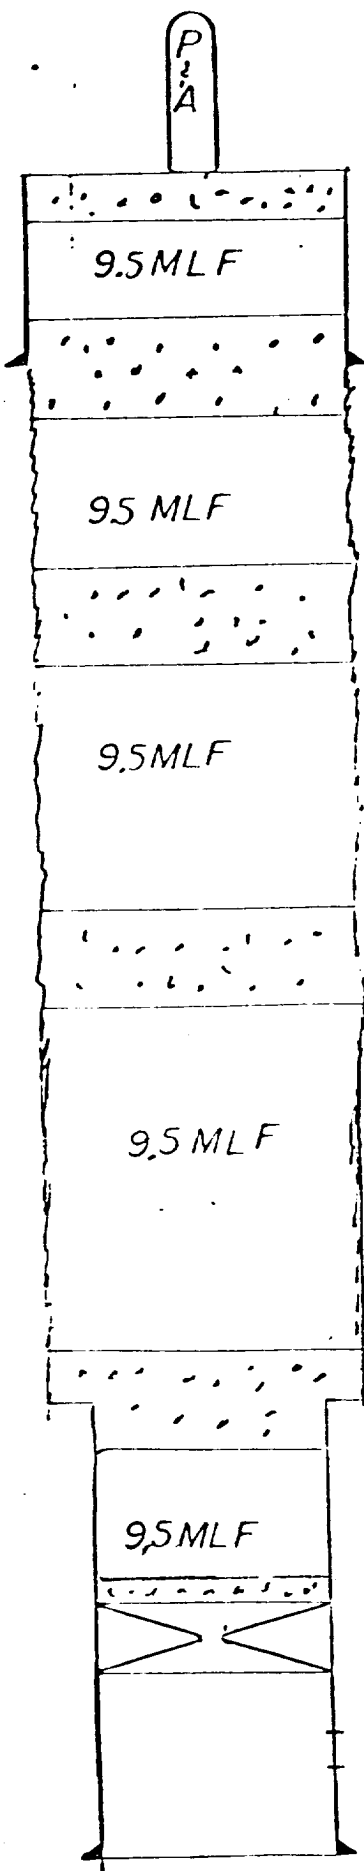

50' CLASS C SURFACE PLUG ± 12 ' SXS

100' CLASS C CMT PLUG 50' ABOVE; BELOW CSG SHOE
 ± 20 ' SX

8⁵/₈ CSG SET AT 490' W 75' SXS

100' CLASS C CMT PLUG 50' ABOVE; BELOW TOP OF
THE BOWERS FROM 1160' TO 1260' ± 20 ' SX

100' CLASS C CMT PLUG 50' ABOVE; BELOW TOP OF
THE QUEEN FROM 1900' TO 2000' ± 20 ' SX

100' CLASS C CMT PLUG 50' ABOVE; BELOW CSG STUB

CIBP SET AT 2725' CAP W/ 35' CMT ± 4 ' SX TO CAP AT 2690'

Perfs 2742 - 2752 4 JS PF

5¹/₂" CSG SET AT 2783' W/ 100' SX Est Cmt Top ± 2200 '

PBTD -

TD 2783'

Richardson & Bass

P. R. Bass

TEXACO COUNTY.



U. S.

$$5h\nu + i2$$

Y A' O

—T. 11000000

‘

WATERFLOOD PATTERN MAP
WEST HENSHAW PREMIER UNIT
WEST HENSHAW GRAYBURG FIELD
EDDY COUNTY, NEW MEXICO
12-8-66 SCALE: 1"=2000'

12-8-66

R.W.W.

MM DFB 11-1-83