

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIP
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

C/SF

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME West Henshaw
2. NAME OF OPERATOR Mobil Producing TX & NM Inc. ✓	8. FARM OR LEASE NAME Premier Unit TR. 5
3. ADDRESS OF OPERATOR 9 Greenway Plaza - Suite 2700 - Houston, TX 77046	9. WELL NO. 6
4. LOCATION OF WELL (Report location clearly and in accordance with any permit requirements. See also space 17 below.) At surface 330 FNL & 2308 FEL	10. FIELD AND POOL, OR WILDCAT Henshaw Grayburg, West
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 10, T-16S, R-30E
15. ELEVATIONS (Show whether DF, RT, OR, etc.) O. C. D. ARTESIA, OFFICE	12. COUNTY OR PARISH Eddy
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF	☐	PLUG OR ALTER CASING	☐
FRACTURE TREAT	☐	MULTIPLE COMPLETION	☒
SHOOT OR ACIDIZE	☐	ABANDON*	☐
REPAIR WELL	☐	CHANGE PLANE	☐
(Other)	☐		

WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACTURE TREATMENT	☐	ALTERING CASING	☐
SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☐
(Other)	☐		

(NOTE: Report results of multiple completion on Well Completion or Re-completion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

1. Notify BLM (505-887-6544) 24 hrs. prior to rigging up.
2. MIRU, POH w/tbg.
3. GIH w/cmt ret & set @ 2850, sqz OH w/10x, cap ret w/100' cmt.
4. Circ hole w/9.5#/gal MLF.
5. Spot plug 2086-2186 w/10x Cl C Neat.
6. Spot plug 1228-1328 w/10x Cl C Neat. *Both sides csg.*
7. Perf 4 sqz holes @ 425. *Perf at 1328'*
8. Set balanced plug 325-425, inside & outside csg w/62x Cl C Neat.
9. Spot plug 0-50 w/75x Cl C Neat.
10. Erect P&A marker, clean & level location.

18. I hereby certify that the foregoing is true and correct

SIGNED

Nancy Lewis

TITLE

Authorized Agent

DATE

3-18-86

(This space for Federal or State office use)

Orig. Sgd. Charles S. [unclear]

APPROVED BY

Area Manager

TITLE

DATE

3-31-86

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

RECOMMENDED WORK PROCEDUREEASE West Henshaw Premier Unit WELL NO. 5-6ANNULAR FLUID PRIOR TO WORKOVER Wellbore Fluids W/O FLUID TO BE USED 9.5' 1/2 MLFWT. (LBS/GAL.) 9.5 ZONE San Andres HYD. PRESS ±1500 RES. PRESS -

ZONE _____ HYD. PRESS _____ RES. PRESS _____

ZONE _____ HYD. PRESS _____ RES. PRESS _____

1. Notify the BLM at 505-887-6544 24hrs prior to rigging up.

2. MURU PU, POH w/ tbg and stand.

3. GIH w/ cmt retainer on tbg and set at 2850'

4. Sq 2 OH 1 perfs w/ ±10 SXS class C cmt, leave 100' cmt on top of retainer ±10 SXS

5. PU to 2750 and circulate hole w/ 9.5' 1/2 MLF ± 67 bbls

6. PU to 2186 and spot a 100' class C neat cmt plug from 2186 to 2046' ±10 SXS across Queen.

7. PU to 1328' and spot a 100' class C neat cmt plug from 1328 to 1228' ±10 SXS across Bowers POH

8. GIH w/ 4 csg gun on wireline and perf 4 sq 2 holes at 425'

9. GIH w/ tbg and establish pump rate into perfs at 425'

10. Place 100' balanced cmt plug inside & outside csg from 325 to 425' ± 62 SXS class C neat

11. PU and spot 50' surface plug w/ ± .75 SXS class C neat

12. Erect P/A marker

13. Clean & level location

Procedure approved by Les Clements NMOCD

K.E. McCready 4/11/85

LOCATION Sec 10, 16, R30

SIGNED K.E. Cready

UNIT

WEST

G.L. _____

D.F. _____

K.B. _____

ZERO _____

Present

12 1/4" hole Surface To TD

* CSG leak at 40' squeezed w/ 35 SX 2/19/81

Est cmt top at 700'

7 7/8" hole 373' to 2247'

6 1/4" hole 2247' to 2920

EOT @ 2895' 2 3/8"

PerFS 2881 to 88 1/2; 2892 to 96 2/JS PF

5 1/2" 14 1/4" FT CSG Set at 2905 w/ 150 SX5 EST Cmt Top @ 700'

OHZ 2909-2920


TD 2920

DATE 4/11/85 WELL NO. 5-6 LEASE W. Henshaw Premier Unit West

LOCATION Sec 10, T16, R30 SIGNED K.E. McCready

G.L. _____
D.F. _____
K.B. _____
ZERO _____

Proposed

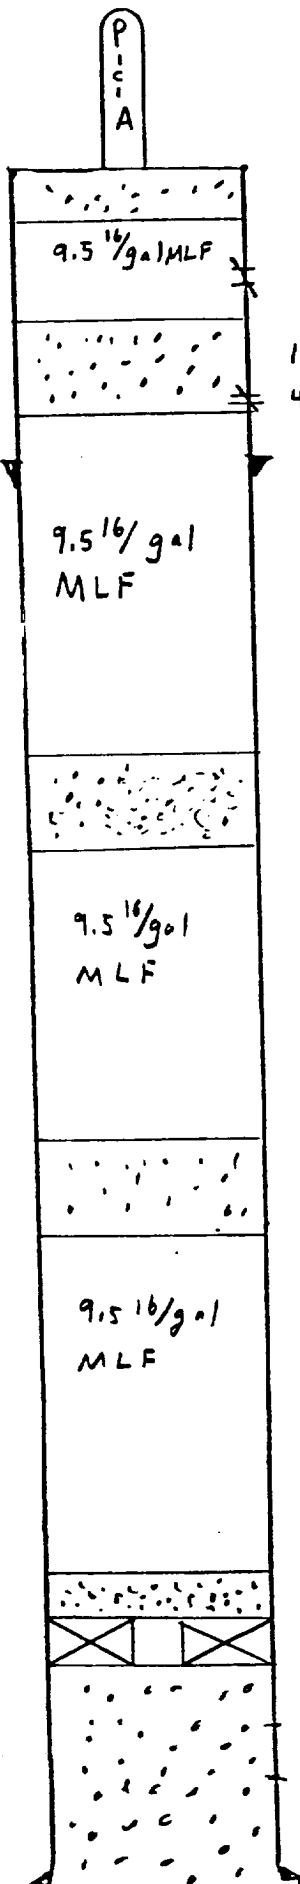

50' Surface plug $\pm$ 7 SXS

12 1/4" hole Surface To 373'

Csg leak at 40' squeezed w/ 35 SX 2/19/81

100' Class C. cmt plug inside ; outside csg $\pm$ 62 SXS, 425'-325'

4 SQZ holes at 425'

Est cmt top at 700'

7 7/8" 373' To 2247'

100' Class C cmt plug $\pm$ 10 SXS across Bowers 1328'-1228'

100' Class C cmt plug $\pm$ 10 SXS across Queen 2186'-2086'

6 1/4" hole 2247' To 2920'

Cmt ret set at 2850 w/ 100' cmt on top $\pm$ 10 SXS

Sqz OH w/ $\pm$ 10 SXS class C neat

Perfs 2881 to 88 ; 2892 to 96 2/JSPF

5 1/2" 14 1/4" FT csg set at 2905 w/ 150 SXS EST cmt top @ 700'

OHZ 2909-2920

COUNT,

P. R. Boss

Texaco COUNTY.

