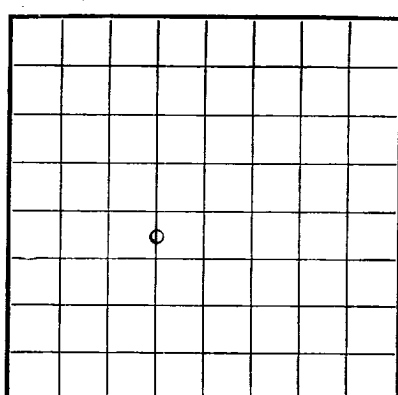


U. S. LAND OFFICE New Mexico
SERIAL NUMBER 04422
LEASE OR PERMIT TO PROSPECT _____

LOCATE WELL CORRECTLY

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

LOG OF OIL OR GAS WELL

Company John H. Trigg Address P. O. Box 5629 Roswell, N. M.
Lessor or Tract Federal "U" Lease Field W. Henshaw Grayburg State New Mexico
Well No. 10-17 Sec. 17 T. 16S R. 30E Meridian N. M. P. M. County Eddy
Location 2310 ft. ^[N.] of S. Line and 1980 ft. ^[E.] of W. Line of Section 17 Elevation 3782
(Derrick floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.

Signed W. H. TriggDate June 27, 1958 Title Geologist

The summary on this page is for the condition of the well at above date.

Commenced drilling May 23, 1958 Finished drilling June 23, 1958

OIL OR GAS SANDS OR ZONES

(Denote gas by G)

No. 1, from _____ to _____ No. 4, from _____ to _____
No. 2, from _____ to _____ No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____

IMPORTANT WATER SANDS

No. 1, from 400 to 410 No. 3, from 2245 to 2260
No. 2, from 2005 to 2020 No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From—	To—	
10 3/4"	32#		J-55	511	Texas Pattern	2251			
8 5/8"	21#		J-55	2135	Texas Pattern	all pulled			
5 1/2"	15.5#		J-55	2748	Texas Pattern	all pulled			

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
10 3/4"	515	75	Pump		
8 5/8"	2135	Mudded	Pump	heavy	20 sacks
5 1/2"	2753	Landed			

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out

TOOLS USED

Rotary tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet
Cable tools were used from 0 feet to 2801 feet, and from _____ feet to _____ feet

DATES

June 27, 1958 Plugged & Abandoned June 6, 1958The production for the first 24 hours was 0 barrels of fluid of which _____% was oil; _____% emulsion; _____% water; and _____% sediment. Gravity, °Bé. _____

If gas well, cu. ft. per 24 hours _____ Gallons gasoline per 1,000 cu. ft. of gas _____

Rock pressure, lbs. per sq. in. _____

EMPLOYEES

O. E. Wood, Driller R. H. Plummer, Driller
D. H. Dillard, Driller _____, Driller

FORMATION RECORD

FROM—	TO—	TOTAL FEET	FORMATION
0	10	10	Blow sand & caliche
10	365	355	Red beds
365	485	120	Anhydrite
485	560	75	Red Shale & anhydrite
560	1065	505	Salt - potash & anhydrite breaks
1065	1240	185	Anhydrite - salt & shale stringers
1240	1290	50	Sand and shale
1290	2005	715	Anhydrite w/shale & salt breaks
2005	2027	22	Water sand
2027	2245	218	Anhydrite - shale & lime stringers
2245	2285	40	Sand - 3 bailers water/hr.
2285	2300	15	Anhydrite
2300	2307	7	Sand: show of gas
2307	2505	198	Anhydrite - sand & shale breaks
2505	2605	100	Lime
2605	2700	95	Anhydrite - shale breaks
2700	2740	40	Lime
2740	2755	15	Anhydrite & sand
2755	2775	20	Red Sand & Lime
2775	2798	23	Gray sand
2798	2801	3	White Lime
Sample Tops:	2801	T. D.	
Top Salt	570	Queen P.	2015
Base Salt	1080	Premier	2755
Yates	1240	San Andres	2798

