

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-10

Revised March 25, 19

WELL API NO.
30-015-21769

5. Indicate Type of Lease

STATE ☒ FEE ☐


6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

Empire Abo Unit "G"

8. Well No.
G-321

9. Pool name or
ABO Wildcat

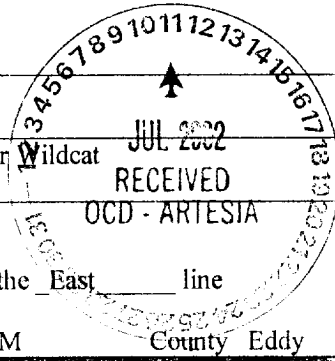

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator BP America (ARCO)

9. Address of Operator P.O. Box 1089 Eunice, NM 88231

10. Well Location

Unit Letter I : 1520 feet from the South line and 250 feet from the East line

Section 33 Township 17S Range 28E NMPM County Eddy

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
KB 10' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Work will commence as soon as a plugging crew is available.

1. NU BOP
2. POH w/tbg. & pkr.
3. TIH w/5 1/2" CIBP & set @ 5770'. Cap w/25 sxs. cmt.
4. Circulate hole w/ 9.5# salt gel mud.
5. PUH w/tbg. & spot 25 sxs. cmt. From 3511 to 3411. Top of Glorieta.
6. PUH w/ tbg. & spot 35 sxs. cmt. From 600' to 500' across 8 5/8 csg. shoe. WOC & TAG.
7. PUH w/tbg. & spot 25 sxs. cmt. Plug from 450' to 350'. Top of Yates.
8. PUH to 60' and spot 10 sxs. cmt surface plug.
9. Cut off wellhead & anchors 3' BGL. Clean up location.
10. Set dry hole marker.

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE M. Kent Whitmire TITLE Operational Specialist DATE 7-7-2002

Type or print name M. Kent Whitmire Telephone No. 505-677-3642


(This space for State use)

APPROVED BY [Signature] DATE JUL 15 2002

Conditions of approval, if any:

Empire Abo Unit 'G' 321

Potential
Perforation
Zones

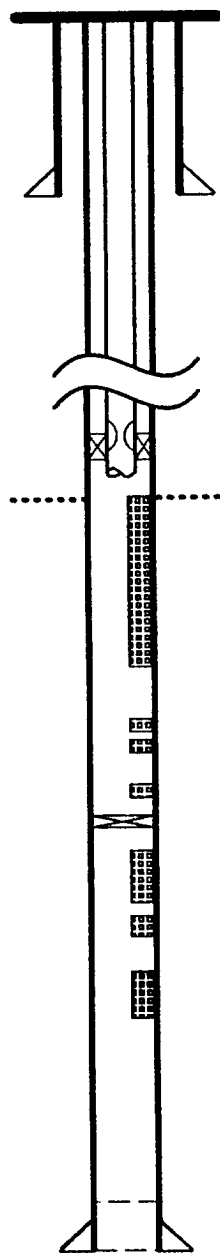

--- KB at 3674' above sea level (Used as the Datum)
Well is currently shut in

--- Top of Cement at surface

--- 8-5/8" - 24# casing set at 550' (11' hole)

--- PKR set at 5780', SN set at 5772'
Tubing: 186jts (5760'), 2 3/8", 4.7#, EUE 8rd, J-55
--- Top of Abo at 5821

--- Perforations 5820' - 5950'

--- Perforations 5990' - 6000'
--- Perforations 6006' - 6016'

--- Perforations 6040' - 6050'
--- CIBP set at 6070'

--- Perforations 6090 - 6130' Closed off w/ CIBP

--- Perforations 6140 - 6156' Closed off w/ CIBP

--- Perforations 6183 - 6218' Squeezed off

--- PBTD at 6353'

--- 5-1/2" - 14# / 15.5# casing set at 6401 (7 7/8" hole)

