Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department




DISTRICT I P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION

WELL API NO. 30-015-21963

P.O. Box 2088 Santa Fe, New Mexico 8790412088 **DISTRICT II** P.O. Drawer DD, Artesia, NM 88210 5. Indicate Type of Lease STATE FEE APR 3 0 1991 DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil & Gas Lease No. O.C.D. SUNDRY NOTICES AND REPORTS ON WELASSESIA, OFFICE (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Type of Well: OAS WELL EMPIRE ABO UNIT "F" WILL KX OTHER 2. Name of Operator 8. Well No. 361 ARCO OIL AND GAS COMPANY 3. Address of Operator 9. Pool same or Wildcat EMPIRE ABO BOX 1710, HOBBS, NEW MEXICO 88240 4. Well Location EAST 1270 $\underline{}:\underline{1765}$ Feet From The NORTH Unit Letter H Line and Feet From The Line **EDDY** 34 17S 28E thip 17S Range 28E 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Township NMPM Section 3668.2' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB TEMPORARILY ABANDON OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. TA & HOLD WELL BORE FOR FIELD BLOW DOWN TD 6350'; PERFS: 6068-6074' POH w/TBG, MIRU. DDPU ND WH NU BOP. PICK UP 3 JTS TBG. TAG UP IN WELL. 4/18/91 S.N. AND PKR. SDON. RIH w/CIBP, RUNNING TOOL, AND TBG. SET CIBP. POH w/1 JT 4/19/91 WELL DEAD. R/U KILL TRUCK. PUMP 150 BARRELS 8.6# BRINE w/WT675 CHEMICAL. WOULD NOT CIRC. POH w/TBG AND CIBP RUNNING TOOL. RIH w/BAKER MODEL "R" PKR AND TAG CIBP. PULL UP 8'. SET PKR w/12000# COMPRESSION. TBG. PRESSURE UP ON CIBP TO 500#. SHOWED PUMP DOWN TBG. RU KILL TRUCK. 4/22/91 R.O. NO LOSS IN PRESSURE. WITH PACK SET LOADED CSG PRESSURE UP TO 500#. SHOWED NO LOSS IN PRESS. RELEASED PKR. PRESS WELL BORE TO 560#. SHOWED NO LOSS IN PRESS. POH w/TBG AND PKR LAYING DOWN IN SINGLES. ND BOP NU W/H w/1 JT ON W/H I hereby certify that the information above is true and complete to the best of my knowledge and belief. FLANGE. CIBP @ 6050.05 . TEST CHART ATTACHED Administrative Supervisor DATE 4/30/91 SIGNATURE TELEPHONE NO. 392-1600 TYPE OR PRINT NAME Cogburn James (This space for State Use)

CONDITIONS OF ATTROVAL, IF ANY

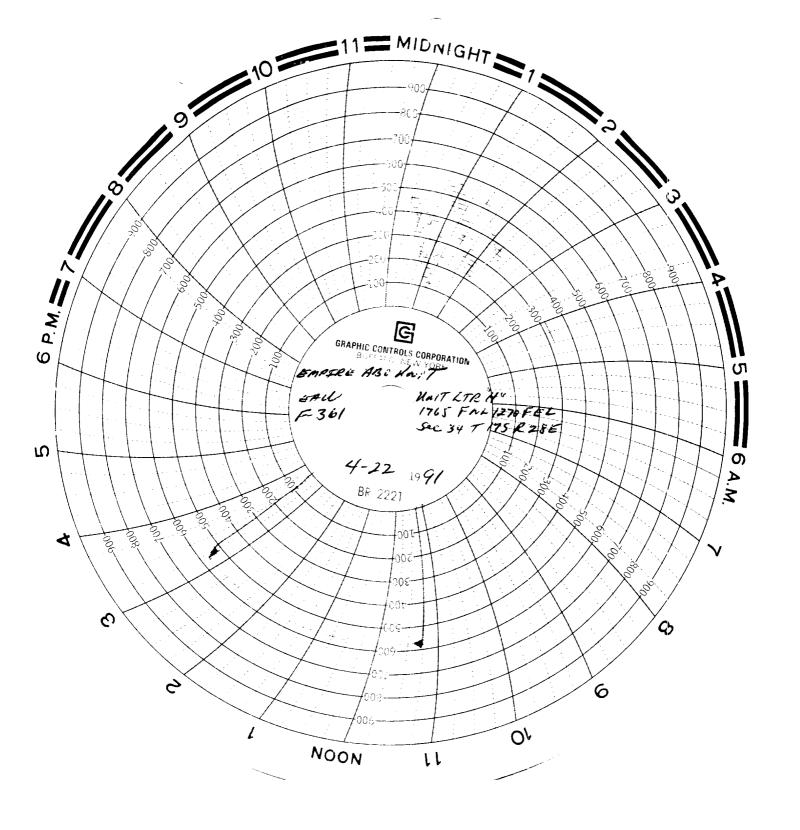

APR 3 0 1991 O. C. D.

Kiloseo Testeo Testeo