

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

AUG 21 '90

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-22818
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator ARCO OIL AND GAS COMPANY		6. State Oil & Gas Lease No. 647
3. Address of Operator BOX 1710, HOBBS, NEW MEXICO 88240		7. Lease Name or Unit Agreement Name EMPIRE ABO UNIT "E"
4. Well Location Unit Letter <u>B</u> : <u>959</u> Feet From The <u>NORTH</u> Line and <u>2400</u> Feet From The <u>EAST</u> Line Section <u>35</u> Township <u>17S</u> Range <u>28E</u> NMPM <u>EDDY</u> County		8. Well No. 392
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3685.5' GR		9. Pool name or Wildcat EMPIRE ABO

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: TEMPORARILY ABANDON ☒	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TA & HOLD WELL BORE FOR FIELD BLOW DOWN

TD 6320'; PBD 6276'; Perfs: 6244-54'

8/09/90 MIRU. DDP. Well dead. N/D W/H N/U BOP. Pickup 6 jts tbg. RIH to tag bottom. Unset pkr. RIH w/6 jts tbg. Tag up @ 6276'. POH w/tbg, Kobe cavity and pkr. SDON.

8/10/90 R.O. Well dead. RIH w/tbg, CIBP running tool and CIBP. Set CIBP. POH w/1 jt tbg. R/U pump truck, circulate well w/8.6# brine w/WT-675 chemical. Close BOP and csg valve. Pressure up to 500#. Held for 15 mins. w/no loss in pressure. (Chart attached.) R/O pump truck. POH w/tbg and CIBP running tool laying down in singles. Left 1 jt tbg on W/H flange. RDCL. CIBP set @ 6227.50'.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE James D. Cogburn TITLE Administrative Supervisor DATE 8/20/90
TYPE OR PRINT NAME James D. Cogburn TELEPHONE NO. 392-3551

(This space for State Use)

APPROVED BY Ray W. Williams TITLE OIL AND GAS INSPECTOR DATE 8/24/90
CONDITIONS OF APPROVAL IF ANY:

This Approval of Temporary
Abandonment Expires

8/10/95

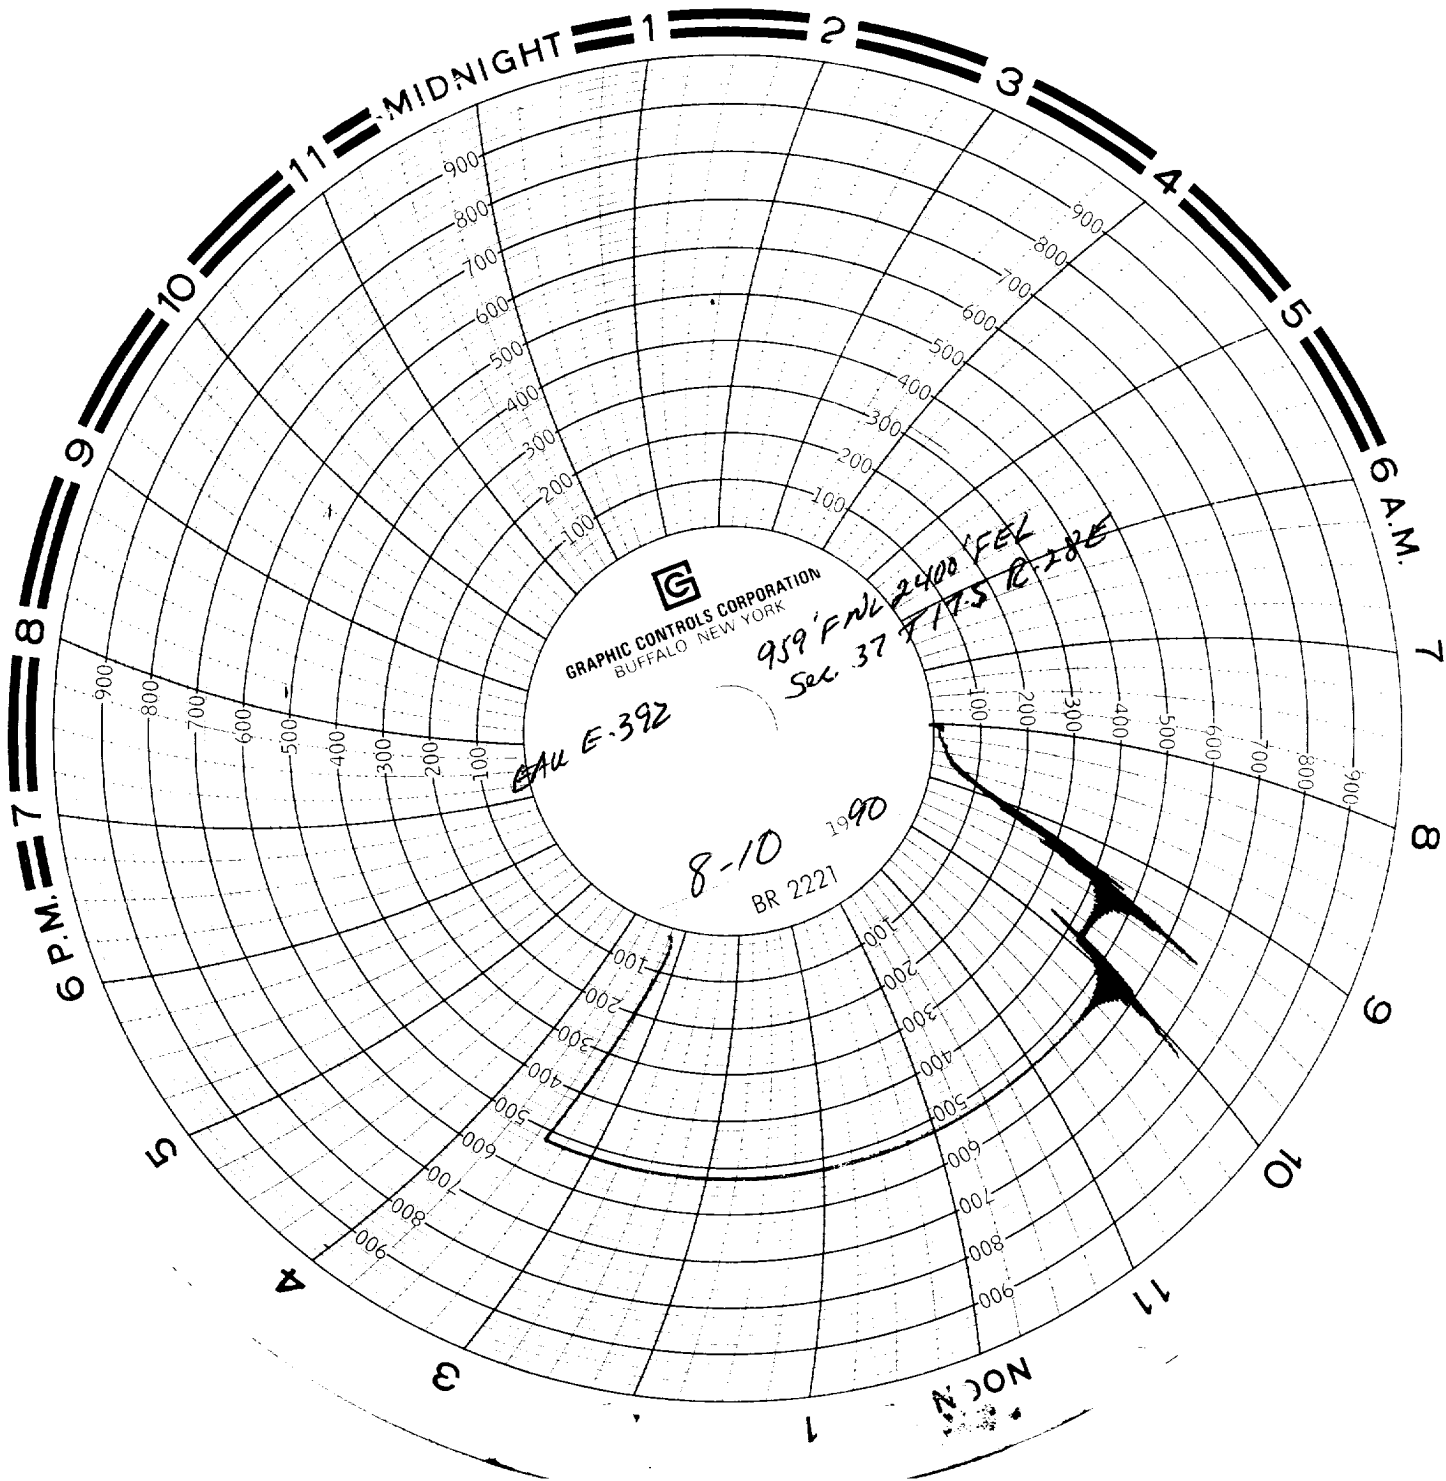

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

EAL E-392

8-10 1990
BR 2221

959 FNL 2400 FEL
Sec. 37 17.5 R-28E

NOON

RECEIVED

AUG 21 '90

Dr. C. D. Fisk
ANTHROPOLOGICAL OFFICE