

CIS  
OP

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

## OIL CONSERVATION DIVISION

2040 Pacheco St.  
Santa Fe, NM 87505

WELL API NO. 30-015-27286
Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
State Oil & Gas Lease No. E-379-4
Lease Name or Unit Agreement Name Chalk Bluff 36 State
Well No. 1
Pool name or Wildcat Logan Draw Atoka

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	
Name of Operator Mewbourne Oil Company /	
Address of Operator PO Box 5270, Hobbs, New Mexico 88241	
Well Location Unit Letter <u>M</u> : <u>660</u> Feet From The <u>South</u> Line and <u>990</u> Feet From The <u>West</u> Line Section <u>36</u> Township <u>17S</u> Range <u>R28E</u> NMPM <u>Eddy</u> County	
Elevation (Show whether DF, RKB, RT, GR, etc.) 3635' GL	

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

### SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ANBANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: PB Atoka. Test & plug off Canyon. Test & Produce Wolfcamp ☒

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

6/28/01... POOH w/ tbq. RIH w/ 4 1/2" CIBP & set @ 9400'. Dump 35' cement on plug. New PBTD @ 9365'. Test to 1000 psi. OK. Perforate Canyon @ 8528-72' (12'. 2 spf. 24 holes). Acidize w/ 2100 gals 20% Ne-Fe & ball sealers. Swab test.

7/05/01...POOH. RIH & set 7" RBP @ 8300'. Load & test to 1000 psi. OK. New PBTD @ 8300'. Perforate Wolfcamp @ 7164-7277' (29'. 2 spf. 58 holes). GIH w/ tbq. Acidize perfs w/ 5000 gals 20% Ne-Fe & ball sealers. Swab test.

7/16/01...POOH w/ test equipment. Run tbq & rods & put well on production.

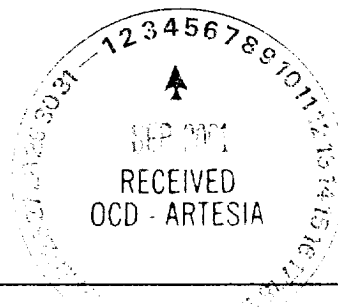

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE N.M. Young TITLE District Manager DATE 08-24-01  
TYPE OR PRINT NAME N.M. Young TELEPHONE NO. 505-393-5905

(This space for State Use)

APPROVED BY [Signature] TITLE DISTRICT II SUPERVISOR DATE SEP 6 2001

CONDITIONS OF APPROVAL, IF ANY: