

YATES PETROLEUM CORPORATION
Martin ARH #1
Section 27-T17S-R26E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

off RBP. Pulled up and set RBP at 8391'. Tested RBP to 2500 psi. TOOH. Shut well in.


3-21-98 - Rigged up wireline with full lubricator. TIH with 4" casing guns and perforated 8327-8333' w/28 .42" holes (4 SPF - Atoka). TOOH with casing guns and rigged down wireline and lubricator. TIH with packer and tubing. Nippled down BOP and riser. Nippled up tree. Set packer at 8260'. Swabbed tubing dry. Rigged up treesaver. Acidized perforations 8327-8333' with 1000 gallons 7-1/2% iron control acid with 1000 scf/bbl N2. Flowed back to tank. Shut well in.

3-22-23-98 - Bled down to pit. Swabbed & flowed. Shut well in.

3-24-98 - Bled well down. Swabbed & flowed. Bled well down. Pumped 50 bbls 2% KCL down tubing. Released packer. Nippled down tree. Nippled up BOP and riser. TIH and latched onto RBP. Pulled up to 8260' and set RBP. Tested RBP to 3000 psi, OK. TOOH. Shut well in.

3-25-98 - Rigged up wireline with full lubricator. TIH with 4" casing guns and perforated 8202-8210' w/36 .42" holes (4 SPF - Strawn). TOOH with casing guns. Rigged down wireline and lubricator. TIH with packer and tubing. Nippled down BOP and riser. Nippled up tree. Set packer at 8134'. Swabbed well down. Rigged up treesaver. Acidized perforations 8202-8210' with 1000 gallons 7-1/2% iron control HCL acid with 1000 scf/bbl N2. Flowed to tank. Shut well in.

3-26-98 - Flared well down to pit. Swabbed & flowed. Shut well in. Released well to production department.

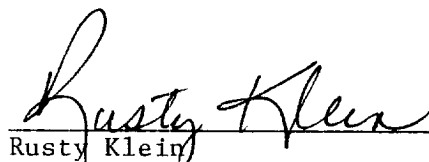

Rusty Klein
Operations Technician
March 27, 1998