

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N.M. O' Cons. Division  
811 S. 1st Street  
Artesia, NM 88210-2834

FORM APPROVED  
OMB No. 1004-0135  
Expires July 31, 1999

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.*

**SUBMIT IN TRIPLICATE - Other instructions on reverse side**

1. Type of Well  
☐ Oil Well ☐ Gas Well ☒ Other Dry

2. Name of Operator  
OXY USA INC.

3a. Address  
P.O. BOX 50250  
MIDLAND, TX 79710-0250

3b. Phone No. (include area code)  
16696  
915-685-3717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
880 FSL 1140 FEL SESE (P) Sec 35 T16S R31E

5. Lease Serial No.  
LC029438A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement Name and/or No.

8. Well Name and No.  
Oxy Liberator Federal #1

9. API Well No.  
30-015-30979

10. Field and Pool, or Exploratory Area  
Four Morrow, NE



11. County or Parish, State  
EDDY NM

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other <u>Spud, Set</u>
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	<u>Csg &amp; Cmt</u>
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	<u>P&amp;A</u>

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

See other side

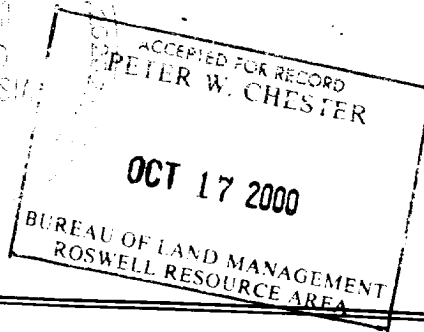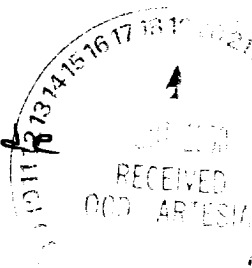

14. I hereby certify that the foregoing is true and correct  
Name (Printed/Typed)

DAVID STEWART

Title

REGULATORY ANALYST

Signature

[Signature]

Date

8/28/00

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Office

Date

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)

ATTACHMENT 3160-5  
OXY USA INC.  
OXY LIBERATOR FEDERAL #1  
SEC 35 T16S R31E  
EDDY COUNTY, NM

NOTIFIED BLM 6/26/00 OF SPUD. MIRU UTI #207, SPUD WELL @ 1245hrs MDT 6/27/00. DRILL 17-1/2" TO TD @ 815', 6/29/00, PUMP SWEEP. RIH W/ 13-3/8" 48# H40 CSG & SET @ 815'. M&P 436sx 65:35 C/POZ W/ 6% BENTONITE + 2% CaCl<sub>2</sub> + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl<sub>2</sub>, DISP W/ FW, PLUG DOWN 6/29/00, CIRC 150sx CMT TO PIT, WOC-4hrs. DUNCAN WHITLOCK-BLM NOTIFIED AND WITNESSED CSG & CMT JOB. CUT OFF CASING, WELD ON STARTING HEAD, TEST TO 500#, OK. NU BOP & CHOKE MANIFOLD, TIH W/ BIT & BHA, TEST CASING & HYDRIL TO 500#, OK. TOTAL WOC-18hrs. RIH & TAG, DRILL OUT & DRILL AHEAD 6/30/00.

DRILL 12-1/4" HOLE TO TD @ 4525' 7/7/00. RIH W/ 9-5/8" 36# K55 CSG & SET @ 4523'. M&P 2033sx 65:35 C/POZ W/ 6% BENTONITE + .25#/sx CELLOFLAKE + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2% CaCl<sub>2</sub> DISP /FW, PLUG DOWN 7/8/00, CIRC 300sx CMT TO PIT, WOC-6hrs. BLM NOTIFIED OF CMT JOB & BOP TEST, DID NOT WITNESS. CUT OFF CSG & INSTALL B SEC, TEST TO 2000#, OK. NU BOP, TEST TO 5000#, OK. TEST CSG, MUD LINE & ANNULAR TO 2500#, OK. NU ROTATING HEAD, RIH & DO CMT & SHOE, DRILL NEW FORMATION, TEST CSG, OK. DRILL AHEAD 7/9/00.

DRILL 8-3/4" HOLE TO TD @ 12535', 8/6/00, PUMP SWEEP & CHC, REC BLM APPR TO DRILL BELOW PERMIT DEPTH. RIH W/ OPEN HOLE LOGS, POOH, CIRC WHILE W/O INSTRUCTIONS. JOE LARA-BLM APPROVED P&A PROCEDURE. RIH OE DP TO 11960', SPOT 85sx CL H CMT. POOH TO 11340', SPOT 90sx CL H CMT. POOH TO 8750', SPOT 70sx CL H CMT. POOH TO 7250', SPOT 70sx CL H CMT. POOH TO 6665', SPOT 60sx CL C CMT. POOH TO 4573', SPOT 60sx CL C CMT W/ 4% CaCl<sub>2</sub>, WOC-3hrs. RIH & TAG @ 4423', POOH TO 865', SPOT 30sx CL C CMT, POOH W/ DP. SPOT 10sx CL C SURFACE PLUG. BLM NOTIFIED BUT DID NOT WITNESS PLUGGING & TAGGING. JET & CLEAN PITS, ND BOP, REL RIG @ 1000hrs MDT 8/10/00, WELL P&A'D.

