

NM OGD - Artesia

0151

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
Budget Bureau No. 1004-0115
Expires: September 30, 1990

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator


MARBOB ENERGY CORPORATION

3. Address and Telephone No.

P. O. Drawer 227, Artesia, NM 88210

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2615 FSL 1295 FEL Sec. 26-T17S-R-29E Unit I

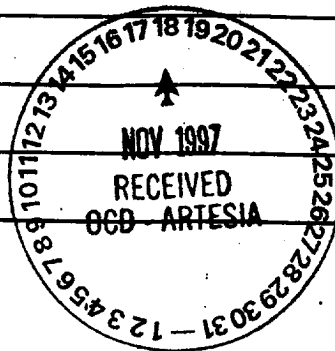

5. Lease Designation and Serial No.

LC-028784B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

Burch Keely Unit

8. Well Name and No.

Burch Keely Unit #178

9. API Well No.

30-015-03125

10. Field and Pool, or Exploratory Area

GRBG Jackson SR Q GRBG

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
- ☐ Subsequent Report
- ☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
- ☐ Recompletion
- ☐ Plugging Back
- ☐ Casing Repair
- ☐ Altering Casing
- ☐ Other

- ☐ Change of Plans
- ☐ New Construction
- ☐ Non-Routine Fracturing
- ☐ Water Shut-Off
- ☐ Conversion to Injection

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Notify BLM of intention to abandon well
2. M.I.R.U. hoist, N/U BOPE 35'
3. Set 7" CIBP @ 2825' w/20" cement cap
4. R.I.H. & circulate hole full w/9.8# mud
5. P.O.H. & spot 30 sx cement from 2728' to 2628'
6. POH & spot 30 sx cement fm 2318' to 2218'
7. POH & spot 30 sx cement fm 1978' to 1878'
8. POH & cut 7" @ 1700'± tor
9. RIH & spot stub plug from 1750 - 1650 w/60 sx tag woc teg
10. POH to 843 & spot 60 sx cement woc tag top @ 743'
11. POH to 450 & spot 60 sx cement to 350 woc & tag
12. RIH to 260 & spot 30 sx cement to 160
13. Spot 10 sx cement to surface from 30' 50'
14. ND BOP, cut off wellhead & install dry hole marker / R.D.M.O.

14. I hereby certify that the foregoing is true and correct.

Signed

Title

Date

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

See attached Conditions & above changes.