

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPL
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

ASF

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER SALT WATER INJECTION WELL		5. LEASE DESIGNATION AND SERIAL NO. 8910138010 NM 29281	
2. NAME OF OPERATOR ARCO OIL AND GAS COMPANY		6. IF INDIAN, ALLOTTEE OR TRIBE NAME SJS	
3. ADDRESS OF OPERATOR P. O. BOX 1710, HOBBS, NEW MEXICO 88240		7. UNIT AGREEMENT NAME EMPIRE ABO UNIT "C"	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 2310 FSL - 330 FWL (UNIT LETTER L)		8. FARM OR LEASE NAME	
14. PERMIT NO. 30-015-03185		9. WELL NO. 49	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3640' DF		10. FIELD AND POOL, OR WILDCAT EMPIRE ABO	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA SEC. 29, T17S, R29E	
		12. COUNTY OR PARISH EDDY	
		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐
☐

REPAIRING WELL

☐
☐
☐
☐

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other) REPAIR TBG LEAK

X

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

TD 6294'; PBD 6290'; PERFS: 6247-82'; PKR 6231'
NOTIFY STATE TO WITNESS PKR TEST

9/18/91 RU. SET BOP. PULLED ON TBG 2-3 PTS TO UNSET STINGER. HOOKED UP SCANALOG. LOG 202 TBG. LAYED DOWN 55 BAD JTS. TOOK STINGER (OTIS J LATCH #212B5515) TO OTIS ENGINEERING CORP. TO REDRESS. HOLE WAS IN #58 JT FROM SURFACE.

9/20/91 RUN TBG BACK IN HOLE. PUT 100 BBLs 8.6 BRINE w/15 GALS OF WT-675 PER 100 BBLs DOWN TBG. IT WAS ON VACUUM. SET STINGER. PUMPED DOWN CSG TO FILL. TOOK 30 BBLs. PRESSURE TESTED 300# FOR 15 MIN. CUT CHART FOR "STATE". RIGGED DOWN.

RECEIVED
OCT 21 11 07 AM '91
CARLSBAD RESOURCE
AREA HEADQUARTERS

18. I hereby certify that the foregoing is true and correct

SIGNED

[Signature]

TITLE Operations Coordinator


DATE 9/25/91

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

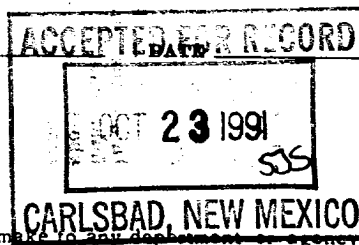

*See Instructions on Reverse Side

