


Sub-3 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

CISF
ep

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-03190
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator B-P America Production Co.		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 1089 Eunice, New Mexico 88231		7. Lease Name or Unit Agreement Name: Empire Abo Unit
4. Well Location Unit Letter <u>L</u> : 1980 feet from the South line and 330 feet from the West line Section 30 Township 17S Range 29E NMPM Eddy County		8. Well No. C-45
10. Elevation (Show whether DR, RKB, RT, GR, etc.) KB 11'		9. Pool name or Wildcat Abo

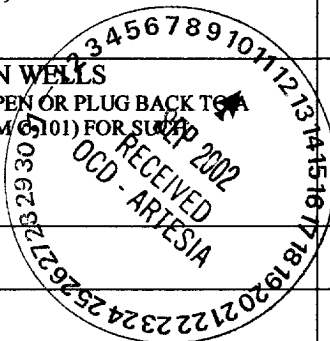

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Procedure to P&A well. CIBP @ 6178' capped with 50' cement. Casing has holes & corrosion from 5526' to 4077' and may be parted at 3990 feet.

- (1) RU & ND W.H. & NU BOP.
- (2) PU & RIH w/tbg. Tag CIBP @ 6178'.
- (3) Circulate hole w/9.5# salt gel mud.
- (4) PUH w/tbg. to 3990' & spot 25 sxs. cmt to 3890'. WOC & Tag.
- (5) PUH w/tbg. & spot 35 sxs. cmt. from 807' to 707'. Covers shoe & top of Yates. WOC & Tag.
- (6) PUH w/tbg. to 60' & spot 10sx. Cmt. plug to surface.
- (7) Cut off well head & anchors 3' BGL.
- (8) Set dry hole marker & clean up location.


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kelvin D. Murrish TITLE Asst. Admin Asst. DATE 09.09.02
Type or print name Kelvin D. Murrish Telephone No. 505.394.1649
(This space for State use)

APPROVED BY [Signature] TITLE Field Rep ID DATE SEP 18 2002
Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET (2 STRING CSNG)

OPERATOR B-P America
 LEASENAME Empire The Unit
 Unit Ltr. L WELL # C-45
 SECT 30 TWN 17 S RNG 29 E
 FROM 1980 M/S L 330 #W/L
 TD: 6350 FORMATION @ TD
 PBTD: 6345 FORMATION @ PBTD

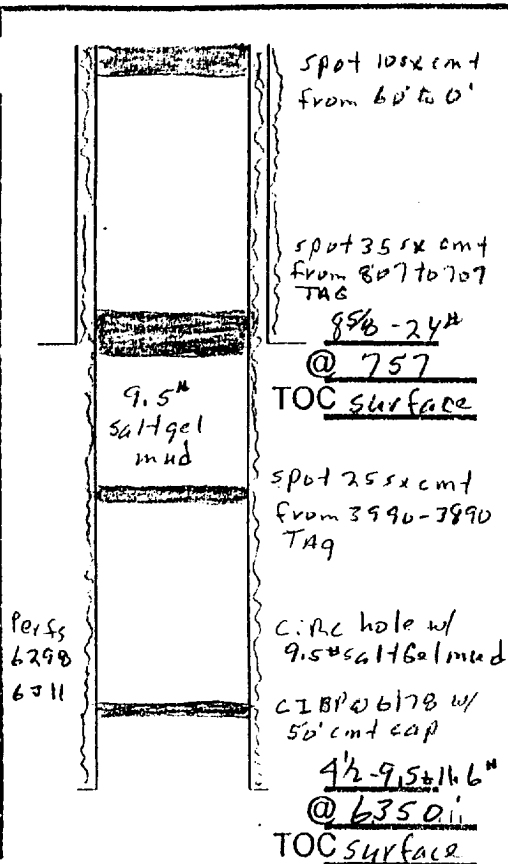

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	8 3/4	757	surface	C.I.R. top of
INTMED 1	4 1/2	6350	surface	C.I.R. 9-25-88
INTMED 2				
PROD				
	SIZE	TOP	BOT	TOC DETERMINED BY
LINER 1				
LINER 2				
	CUT & PULL @		TOP - BOTTOM	
INTMED 1			PERFS	6270 - 6288
INTMED 2				6298 - 6311
PROD				

*REQUIRED PLUGS DISTRICT I

RUSTLER (ANYID)	
YATES	800'
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPITAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
GLORIETA	3990
GLINEDRY	
TUBB	
DRINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOKA	
MORROW	
M/S	
DEVONIAN	

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	35 SXS	6400'
PLUG #2	SHOE	50 SXS	5550'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #4	CIBP	25 SXS	4800'
PLUG #5	STUB	50 SXS	3600'-3700'
PLUG #6	RETNR SQZ	200 SXS	400'
PLUG #7	SURF	10 SXS	0-10'
PLUG #1	CIBP	50"	6178-6128
PLUG #2	Glorieta	255x	3990-3890
PLUG #3	shoe + yates	35 x	807-707
PLUG #4	surface	105x	0-60'
PLUG #5			
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			

P&A' well

TD 6350